THIRD SEMI-ANNUAL VRP PROGRESS REPORT
FOR THE
THOMASVILLE NATIONAL BANK (FORMER ROSE CITY CLEANERS) PROPERTY
THOMASVILLE, THOMAS COUNTY, GEORGIA
HSI# 10902

PROJECT NUMBER 3151

DOCUMENT PREPARED FOR:

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA 31792

DOCUMENT PRESENTED TO:

GEORGIA ENVIRONMENTAL PROTECTION DIVISION
HAZARDOUS WASTE MANAGEMENT BRANCH
2 MARTIN LUTHER KING, JR. DRIVE, SE, SUITE 1154
ATLANTA, GEORGIA 30334-9000

DOCUMENT PREPARED BY:

PEACHTREE ENVIRONMENTAL
3000 NORTHWOODS PARKWAY, SUITE 105
NORCROSS, GEORGIA 30071
PHONE (770)449.6100 · FAX (770)449.6119
WWW.PEACHTREEENVIRONMENTAL.COM

AUGUST 2014

THE INFORMATION CONTAINED IN THIS REPORT TITLED

ñ**THIRD SEMIANNUAL VRP PROGRESS REPORT FOR THE**
THOMASVILLE NATIONAL BANK (FORMER ROSE CITY CLEANERS) PROPERTY
THOMASVILLE, THOMAS COUNTY, GEORGIA"
HSI#10902

DOCUMENT PREPARED BY:

THOMAS A. LAWRENCE, PG, *PROJECT MANAGER*

DOCUMENT REVIEWED BY:

JOHN P. MARTINIERE, JR., P.E., *PROJECT DIRECTOR*

CHARLES H. MACPHERSON, JR., *TECHNICAL DIRECTOR*

August 2014

2014 Peachtree Environmental

THIRD SEMIANNUAL PROGRESS REPORT
FOR THE
THOMASVILLE NATIONAL BANK (FORMER ROSE CITY CLEANERS) PROPERTY
THOMASVILLE, THOMAS COUNTY, GEORGIA"
HSI#10902

TABLE OF CONTENTS

1.0 INTRODUCTION AND BACKGROUND 5
1.1 Introduction 5
1.2 VRP Property Description 5
1.3 Property Background 5
1.3.1 Historic Property Use 5
1.3.2 Initial HSRA Release Notification 6
1.3.3 Listing on the Georgia Hazardous Site Inventory 6
1.3.4 Compliance Status Report and Corrective Action Plan 7
1.3.5 Voluntary Remediation Program Application and Approval 7
1.3.6 November 2013 Supplemental Soil and Groundwater Investigation 7
2.0 PRELIMINARY CONCEPTUAL SITE MODEL 9
2.1 Surface and Sub-surface Setting 9
2.1.1 Surface Setting 9
2.1.2 Subsurface Setting 9
2.2 Known or Suspected Source Areas 10
2.3 Contaminant Migration Pathways 10
2.4 Soil and Groundwater Impacts 12
2.4.1 Soil Impacts 12
2.4.2 Groundwater Impacts 12
2.5 Regulated Substances 12
2.5.1 Constituents of Concern in Soil 12
2.5.2 Constituents of Concern in Groundwater 13
3.0 JUNE 2014 SEMIANNUAL GROUNDWATER MONITORING 15
3.1 Groundwater Elevations 15
3.2 Well Purging 15
3.3 Sampling Procedures 16

3.4 Decontamination Procedures 16
3.5 Analytical Results 16
3.6 Groundwater Delineation Standards 17
4.0 PRELIMINARY REMEDIATION PLAN 19
5.0 PROFESSIONAL CERTIFICATION 21

LIST OF FIGURES

Figure 1 Property Location / USGS Topographic Map
Figure 2 Property Layout Map
Figure 3 Water Table Map ï June 22, 2014
Figure 4 Suspected Source Area Location Map
Figure 5 CSM ï Cross-Section Location Map
Figure 6A CSM ï Cross-Section (A ï Aô)
Figure 6B CSM ï Cross-Section (B ï Bô)
Figure 6C CSM ï Cross-Section (C ï Cô)
Figure 9 VOCs Impacts in Groundwater ï June 2014
Figure 10 PCE Concentration Map ï June 2014
Figure 11 TCE Concentration Map ï June 2014
Figure 12 cis-DCE Concentration Map ï June 2014
Figure 13 Benzene Concentration Map ï June 2014

LIST OF TABLES

Table 1 Summary of Groundwater Elevations
Table 2 Summary of Soil Analytical Results ï August 2009 ï September 2011
Table 3 Summary of Soil Analytical Results ï November 2013
Table 4 Summary of Groundwater Analytical Results
Table 5 Summary of Groundwater MNA Results

LIST OF APPENDICES

Appendix A November 2013 Soil Laboratory Analytical Report
Appendix B June 2014 Groundwater Laboratory Analytical Report
Appendix C Monitoring Well Purging and Sampling Information Sheets
Appendix D Summary of Professional Certification Hours

ACRONYMS

AES	Analytical Environmental Services, Inc.
Applicant	Thomasville National Bank (TNB)
bgs	Below Ground Surface
bls	Below Land Surface
CAP	Corrective Action Plan
cis-DCE	cis-1,2-Dichloroethene
CSR	Compliance Status Report
COCs	Constituents of Concern
COPC	Constituent of Potential Concern
CSM	Conceptual Site Model
Georgia EPD	Georgia Environmental Protection Division
HSI	Hazardous Site Inventory
HSRA	Hazardous Site Response Act
IRIS	Integrated Risk Information System
MCL	Maximum Contaminant Levels
ε g/L	Micrograms per Liter
mg/Kg	Milligrams per Kilogram
mg/L	Milligrams per Liter
NC	Notification Concentration
Peachtree	Peachtree Environmental
PCE	Tetrachloroethene
POD	Point of Demonstration
PRE	Preliminary Risk Evaluation
Property	Thomasville National Bank
RAGS	Risk Assessment Guidance for Superfund
RBCA	Risk Based Corrective Action
RN	Release Notification
RRS	Risk Reduction Standard
SVE	Soil Vapor Extraction
SVOCs	Semi-Volatile Organic Compounds
TCLP	Toxicity Characteristic Leaching Procedure
TCE	Trichloroethene
USEPA	United States Environmental Protection Agency
USGS	United States Geological Survey
VIRP	Voluntary Investigation and Remediation Plan
VRP	Voluntary Remediation Program
VOCs	Volatile Organic Compounds

1.0 INTRODUCTION AND BACKGROUND

1.1 INTRODUCTION

PEACHTREE ENVIRONMENTAL (Peachtree) is submitting this Voluntary Investigation and Remediation Plan (VIRP) Semiannual Progress Report on behalf of **THOMASVILLE NATIONAL BANK** (TNB), for the Thomasville National Bank (former Rose City Cleaners) property located at 301 North Broad Street, in Thomasville, Thomas County, Georgia (the ñVRP Propertyò); HSI #10902 (the ñSiteò). The report serves as the third VIRP Semiannual Progress Report and details activities conducted since acceptance into the Voluntary Remediation Program (VRP) in February 2013. Since the submittal of the 2nd Semiannual Progress Report, the Thomas County Courthouse Property has enrolled as part of the VRP Property.

1.2 VRP PROPERTY DESCRIPTION

The VRP Property has a latitude coordinate of 30° 50' 21.63" North and a longitude coordinate of 83° 58' 56.80" West. A VRP Property Location / USGS Topographic Map is included as **Figure 1**. The VRP Property consists of two parcels of land totaling approximately 1.52 acres, as follows:

- 301 North Broad Street - Parcel ID: 005 006004 (1.0 Acres); and
- 325 North Broad Street - Parcel ID: 005 006003 (0.52 Acres).

The 301 North Broad Street parcel consists of the main TNB building with walk-up and drive through teller services and administrative offices; 325 North Broad Street is occupied by the TNB Financial Services building. Previously, from the 1970s to 1990s, the Site was occupied by an automotive service station and the pick-up/drop-off Rose City Dry Cleaners. The Site is bordered by:

- North - Broad Street with commercial establishments beyond;
- East - Washington Street and a City of Thomasville government complex beyond;
- South - North Madison Street with commercial and governmental complexes; and
- West - Undeveloped and commercial properties to the West.

A VRP Property Layout Map is provided as **Figure 2**.

1.3 PROPERTY BACKGROUND

1.3.1 Historic Property Use

The VRP Property reportedly operated as a gasoline service station and dry cleaner from the 1970's to the 1990's. The former Underground Storage Tank (UST) system owner, Mr. Carlos Gay, reported a release of regulated petroleum constituents on May 4, 1995. Corrective action measures were then implemented, which included the removal of two 6,000-gallon and one 4,000-gallon gasoline USTs from a single tank pit, and

excavation and off-site disposal of approximately 370 cubic yards of impacted soils. At a later date, two additional USTs were reportedly removed from a second UST pit on the Property. The size and contents of these USTs are unknown.

The UST release and corrective actions were addressed through the Georgia Underground Storage Tank Management Program (USTMP) branch of the Environmental Protection Division (EPD). The USTMP issued a regulatory status of ñNo Further Actionòfor the UST release on May 31, 2001.

1.3.2 Initial HSRA Release Notification

A Hazardous Site Response Act (HSRA) Release Notification (RN) was filed with the Georgia EPD on April 8, 2008, by Huber Engineering Company, Inc. (Huber) on behalf of Thomas County for the then-proposed Thomas County Courthouse property located south of the TNB facility. This RN was based on the detection of various Volatile Organic Compounds (VOCs) and Lead in groundwater samples collected on the proposed courthouse property.

Based on its review of the initial RN for the proposed courthouse property and subsequent information provided by Huber on June 27, 2008, the Georgia EPD issued TNB a letter dated January 16, 2009, requesting that they file a separate RN. TNB provided a RN for the TNB property dated February 16, 2009. Based on its review of the RN provided by TNB, the Georgia EPD requested in a letter dated May 11, 2009, that TNB prepare and submit a revised RN to include soil and groundwater analytical testing data for volatile organic compounds.

In August 2009, Peachtree was retained by TNB to conduct a subsurface investigation to assess the potential impacts from the former service station and dry cleaner. Five soil borings, completed as monitoring wells, were installed at the center and four corners of the VRP Property. Soil and groundwater samples were collected from them and submitted for analysis of VOCs. There were no VOCs detected in soil above HSRA Notification Concentrations. Seven of the 12 VOCs detected in groundwater exceeded their respective EPA Maximum Contaminant Levels (MCLs) for drinking water. Based on the results of the August 2009 investigation, a revised RN for the TNB property was submitted on October 2, 2009.

1.3.3 Listing on the Georgia Hazardous Site Inventory

On November 10, 2009, the Georgia EPD issued a letter TNB indicating that the TNB property was being placed on the State Hazardous Site Inventory (HSI) as HSI #10902 based on the identification of tetrachloroethene (PCE) in groundwater at levels exceeding the reportable quantity. The Georgia EPD also issued a letter dated November 9, 2009, to the Thomas County Board of Commissioners indicating that the proposed Thomas County Courthouse property was being sub-listed on the HSI as part of the TNB property listing.

1.3.4 Compliance Status Report and Corrective Action Plan

On March 25, 2011, the Georgia EPD issued a letter requesting that a Compliance Status Report (CSR) and compliance certification statement be prepared and submitted for the Site by September 26, 2011, in accordance with Section 391-3-19-.06(3)(a) and 391-3-19-.07 of the Rules. The letter also stated that in lieu of the submittal of a CSR, that a Corrective Action Plan (CAP) could be submitted by the September 26, 2011, submittal deadline. Smith, Gambrell & Russell (SGR), on behalf of TNB, responded in a letter dated May 18, 2011, stating that TNB elected to submit a CAP by the September 26, 2011, deadline.

Field investigations for the CSR/CAP were conducted by Peachtree from August 31 to September 2, 2011, which included sampling of six soil borings (SB-6 to SB11) to augment data collected for the 2009 RN activities, sampling of monitoring wells MW-1 to MW-5, aquifer slug testing, and collection of Monitored Natural Attenuation (MNA) parameter data.

A CSR/CAP report was submitted to the Georgia EPD on September 26, 2011, which provided a Compliance Certification that Site soils met the regulatory criteria for Type 1/3 Residential Risk Reduction Standards (RRS) for soils. In addition, the report provided a corrective action strategy of a 2-year MNA demonstration for addressing groundwater impacts. In June 2012, Peachtree sampled the existing monitoring wells, plus installed and sampled three new monitoring wells (MW-6, MW-7, and MW-8) to horizontally delineate groundwater impacts at the VRP Property. Monitored Natural Attenuation (MNA) parameter data was also collected. Georgia EPD approved the MNA approach on November 1, 2012.

1.3.5 Voluntary Remediation Program Application and Approval

In December 2012, a VIRP and VRP application were submitted for the Site based on the data collected in August 2009, September 2011, and June 2012. The VIRP and VRP application were submitted in place of the Annual Groundwater Monitoring Report, outlined in the 2011 CAP schedule. Georgia EPD approved the VRP Application in February 2013.

1.3.6 November 2013 Supplemental Soil and Groundwater Investigation

In November 2013, Peachtree conducted additional supplemental soil and groundwater investigations, as proposed in the 1st Semiannual VRP Progress Report. Field activities included: collection of 10 soil samples from 8 soil borings installed at suspected source locations at the VRP Property; installation and sampling of five monitoring wells (MW-9, MW-10, MW-11, MW-12, and MW-13) to horizontally delineate groundwater impacts at the VRP Property; sampling of existing monitoring wells MW-1 to MW-8; aquifer slug testing; and, collection of MNA parameter data. The results of these investigations were provided in the 2nd Semiannual VRP Progress Report.

Based on the results of the slug testing and MNA parameter analysis, it was determined that bio-enhancement of the MNA process would be required at the VRP Property. Also,

the potential for intrusion of VOCs by the groundwater-to-indoor-air pathway was evaluated using the U.S. Environmental Protection Agency (EPA) Vapor Intrusion Screening Level (VISL) calculator. The VISL calculator was used to predict indoor air concentrations for each of the detected VOCs, which were then used to calculate the carcinogenic risk and non-carcinogenic hazard associated with the predicted indoor air concentrations. A site-specific evaluation of the vapor-intrusion potential was performed using the Johnson & Ettinger Model. Based on the results of the VISL screening and J&E modelling, none of the COCs concentrations in groundwater would result in an unacceptable risk to human health via the vapor intrusion pathway.

2.0 PRELIMINARY CONCEPTUAL SITE MODEL

A Preliminary 3-D conceptual site model (CSM) has been developed for the VRP Property. The CSM will be utilized to:

- Integrate technical data from various sources;
- Support the selection of sample locations;
- Identify data gaps/needs; and
- Evaluate risks to human health and the environment.

The following provides a description of the various factors (surface / sub-surface setting, regulated substances, known or suspected source areas, contaminant migration pathways, and soil and groundwater impacts) considered during the development of the CSM.

2.1 SURFACE AND SUB-SURFACE SETTING

2.1.1 Surface Setting

The surface setting at the VRP Property consists of one single-story building and one two-story building, both constructed of wood and brick on a concrete slab base. The parking lot and driveway associated with the VRP Property is constructed of asphalt. Grass/landscaped areas are present to the northeast of the bank building. The property is designated for commercial-retail use.

2.1.2 Subsurface Setting

Thomas County, Georgia, is located in the Coastal Plain Physiographic Province of Georgia. The Coastal Plain extends south from the Fall Line, a line traversing across Georgia from Augusta to Macon and west to Columbus. This line is the intersection of the Piedmont providence and historically was a Mesozoic shoreline still marked by a line of sand hills. Most of this area is characterized by broad, flat to level plains underlain by a variety of limestone, minor dolomite, and unconsolidated sediments (phosphatic sand, marl, gravel, sand, clay, and sandy clay). The rocks exposed in the Coastal Plain range from Late Cretaceous to Recent age and consist of alternating layers of sand, clay, and limestone. These sedimentary rocks of the Coastal Plain crop out at progressively younger ages from the Fall Line seaward. The Coastal Plain sediments gently dip to the south and southeast, and thicken in the down dip direction forming wedge-shape strata. The elevations in the Coastal Plain range from approximately 750 feet above mean sea level to sea level on the Atlantic Coast.

According to the Geologic Map of Georgia, Thomas County and the City of Thomasville are underlain by rocks of the Miccosukee Formation. The Miccosukee Formation is a prodeltaic deposit composed of grayish orange to grayish red, mottled, poorly to moderately consolidated, interbedded clay, sand and gravel. The unit is relatively impermeable but is considered a part of the surficial aquifer system.

Topography of the surrounding area slopes slightly towards the southeast. The nearest surface water body, an unnamed tributary to Oguina Creek, is located approximately 1,400 feet west-southwest of the VRP Property.

Soils beneath the VRP Property consist primarily of orange silty clays to clayey silts and white Kaolin-like clays and fine sands to depths of at least 20 feet. The principal water-bearing portion of the shallow aquifer is comprised of a fine to very fine, well sorted sand. Groundwater occurs under water table (unconfined) conditions within the shallow aquifer, with depths to groundwater as measured from the surveyed top of well casings ranging between 3.5 to 26 feet BLS. Groundwater elevations collected August 2009, September 2011, June 2012, June 2013, November 2013, and June 2014 are summarized on **Table 1**. A water table map based on the June 2014 elevation data is included as **Figure 3**.

2.2 KNOWN OR SUSPECTED SOURCE AREAS

The limited historic information available at the time of this report indicates that the Site was formerly utilized as a gasoline retail station and dry cleaner from the 1970's to 1990's. The former UST system Owner, Mr. Carlos Gay, had a reported a release of regulated fuel constituents on May 4, 1995. The UST release was addressed through the Georgia USTMP branch of the EPD. The USTMP issued a regulatory status of õno further actionò for the UST release on May 31, 2001. No information is available on the past dry cleaning operations.

VOCs were detected in soil and groundwater at the Site in several locations. To date, the source of dry cleaner constituent impact in undetermined. VOCs detected in soil appear to be the result of past gasoline service station and dry cleaning operations at the VRP Property. The suspected source areas are depicted on **Figure 4**.

2.3 CONTAMINANT MIGRATION PATHWAYS

A preliminary evaluation of the contaminant migration pathway has been completed and includes the following:

- Vertical migration of PCE from beneath the former dry cleaning equipment, through the concrete floor to the soils below;
- Vertical migration through soils to the water table;
- Horizontal and vertical migration within the shallow water table, based on solubility of PCE, hydraulic properties and flow direction;
- Potential vapor intrusion pathway from contaminated groundwater.

A CSM cross-section location map and associated CSM cross-sections A-Aô, B-Bô, and C-Côare provided as **Figure 5** and **Figures 6A**, **6B**, and **6C**, respectively. A final evaluation of the contaminant migration pathways and associated updates of the CSM will be performed during the implementation of the Preliminary Remediation Plan and included in the VRP CSR.

For the previous 2nd VIRP Semiannual Monitoring Report, Peachtree evaluated the potential for intrusion of VOCs into the overlying buildings by the groundwater-to-indoor-air pathway using the EPAôs VISL calculator. Since monitoring wells MW-2 and MW-5 are located relatively close to the bank building, groundwater beneath the building may contain substances at the concentrations detected from either well. Therefore, the VISL calculator was run using the maximum concentrations from both wells (ñworst-caseò scenario). The screening suggested that the carcinogenic risk for both PCE (5.9×10^{-5}) and ethylbenzene (5.2×10^{-5}) exceeds the threshold of 1×10^{-5}, and that the non-carcinogenic hazard quotient for PCE (16), TCE (1.3), and m&p Xylenes (1.4) exceeds the threshold of 1.

Since the VISL screening indicated that concentrations of PCE, TCE, ethylbenzene, and m&p xylenes in groundwater exceed screening values, site-specific evaluation of the vapor-intrusion potential was performed using the Johnson & Ettinger model. The physio-chemical data and toxicological data for the J&E model were updated with the current values from the Mid-Atlantic Regional Screening Tables; the physio-chemical and toxicological data for total xylenes was used for m&p-xylenes and entered into the J&E model as m-xylene. The following additional model inputs were selected:

- Average soil/water temperature: 19.4°C (same as VISL calculator)
- Depth below grade to bottom of enclosed space floor: 15 cm (J&E default for slab-on-grade buildings)
- Depth below grade to water table: 762 cm (25 feet)
- Soil type: Sandy clay (SC)
- Enclosed space floor length: 2438 cm (80 feet)
- Enclosed space floor width: 1829 cm (60 feet)
- Enclosed space height: 244 cm (J&E default for slab-on-grade buildings)
- Exposure duration: 25 years (HSRA default for non-residential exposure)
- Exposure frequency: 250 days (HSRA default for non-residential exposure)
- Target risk for carcinogens: 1×10^{-5} (HSRA default target)

All other input parameters were J&E model default values, including the conservative 0.25/hour indoor air exchange rate.

The highest detected concentrations of each of the four VOCs exceeding the VISL screening were then put into the J&E model and the carcinogenic risk and non-carcinogenic hazard were calculated. The model demonstrated that the VOC concentrations in groundwater would not cause the carcinogenic risk and non-carcinogenic hazard associated with the resulting indoor air concentrations to exceed the threshold values, thus Site VOCs would not result in an unacceptable risk to human health via the vapor intrusion pathway. As such, further action is not warranted.

2.4 SOIL AND GROUNDWATER IMPACTS

2.4.1 Soil Impacts

Based on the analytical results of Peachtreeôs August 2009 and September 2011 soil investigation activities, eight regulated substances have been detected above laboratory reporting limits (RLs) in soil. The August 2009 and September 2011 soil sampling analytical results are illustrated on **Figures 7A** and **7B,** respectively. A complete copy of the August 2009 and September 2011 soil analytical testing results was provided in the September 2011 CAP.

In November 2013, Peachtree conducted a supplemental soil investigation within suspected source areas at the Property. The soil sample locations and extent of PCE detected in soil during the November 2013 investigation are depicted on **Figure 8**.

2.4.2 Groundwater Impacts

Based on the analytical results of Peachtreeôs investigations to-date, 11 VOCs have been detected above laboratory RLs in groundwater. The current horizontal extent of groundwater impact from the current semiannual sampling (see Section 3) is shown on **Figure 9**. The historic groundwater analytical results and groundwater RRS are summarized in **Table 4**. MNA field readings and analytical results are summarized in **Table 5**.

2.5 REGULATED SUBSTANCES

Based on the soil and groundwater data collected at the VRP Property to-date, the following VOCs have been detected above the laboratory RL:

- Benzene (CAS No. 71432); - Groundwater;
- cis-1,2-Dichloroethene (cis-DCE - CAS No. 156592); - Groundwater;
- Cyclohexane (cis-DCE - CAS No. 110827); - Soil/Groundwater;
- Ethylbenzene (CAS No. 100414); - Soil/Groundwater;
- Isopropylbenzene (CAS No. 98828); - Soil/Groundwater;
- Methylcyclohexane (CAS No. 108872 ï Not Regulated); - Groundwater;
- Methyl-tert-butyl-ether (CAS No. 1634044 ï Not Regulated); - Groundwater;
- Tetrachloroethene (PCE - CAS No.127184); - Soil/Groundwater;
- Toluene (CAS No. 108883); - Soil/Groundwater;
- Trichloroethene (TCE - CAS No. 79016); - Groundwater; and
- Total Xylenes (CAS No. 1330207); - Soil/Groundwater.

2.5.1 Constituents of Concern in Soil

Based on a preliminary review of regulated substances detected in soil at the VRP Property, none were detected above their respective Type 1 RRS. A table presenting

the regulated substances detected in soil and their respective Type 1 Risk Reduction Standards is provided below:

TABLE 2.5.1 – TYPE 1 SOIL RRS

REGULATED CONSTITUENT	HIGHEST DETECTED CONCENTRATION (SOIL SAMPLE – (DEPTH))	TYPE 1 RRS (MG/KG)
Cyclohexane	0.15 mg/Kg (SB-2 (15-20ô))	20
Ethylbenzene	1.4 mg/Kg (SB-2 (15-20ô))	70
Isopropylbenzene	0.30 mg/Kg (SB-2 (15-20ô))	21.88
PCE	0.43 mg/Kg (B-2 (12ô))	0.5
Toluene	0.12 mg/Kg (SB-2 (15-20ô))	100
Total Xylenes	6.1 mg/Kg (SB-2 (15-20ô))	1,000

NOTES: 1) No constituents were detected above Type 1 RRS

2.5.2 Constituents of Concern in Groundwater

A preliminary review of regulated substances detected in groundwater show that benzene, cis-DCE, cyclohexane, ethylbenzene, isopropylbenzene, PCE, toluene, and TCE are considered COCs at the VRP Property since they were detected above their respective MCL or Type 1 RRS in groundwater. No other regulated substances were detected above their respective MCL or Type 1 RRS in groundwater. A table presenting the regulated substances detected in groundwater and their respective MCL / Type 1 RRS is provided below:

TABLE 2.5.2 –TYPE 1 GROUNDWATER RRS

REGULATED CONSTITUENT	HIGHEST DETECTED CONCENTRATION (µg /L) (MONITORING WELL - DATE)	MCL / TYPE 1 RRS (µg /L)
Benzene	**33 (MW-6 – 6/27/12)**	**5.0**
cis-1,2-Dichloroethene	**140 (MW-3 – 9/1/11)**	**70**
Cyclohexane	**190 (MW-2 – 9/1/11)**	**5**
Ethylbenzene	**2,100 (MW-2 – 6/25/14)**	**1,000**
Isopropylbenzene	**77 (MW-2 – 9/1/11)**	**5.0**
PCE	**5,200 (MW-5 – 11/21/13)**	**5.0**
Toluene	**2,600 (MW-2 – 11/20/13)**	**1,000**
TCE	**100 (MW-6 – 6/7/13)**	**5.0**
Total Xylenes	**11,700 (MW-2 – 6/25/14)**	**10,000**

NOTES: 1) **Bolded** constituents exceed MCL / Type 1/3 RRS

Based on the June 2014 analytical results, new high concentrations of ethylbenzene, PCE, toluene, and total xylenes were detected at the Property. As noted in Table 2.5.2 above, PCE was detected at a concentration of 5,200 ug/L in monitoring well MW-5, while petroleum-related VOCs ethylbenzene, toluene, and total xylenes were detected in monitoring well MW-2. Further discussion of the June 2014 groundwater analytical results is provided in Section 3.0.

3.0 JUNE 2014 SEMIANNUAL GROUNDWATER MONITORING

Peachtree completed the third semiannual groundwater monitoring at the VRP Property in June 2014. This data has been utilized for the preparation of figures and tables depicting the delineation of COC-impacted groundwater. Groundwater monitoring wells were sampled to evaluate the extent and concentration of the existing groundwater plume, such that corrective measures could be evaluated to comply with applicable RRS. Peachtree collected groundwater samples from the 13 shallow water-bearing zone monitoring wells.

Measurements of MNA parameters have been previously collected from monitoring wells MW-2, MW-3, MW-5, and MW-6, such that a natural-attenuation based corrective action approach could be evaluated. In November 2013, Peachtree collected MNA parameters in MW-1 (background well), MW-5 (source area well), MW-7 (downgradient impacted well) and MW-12 (the most-downgradient impacted well). MNA parameters were not collected this sampling event. It has been determined that the effectiveness of natural attenuation will likely need enhancement through the introduction of a food source for the natural bacteria.

3.1 GROUNDWATER ELEVATIONS

Peachtree personnel measured water levels and collected groundwater samples from the monitoring well network at the VRP Property. Prior to well purging and sampling, the depth to water in each monitoring well was measured from the top of the casing using an electronic water level indicator. Each well measurement was recorded to one-hundredth of a foot. The well data was recorded on field logs which are included in the Monitoring Well Purging & Sampling Information Sheets of **Appendix C**. The groundwater elevation of each monitoring well was used to prepare a water table map for the June 2014 sampling event, included as **Figure 3**. The resulting groundwater flow direction to the southwest is consistent with historic observations.

3.2 WELL PURGING

Well purging and sampling was conducted in general accordance with the Region IV U.S. Environmental Protection Agency (USEPA) Science and Ecosystem Support Division (SESD) Operating Procedure for Groundwater Sampling (SESDPROC-301-R3, March 2013; Section 3.2.1)[1]. After water levels were measured, the wells were purged using low-flow/low-displacement methodology using a peristaltic pump in accordance with USEPA standard protocols. Field parameters (pH, specific conductivity, temperature, dissolved oxygen, and

[1] Also see: Puls, R.W. and M.J. Barcelona, 1996, *Groundwater Issue Paper: Low-Flow (Minimal Drawdown) Ground-Water Sampling Procedures*; USEPA, EPA/540/S-5/504,12 pp.; USEPA Region II. March 16, 1998. *Low Stress (Low-Flow) Purging and Sampling*. Final Ground Water Sampling SOP # G001; USEPA Region I. January 19, 2010. *Low Stress (Low-Flow) Purging and Sampling Procedure for the Collection of Groundwater Samples from Monitoring Wells*.EQASOP-GW 001 Revision 3.

oxidation-reduction potential) were measured using a flow-through cell[2]. Turbidity was nmeasured using a LaMotte 2020 Nephelometer. Flow rates were generally kept within a range of 100 ml/min to 400 ml/min, to minimize drawdown. The results of these measurements are presented on the Field Water Quality Sampling Forms in **Appendix C**. When the field parameters stabilized[3], purging stopped and the wells were sampled.

3.3 SAMPLING PROCEDURES

Groundwater sampling was conducted in general accordance with standard USEPA protocol (i.e., SESDPROC-301-R3, March 2013; Section 4.3.1.3; Puls and Barcelona, 1996). Groundwater samples were collected from the peristaltic pump following well purging and appropriate recharge. Copies of the data recorded during purging are included in the Field Water Quality Sampling Forms shown in **Appendix C**.

Samples were poured directly into clean 40 ml glass vials with Teflon® septa. The samples were placed in a cooler on ice and transported to Analytical Environmental Services, Inc., Atlanta, Georgia, following strict chain-of-custody procedures. The TCL VOC samples were analyzed by EPA Method 8260B (SW 846 "Test Methods for Evaluating Solid Waste" Third Edition with subsequent updates).

3.4 DECONTAMINATION PROCEDURES

The majority of sample-contacting equipment was single-use, disposable equipment. All other downhole or reusable field monitoring and sampling equipment was properly decontaminated between sampling locations in accordance with the SESD Operating Procedures for Field Equipment and Decontamination (SESDPROC-205-R2, December 2011; Sections 3.3, 3.5, and 3.6).

3.5 ANALYTICAL RESULTS

Eight COCs were reported at concentrations in excess of the laboratory RL during the June 2014 sampling event. In addition, the non-regulated VOC methylcylcohexane was also detected in excess of the laboratory RL. The VOCs detected in June 2014 (and monitoring well where detected) are summarized below:

- Benzene (MW-5);
- cis-DCE (MW-3, MW-5);
- Cyclohexane (MW-5);
- Ethylbenzene (MW-2);
- Methylcyclohexane ï Not regulated (MW-2, MW-5);

[2] Flow-through cell utilized a YSI 556 multi-parameter water quality probe.

[3] Groundwater stabilization has occurred if three consecutive well measurements of specific conductivity are approximately ± 10 %, pH values are within 1 pH unit of the last three value averages, and groundwater turbidity (NTU) values are ± 10 % (EPA/542/S-02/001).

- PCE (MW-3, MW-5, MW-6, MW-7, MW-12);
- Toluene (MW-2);
- TCE (MW-3, MW-5, MW-6, MW-7); and
- Total (m,p,o isomers) Xylenes (MW-2).

Horizontal Extent of Impacted Groundwater

The COCs detected in groundwater during the June 2014 sampling event are depicted on **Figure 9**. The principal COCs at the VRP Property are PCE (and its associated breakdown products), BTEX, and various petroleum-related COCs. The June 2014 concentration map for PCE, TCE, cis-DCE, and benzene are included as **Figures 10 - 13**. Concentration maps for remaining COCs (ethylbenzene, cyclohexane, isopropylbenzene and toluene) detected above their respective Type 1 RRS were not included since these COCs were only detected in MW-2. A summary of the historic groundwater analytical data and MNA parameters are provided in **Tables 4** and **5**, respectively.

PCE was previously detected in 7 of 13 wells in November 2013. This sampling event, it was only detected in only 5 wells; MW-2 and MW-11 were non-detect for PCE.

Based on the June 2014 groundwater analytical results, the horizontal extents of benzene, cis-DCE, cyclohexane, ethylbenzene, isopropylbenzene, toluene, TCE, and total xylenes have been delineated at the VRP Property. PCE was delineated in all directions except downgradient, since it was detected in the MW-12 sample. It is anticipated that a downgradient delineation monitoring well (MW-14) may need to be installed in the City of Thomasville right-of-way in accordance with the required 2-year VRP milestone schedule.

Vertical Extent of Impacted Groundwater

The vertical extent of impacted groundwater has yet to be defined at the VRP Property. Based on the current analytical results, the location of the deep well will be within the vicinity of MW-5. Discussions and data associated with vertical extent delineation will be provided in subsequent semiannual groundwater monitoring reports and the final VRP CSR. Vertical delineation will be conducted in accordance with the VRP milestone schedule, prior to the 5th Semiannual Progress Report, due August 1, 2015.

3.6 GROUNDWATER DELINEATION STANDARDS

Eight HSRA-regulated substances were detected in groundwater samples collected at the VRP Property above applicable groundwater RRS during the June 2014 sampling event. The resulting groundwater delineation standards are provided below:

TABLE 3.6 – JUNE 2014 TYPE 1 GROUNDWATER RRS SUMMARY

REGULATED CONSTITUENT	HIGHEST DETECTED CONCENTRATION IN µg/L (JUNE 2014)	TYPE 1 RRS (µg /L)
Benzene	**13 (MW-5)**	**5**
cis-DCE	**33 (MW-3)**	**5**
Cyclohexane	**5.8 (MW-2)**	**5**
Ethylbenzene	**2,100 (MW-2)**	**700**
PCE	**1,100 (MW-5)**	**5**
Toluene	**2,400 (MW-2)**	**1,000**
TCE	**25 (MW-5)**	**5**
Total Xylenes (o,m,p)	**11,700 (MW-2)**	**10,000**

Notes: **Bolded** constituents exceed the Type 1 RRS.

The detections of ethylbenzene and total xylenes were seen to increase in MW-2. However, the previously detected PCE and TCE were not seen this period, possibly from cometabolic degradation. MW-5 is the only other well showing detections of petroleum hydrocarbons. The previous detection of 5,200 µg/L PCE in MW-5 has dropped to 1,100 µg/L. Currently, PCE is the only COC requiring additional horizontal delineation.

4.0 PRELIMINARY REMEDIATION PLAN

Based on the results of the previous slug testing and MNA parameter analysis, bio-enhancement of the MNA process will be required at the VRP Property. It is likely that natural attenuation using BTEX present from former operations at the site has slowed in recent years due to the depletion of BTEX concentrations. This explains the need for the bio-enhancement of the MNA process being proposed.

Due to the presence of daughter products (i.e., TCE and cis-1,2-Dichloroethene), and moderate levels of dissolved oxygen (DO) and oxidation-reduction potential (ORP) in groundwater, it is evident that reducing conditions are already present and, therefore, an enhanced reductive dechlorination (ERD) approach using a carbon source (e.g., glycerin, emulsified soy oil, lactate, etc.) to enhance existing biological degradation is warranted.

Currently, there have been no detections of vinyl chloride at the VRP Property. However, Peachtree is looking at eliminating the potential of producing vinyl chloride beneath the building slab through enhanced bioremediation by using a combination of ERD with zero-valent iron (ZVI) added for chemical reduction. Treatment of chlorinated volatile organic compounds by ZVI was first performed over 20 years ago, and is a proven and widely accepted in-situ technology for remediation of chlorinated solvents such as PCE, TCE, and their daughter products.

The addition of ZVI to the carbon source (using patented proprietary products such as EHC®, ABC+®, eZVI®) provides a number of advantages over ERD alone. The ZVI will provide an immediate chemical reduction of all constituents, significantly vinyl chloride if present. The carbon substrate will provide short-term and long-term nutrients to anaerobic growth, which also assists in creating a reducing environment. In addition, the corrosion of iron metal yields ferrous iron and hydrogen, both of which are possible reducing agents. The hydrogen gas produced is also an excellent energy source for a wide variety of anaerobic bacteria. The carbon source should provide a food source to natural bacteria for at least one to two years; the ZVI should have a chemical reaction time of up to 5 years.

Injection of the carbon-ZVI solution can be performed through direct push drill rods located around the perimeter of the buildings. Inoculation with bacteria is not recommended with the injection. In most cases, the dehalococcoides (DHC) bacteria necessary to break down the chlorinated compounds are already present and will be stimulated with the addition of a carbon food source. Plus, the ZVI will provide an immediate chemical reduction of all chlorinated hydrocarbons, which will effectively prevent the formation of vinyl chloride.

The eventual use of environmental covenants for both the VRP property and the downgradient County properties will be further explored.

The next groundwater sampling event is scheduled for December 2014. The results of the proposed soil investigation and December 2014 groundwater sampling results will be provided in the next (4th) VRP Semiannual Progress Report, due January 1, 2015.

A monthly summary of Professional Engineer/Geologist hours expended as part of this semiannual progress report is included as **Appendix D**.

5.0 PROFESSIONAL CERTIFICATION

ñI certify that I am a qualified groundwater scientist who has received a baccalaureate or post graduate degree in the natural sciences or engineering, and have sufficient training and experience in groundwater hydrology and related fields, as demonstrated by state registration and completion of accredited university courses, that enable me to make sound professional judgments regarding groundwater monitoring and contaminant fate and transport. I further certify that this report was prepared by me or by a subordinate working under my direction.ò

John P. Martiniere, Jr., P.E.

Georgia Registration No. 11858

FIGURES

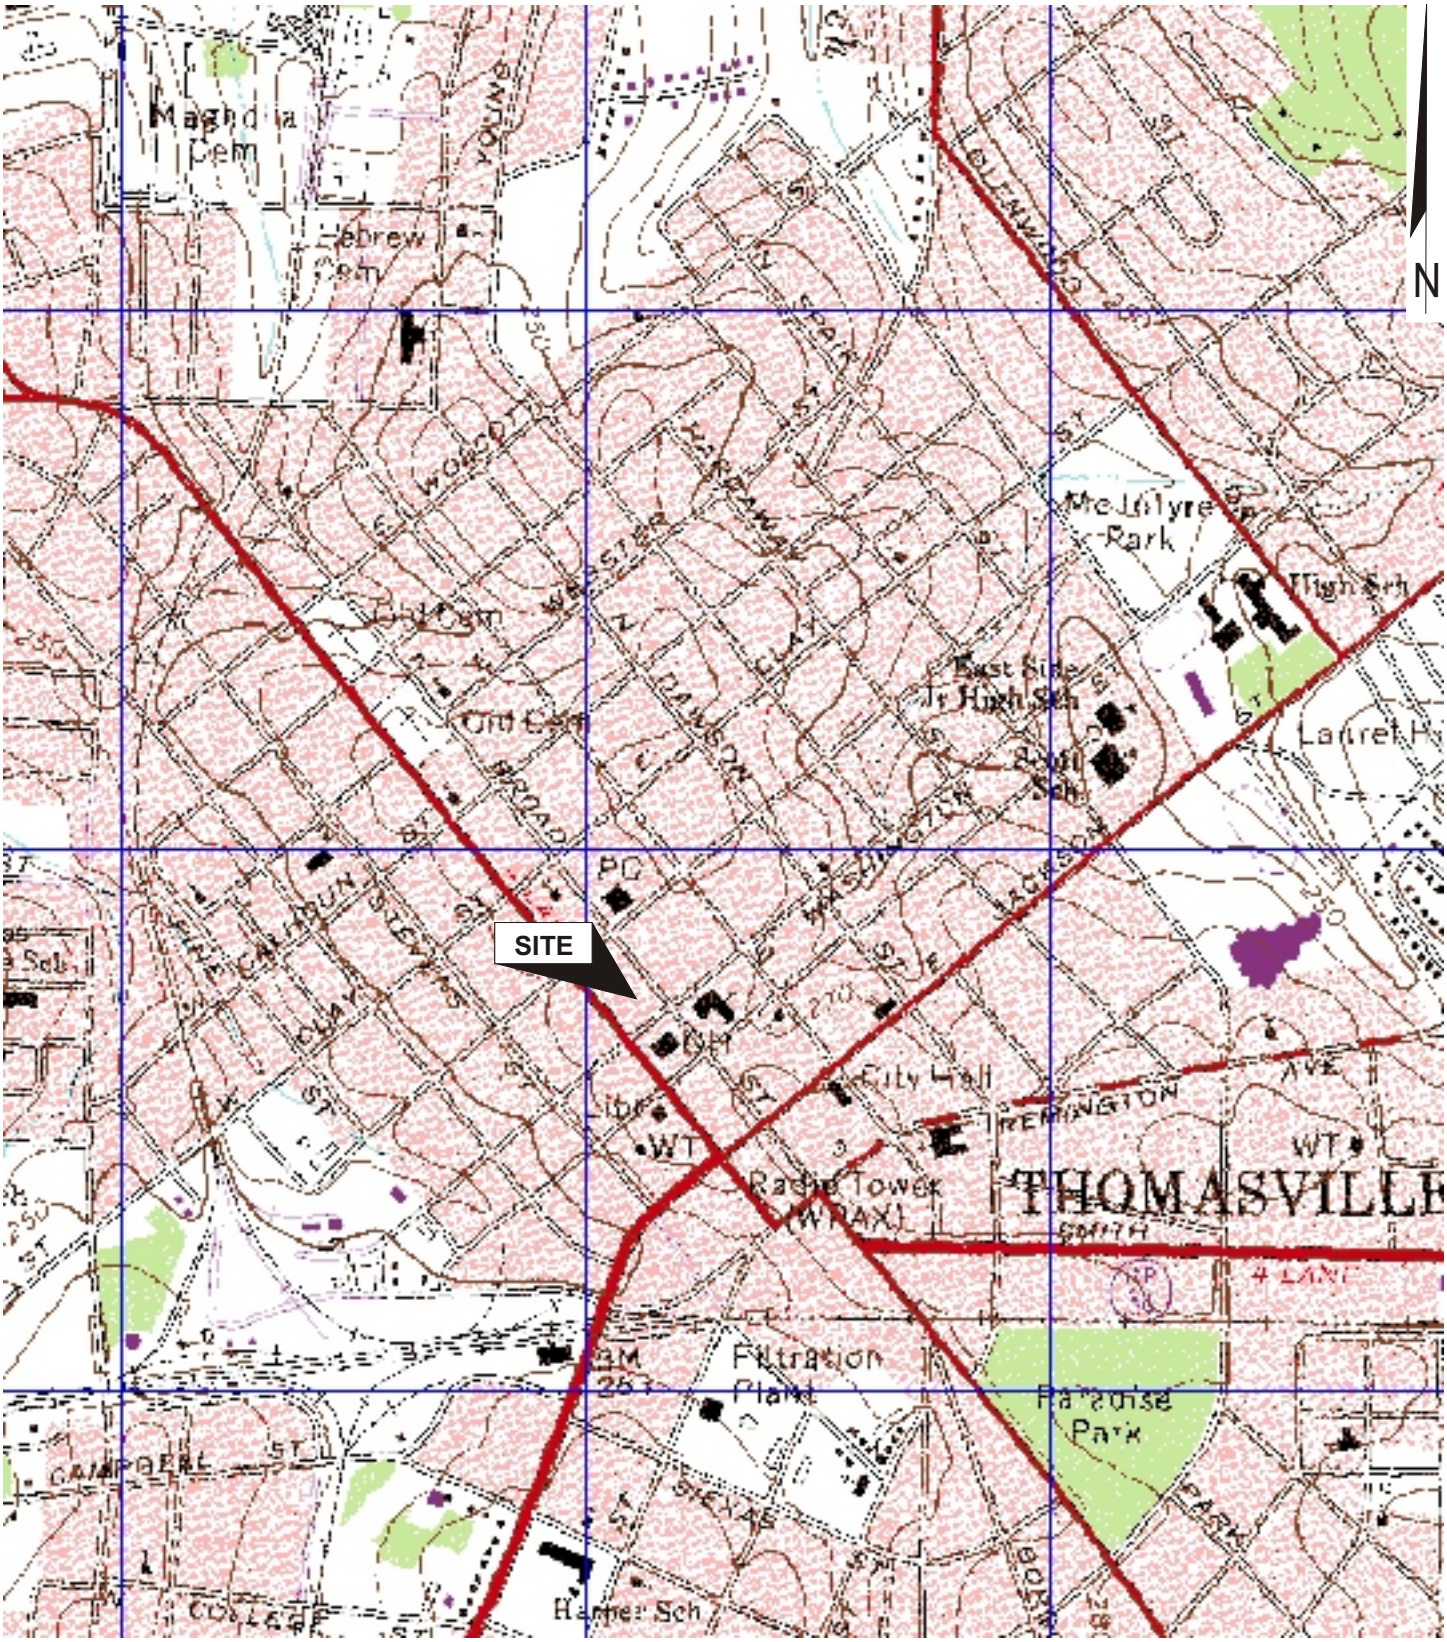

Source: United States Geological Survey 7.5 Minute Topographic Map
Thomasville Quadrangle

SCALE: 1" = 2000'

Peachtree Environmental

THOMASVILLE NATIONAL BANK
THOMASVILLE, THOMAS COUNTY, GEORGIA

FIGURE 1
PROPERTY LOCATION / USGS TOPOGRAPHIC MAP

2nd SEMIANNUAL REPORT

QUADRANGLE LOCATION

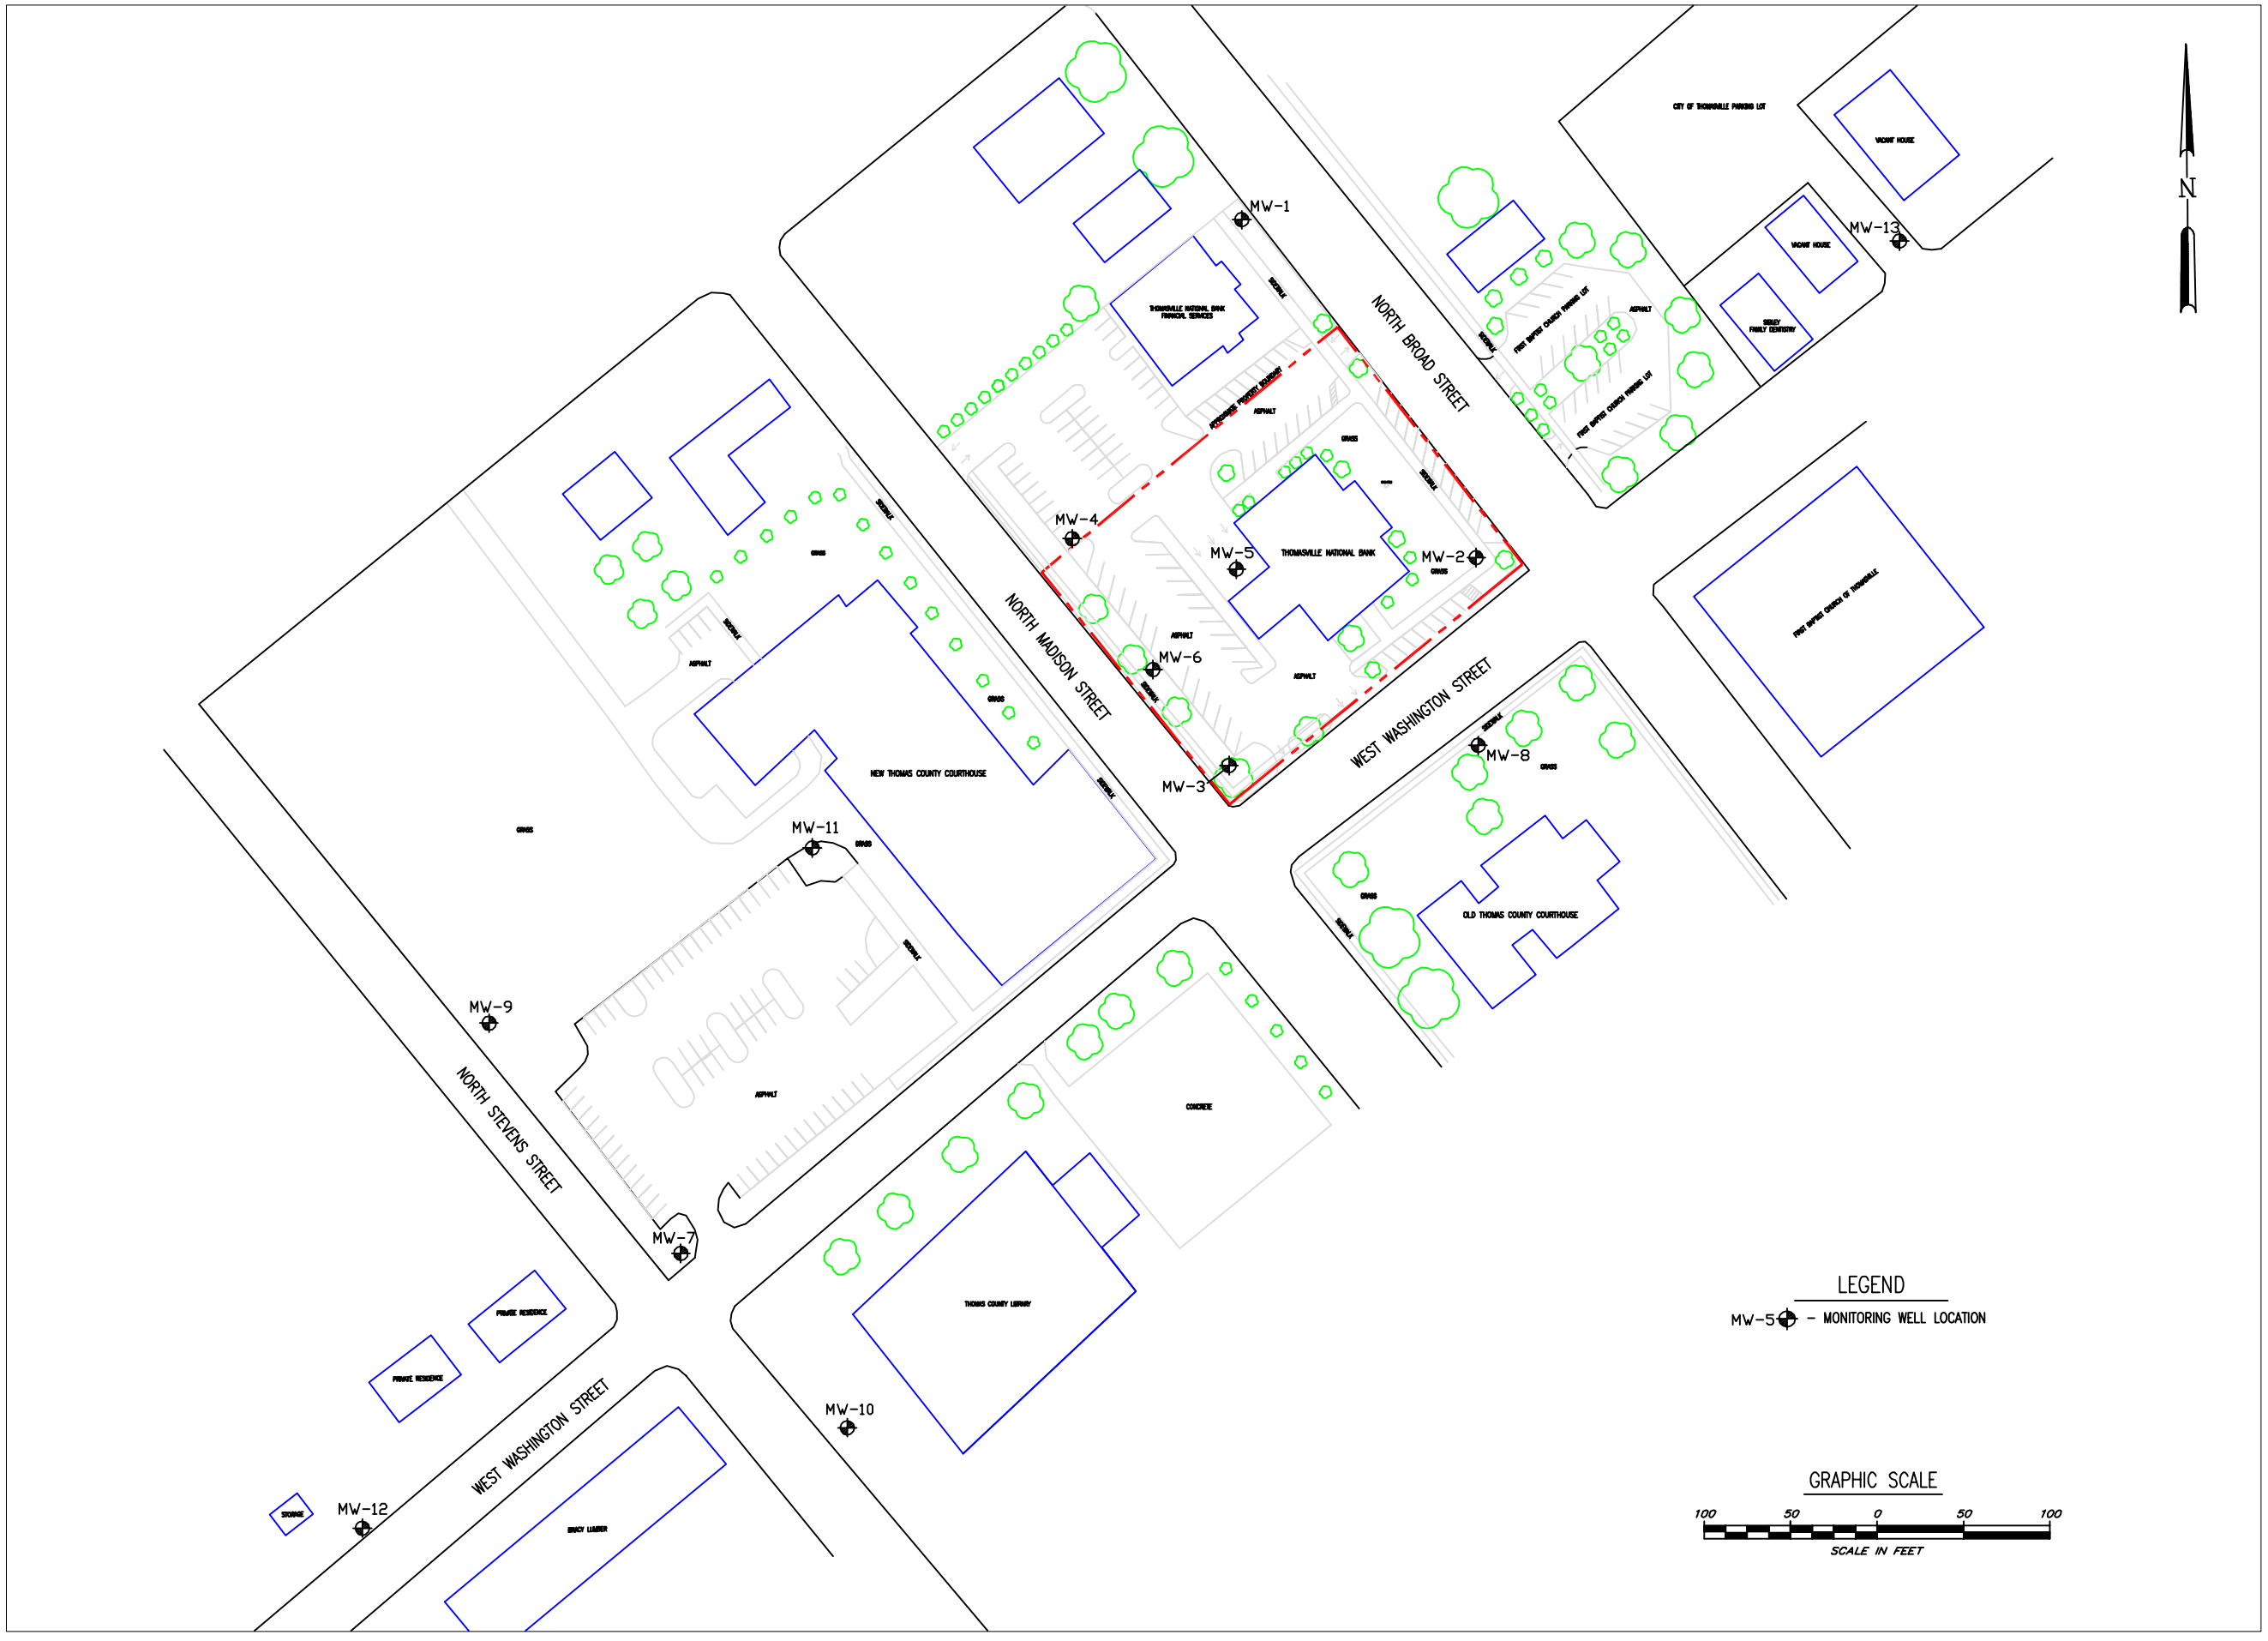

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 11/26/13		JPC	JPC	JPM	CHM

Peachtree Companies, Inc.

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

PROPERTY LAYOUT MAP

FIGURE NO. **2**
THOMASVILLE 3151

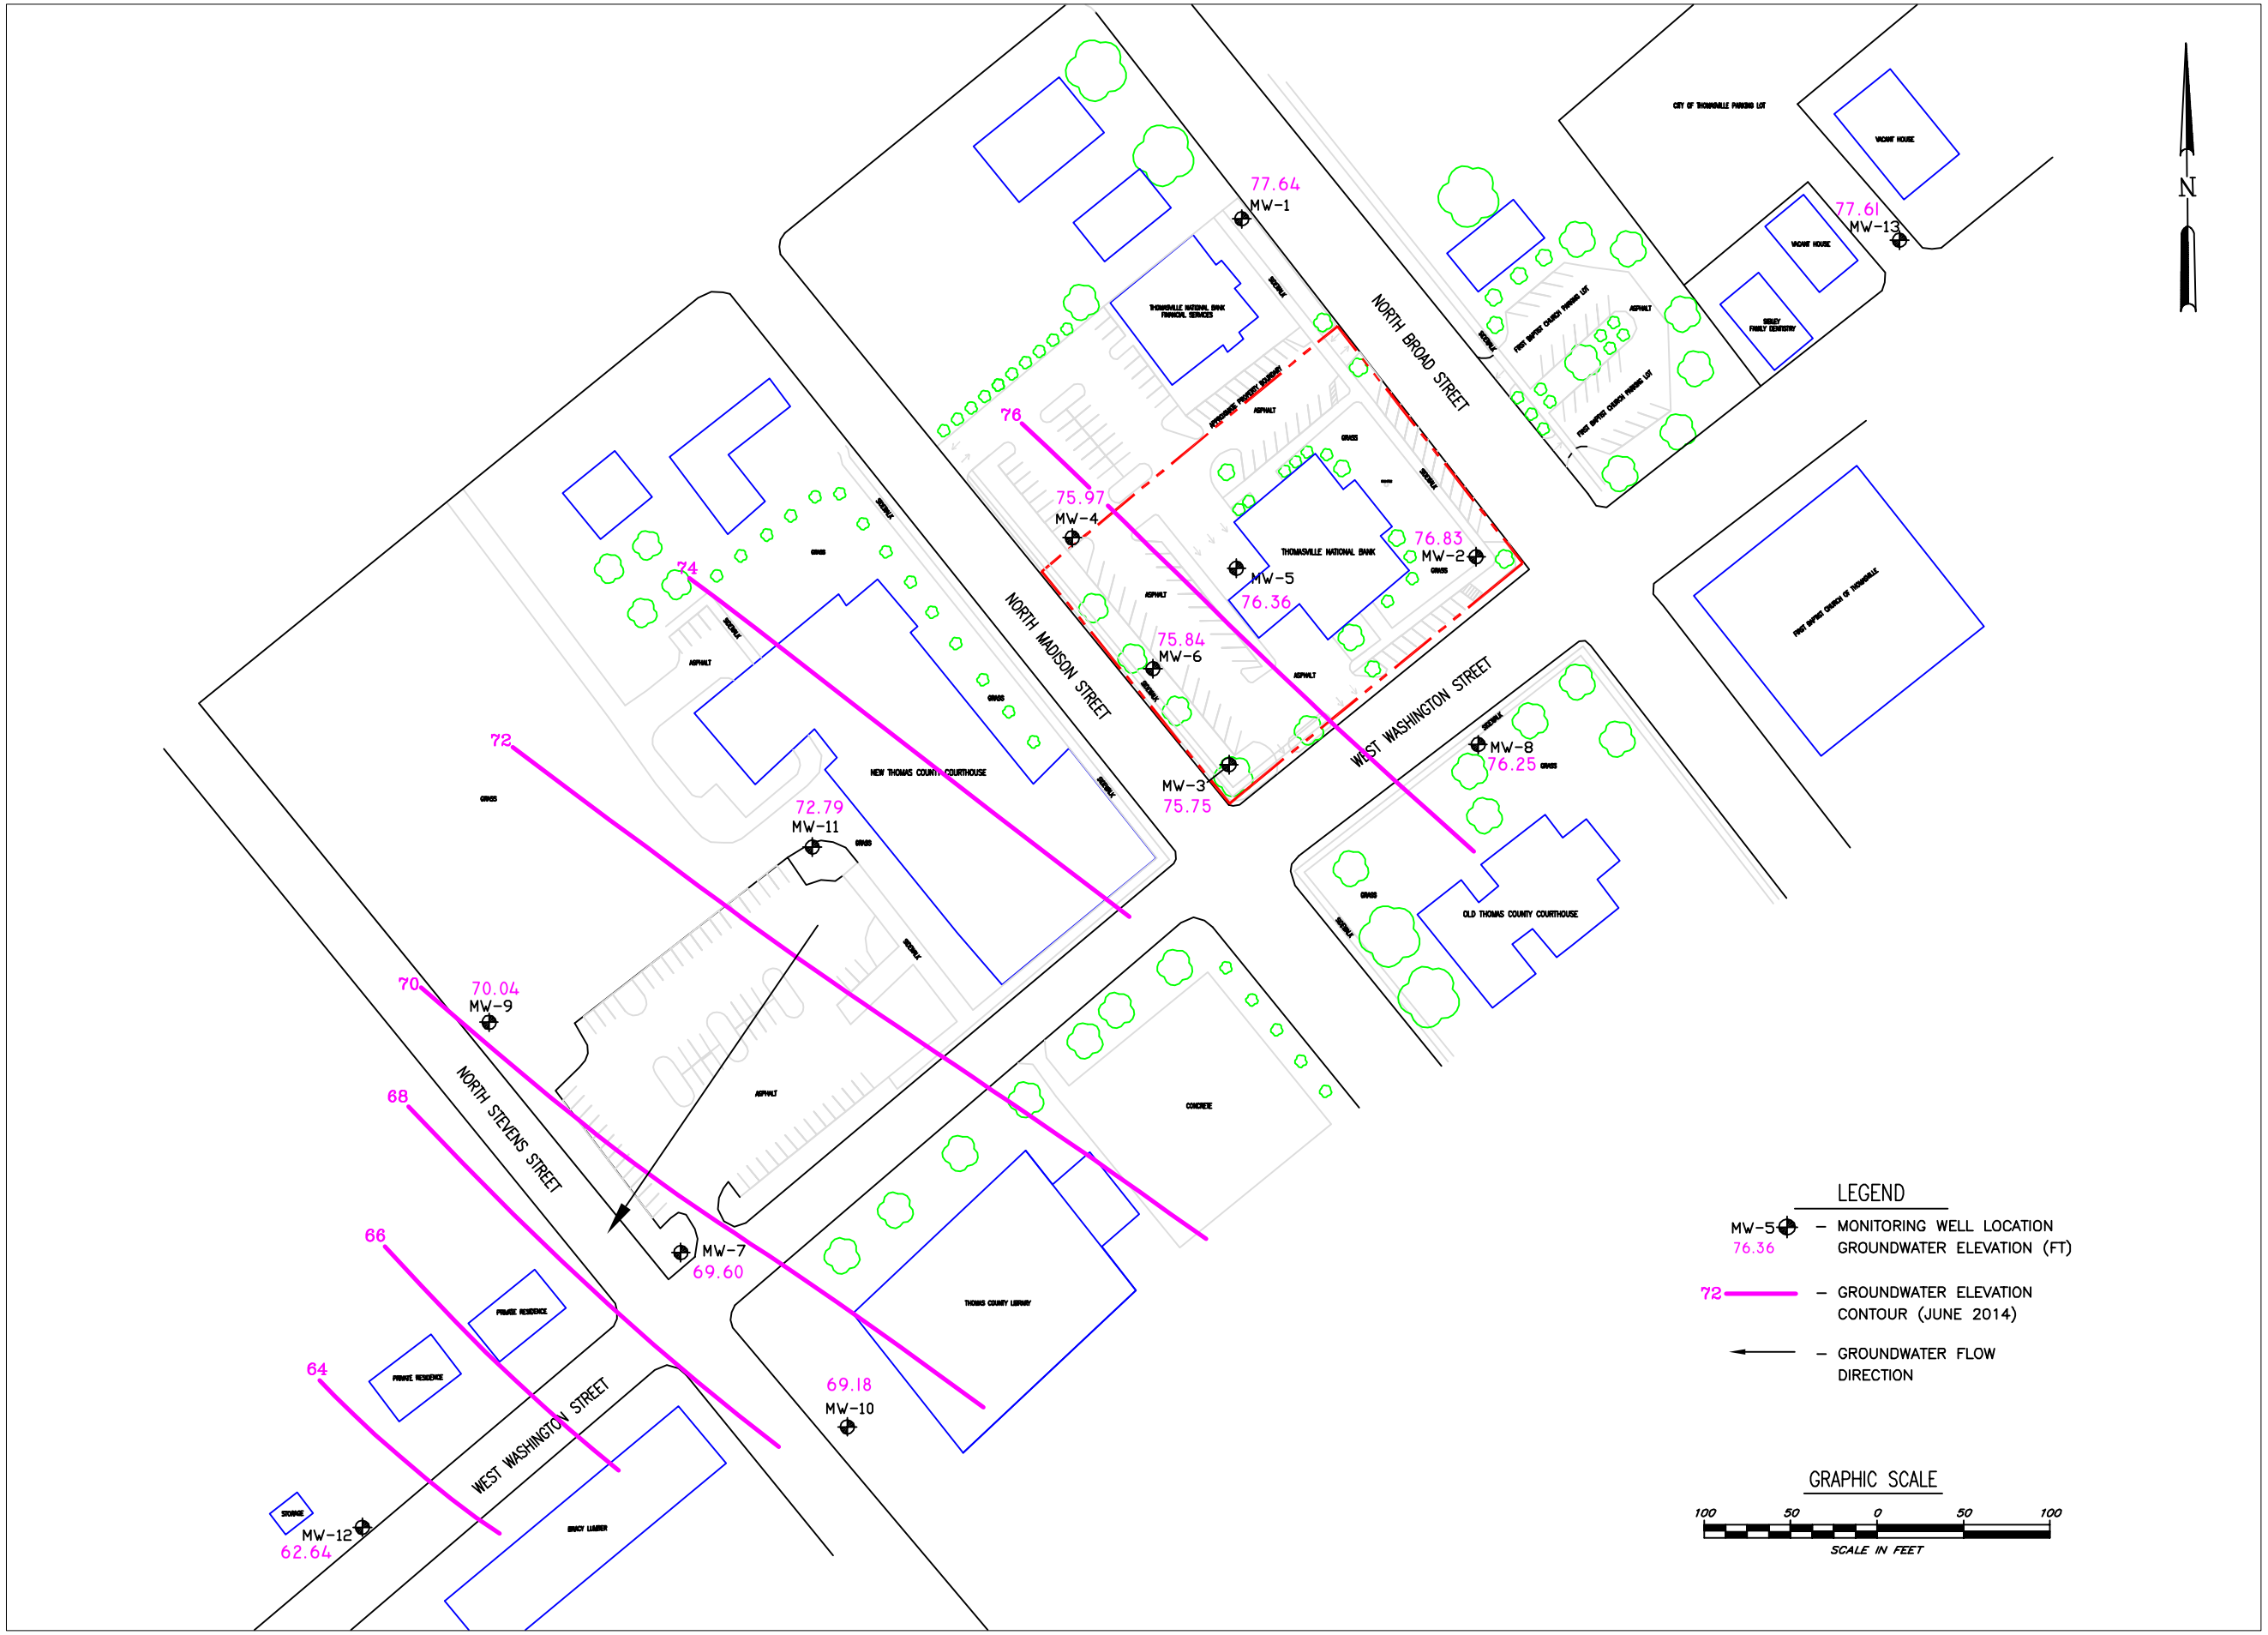

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/21/14		DWN BY MBH	DES BY JPC	CHK BY JPM	APP BY CHM

Peachtree Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

WATER TABLE CONTOUR MAP
JUNE 24, 2014

FIGURE NO. **3**

THOMASVILLE 3151

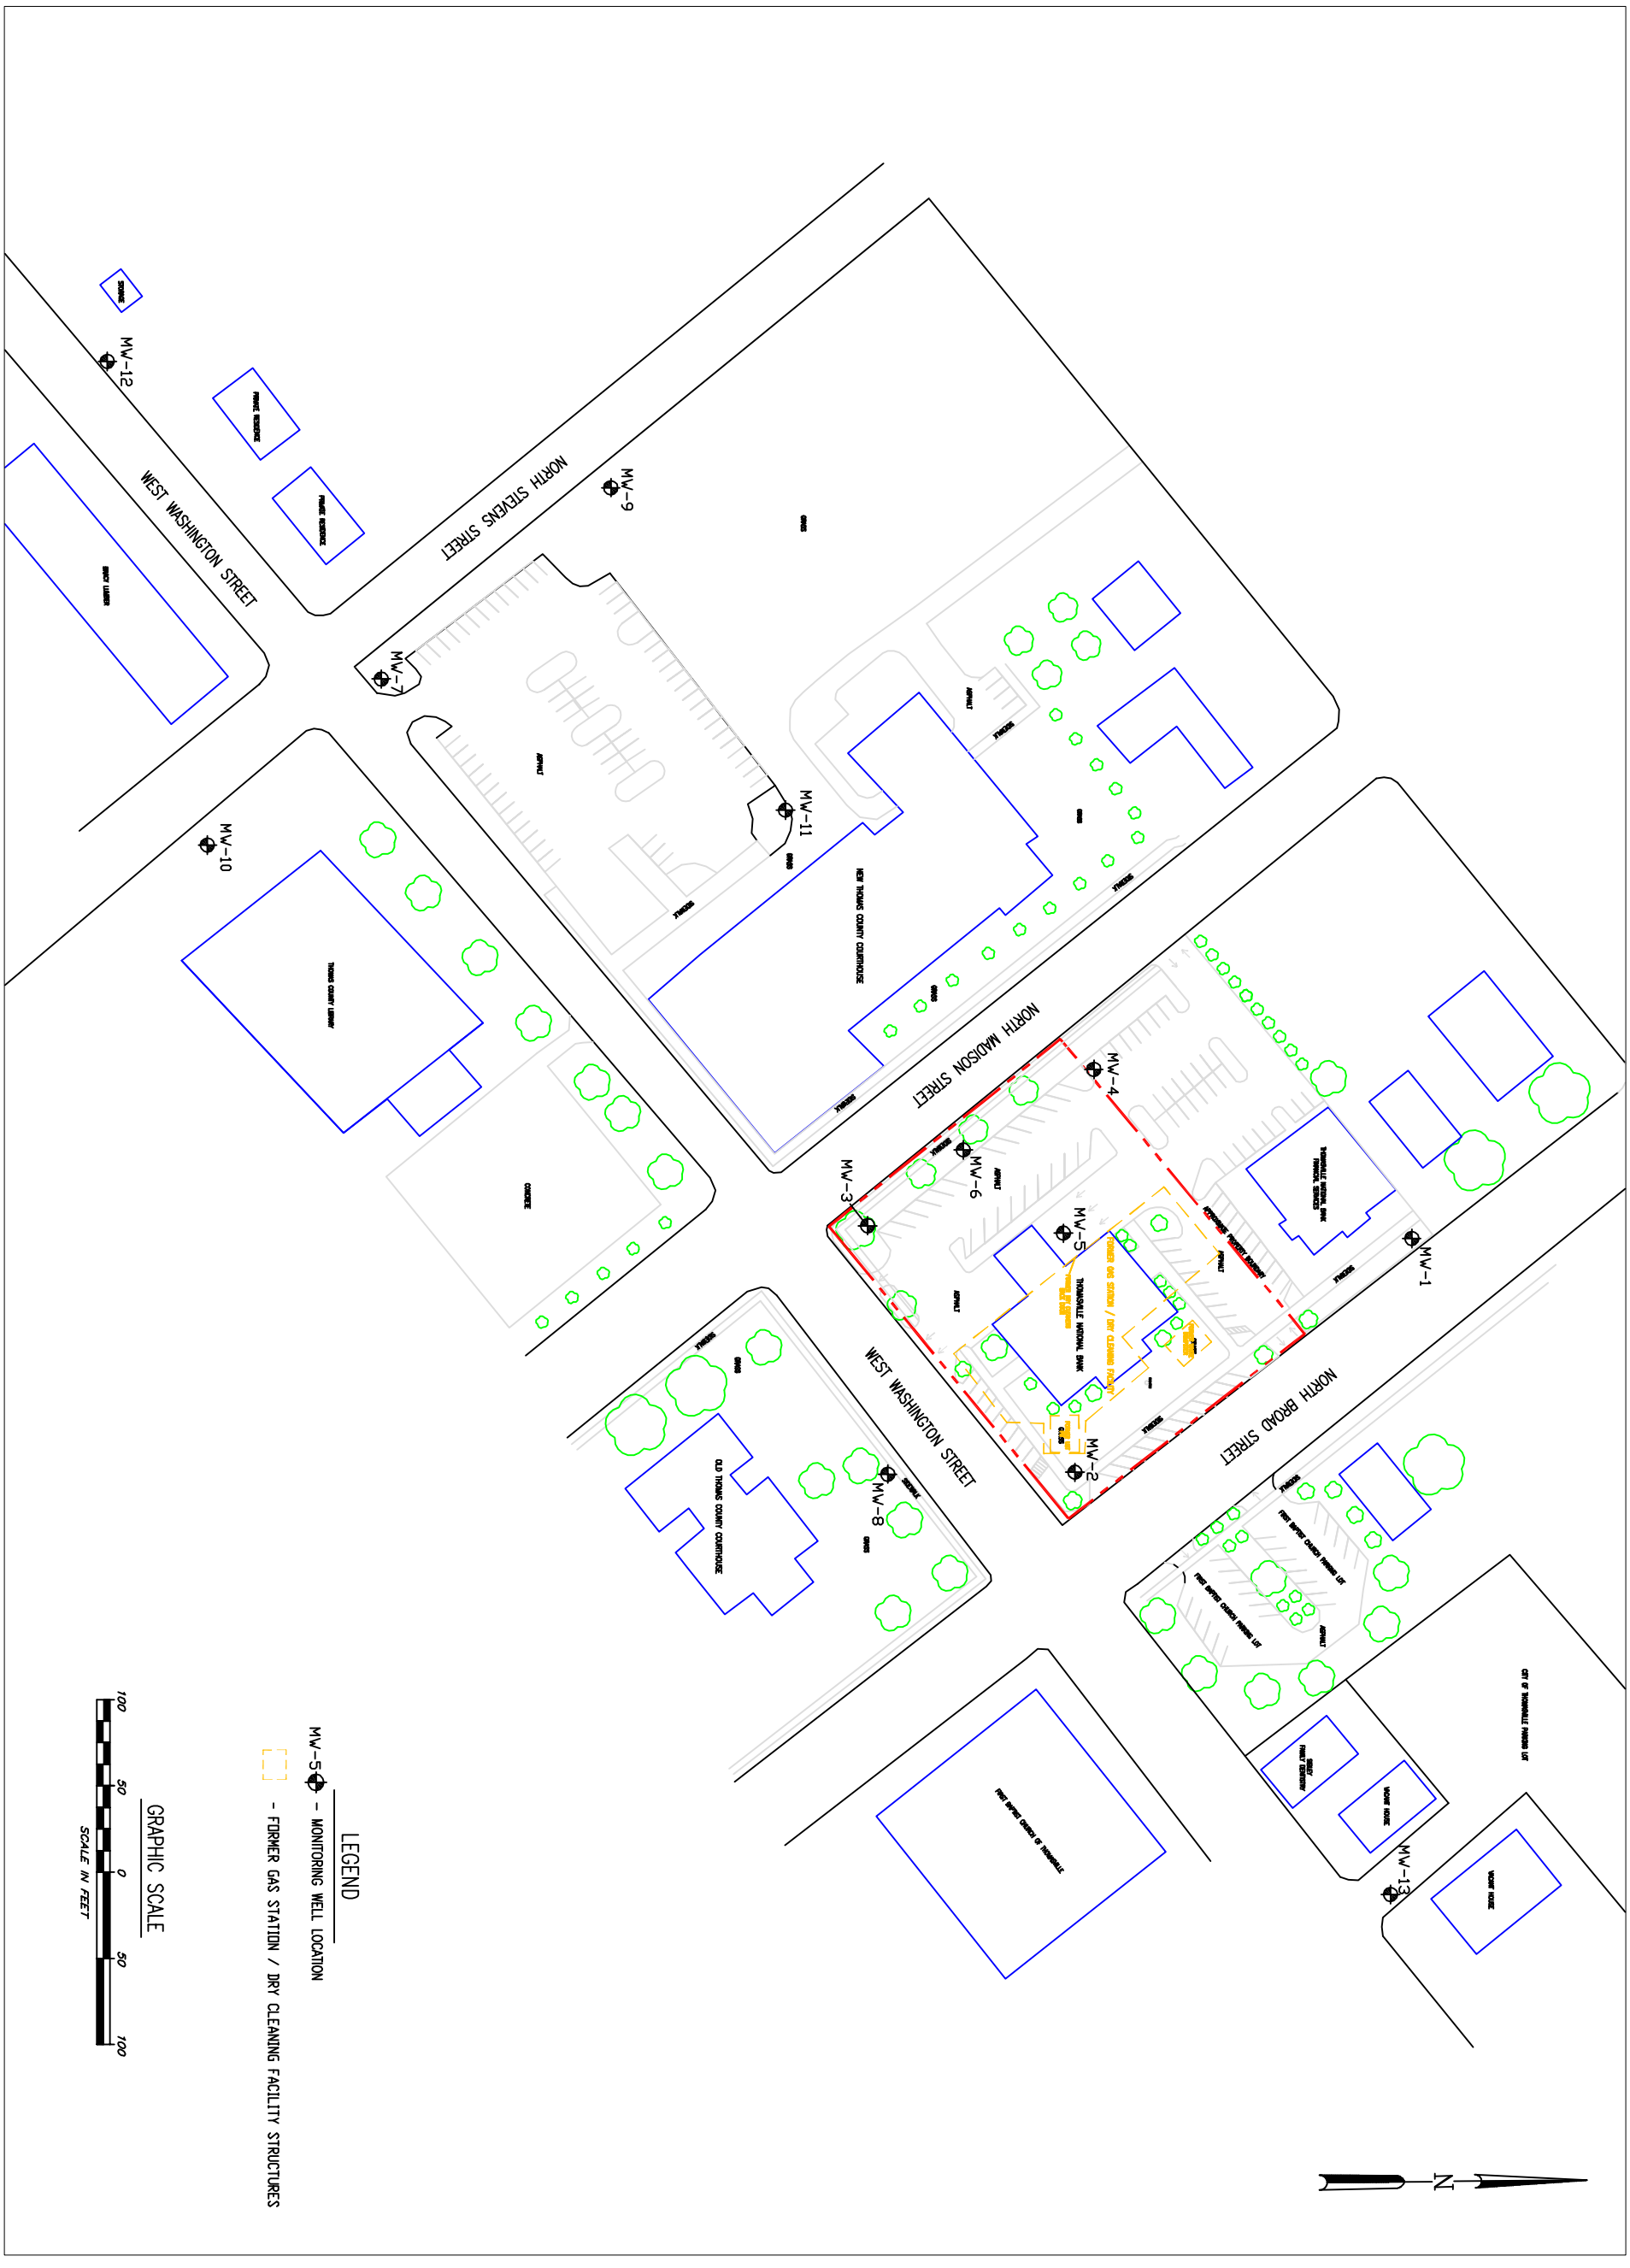

FIGURE NO.
4
THOMASVILLE
3151

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

SUSPECTED SOURCE AREA LOCATION MAP

Peachtree Environmental Inc.

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY

DATE OF ISSUE 1/21/14 DWN BY JPC DES BY JPC CHK BY JPM APP BY CHM

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/15/14		DWN BY JPC		CHK BY JPM	
			DES BY JPC		APP BY CHM	

Pandora Technology Corporation

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

CONCEPTUAL SITE MODEL CROSS-SECTION LOCATION MAP

FIGURE NO. **5**

THOMASVILLE 3151

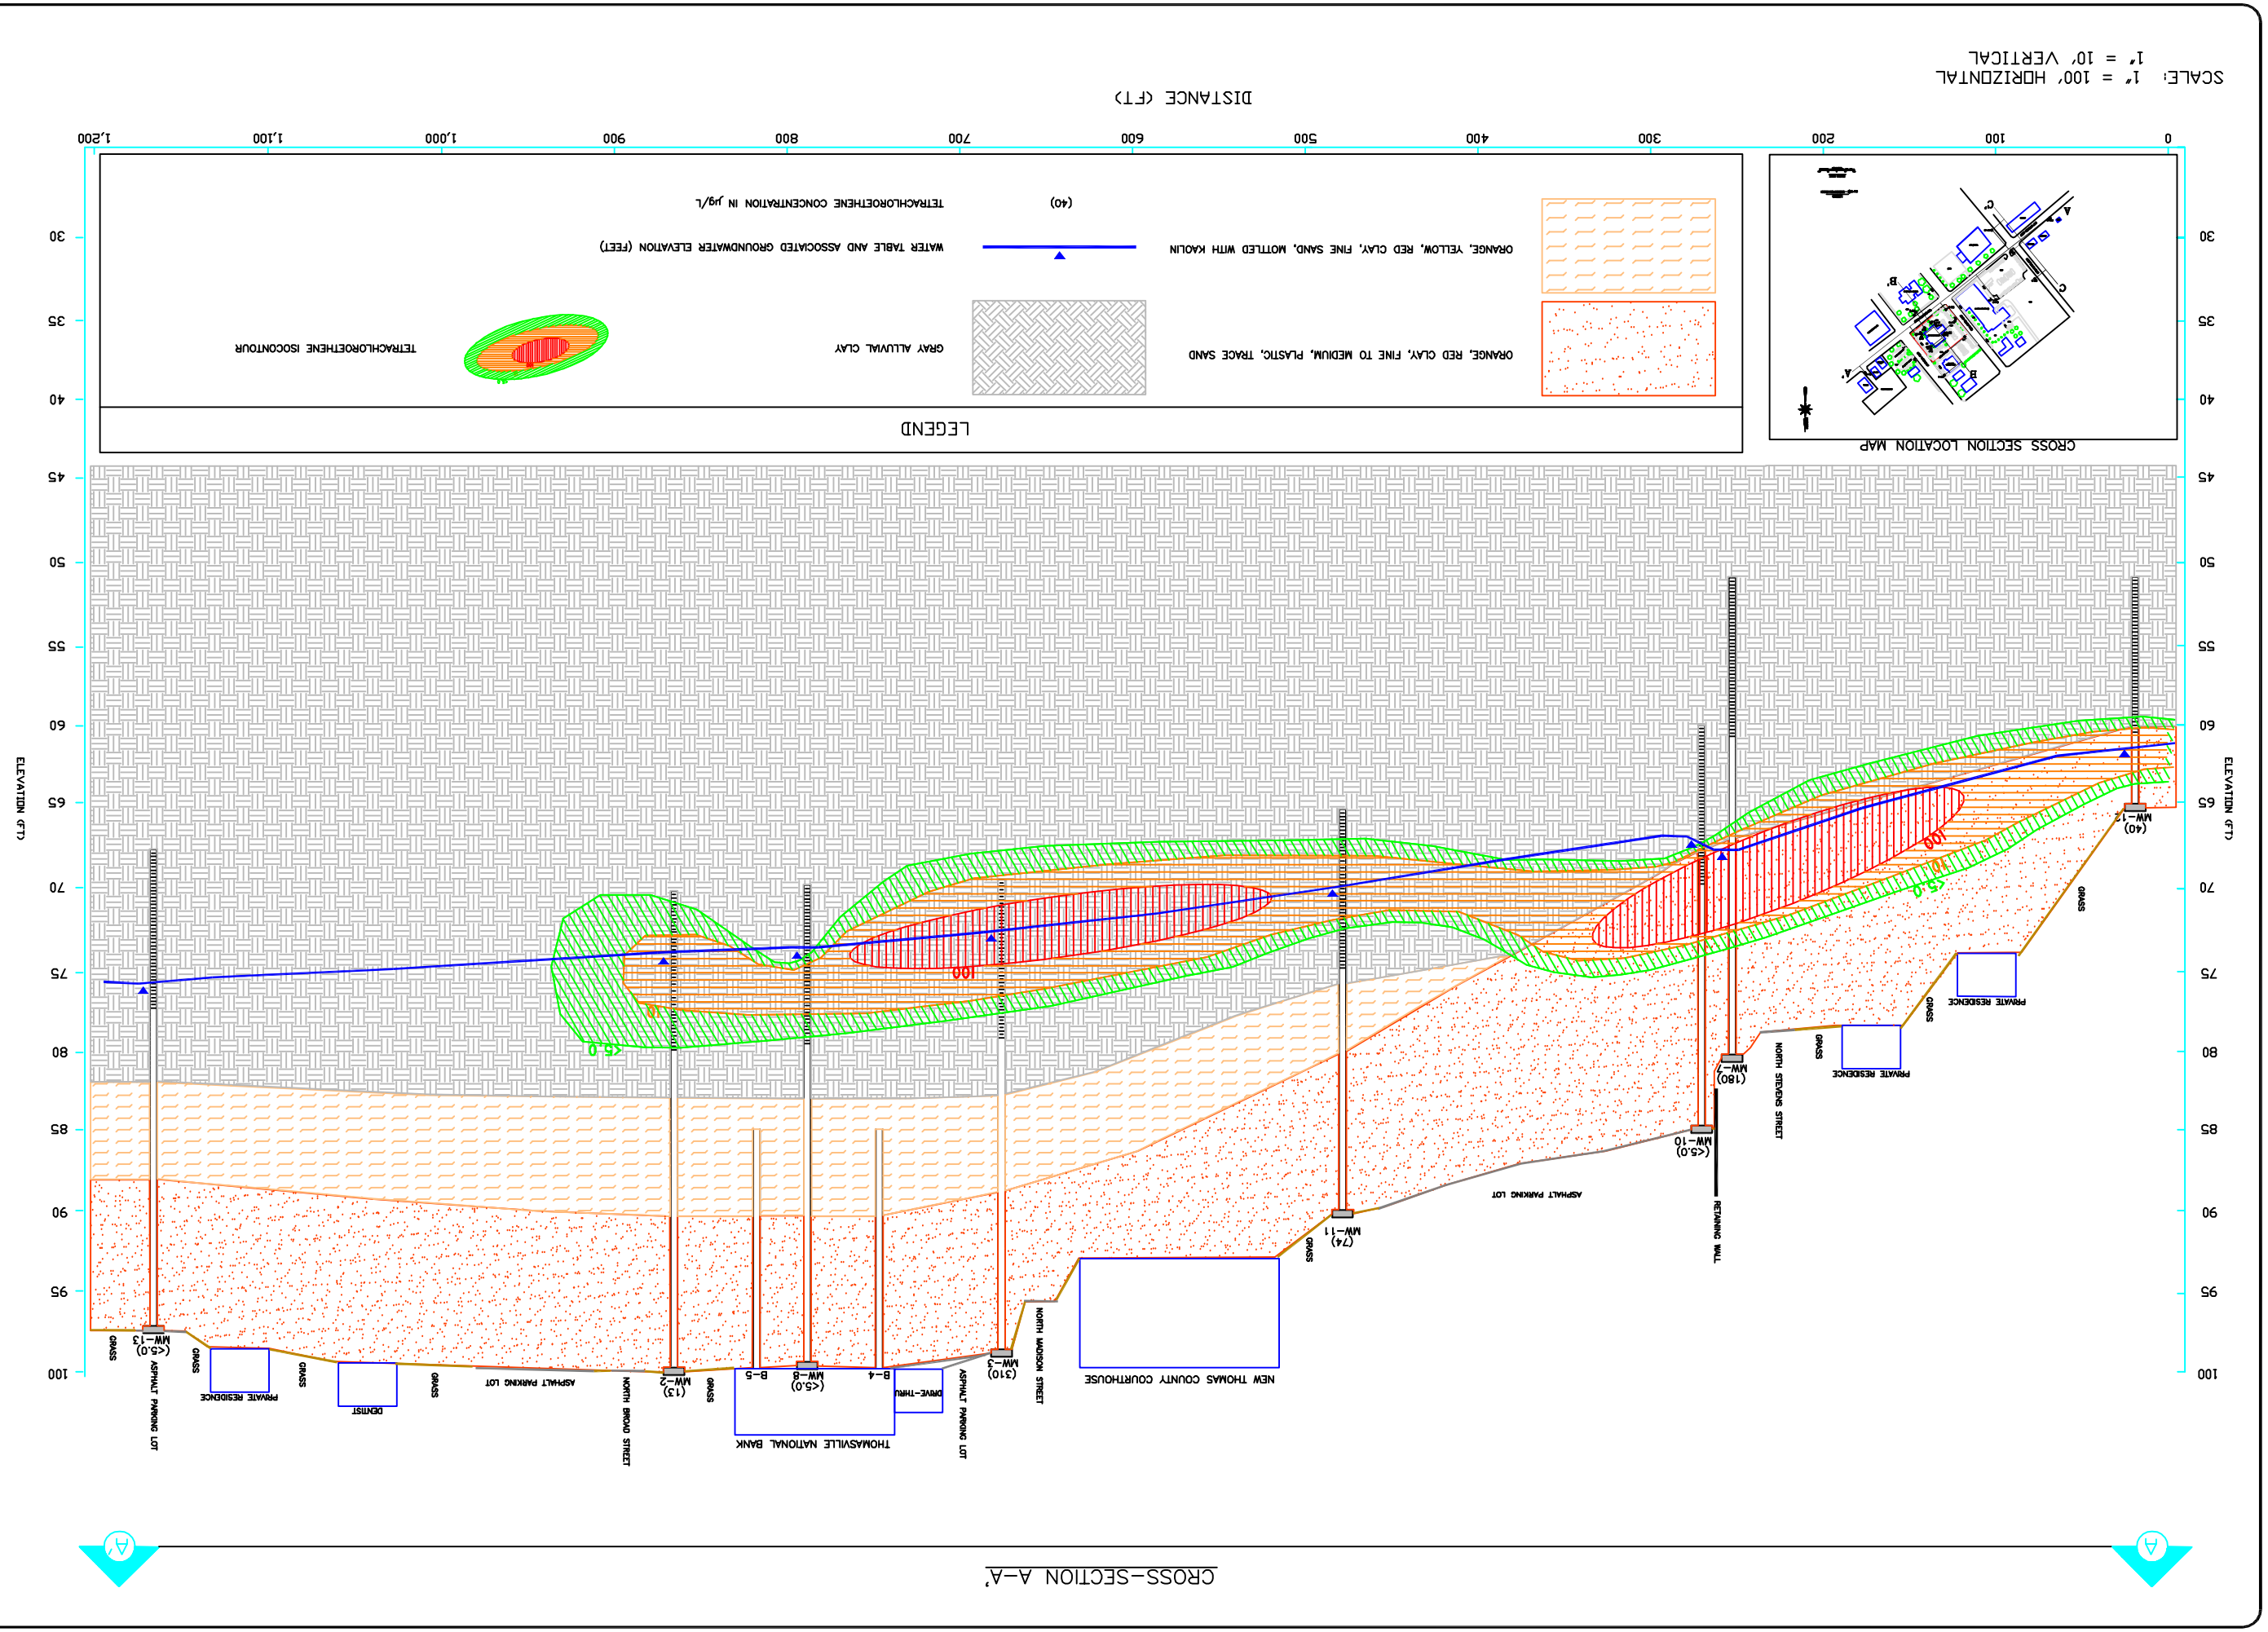

FIGURE NO.
6A
TNB
3151

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

CSM CROSS-SECTION (A - A')

Peachtree Environmental

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY

DATE OF ISSUE 1/14/14
DWN BY JPC
DES BY JPC
CHK BY TAH
APP BY JPM

CROSS-SECTION B–B'

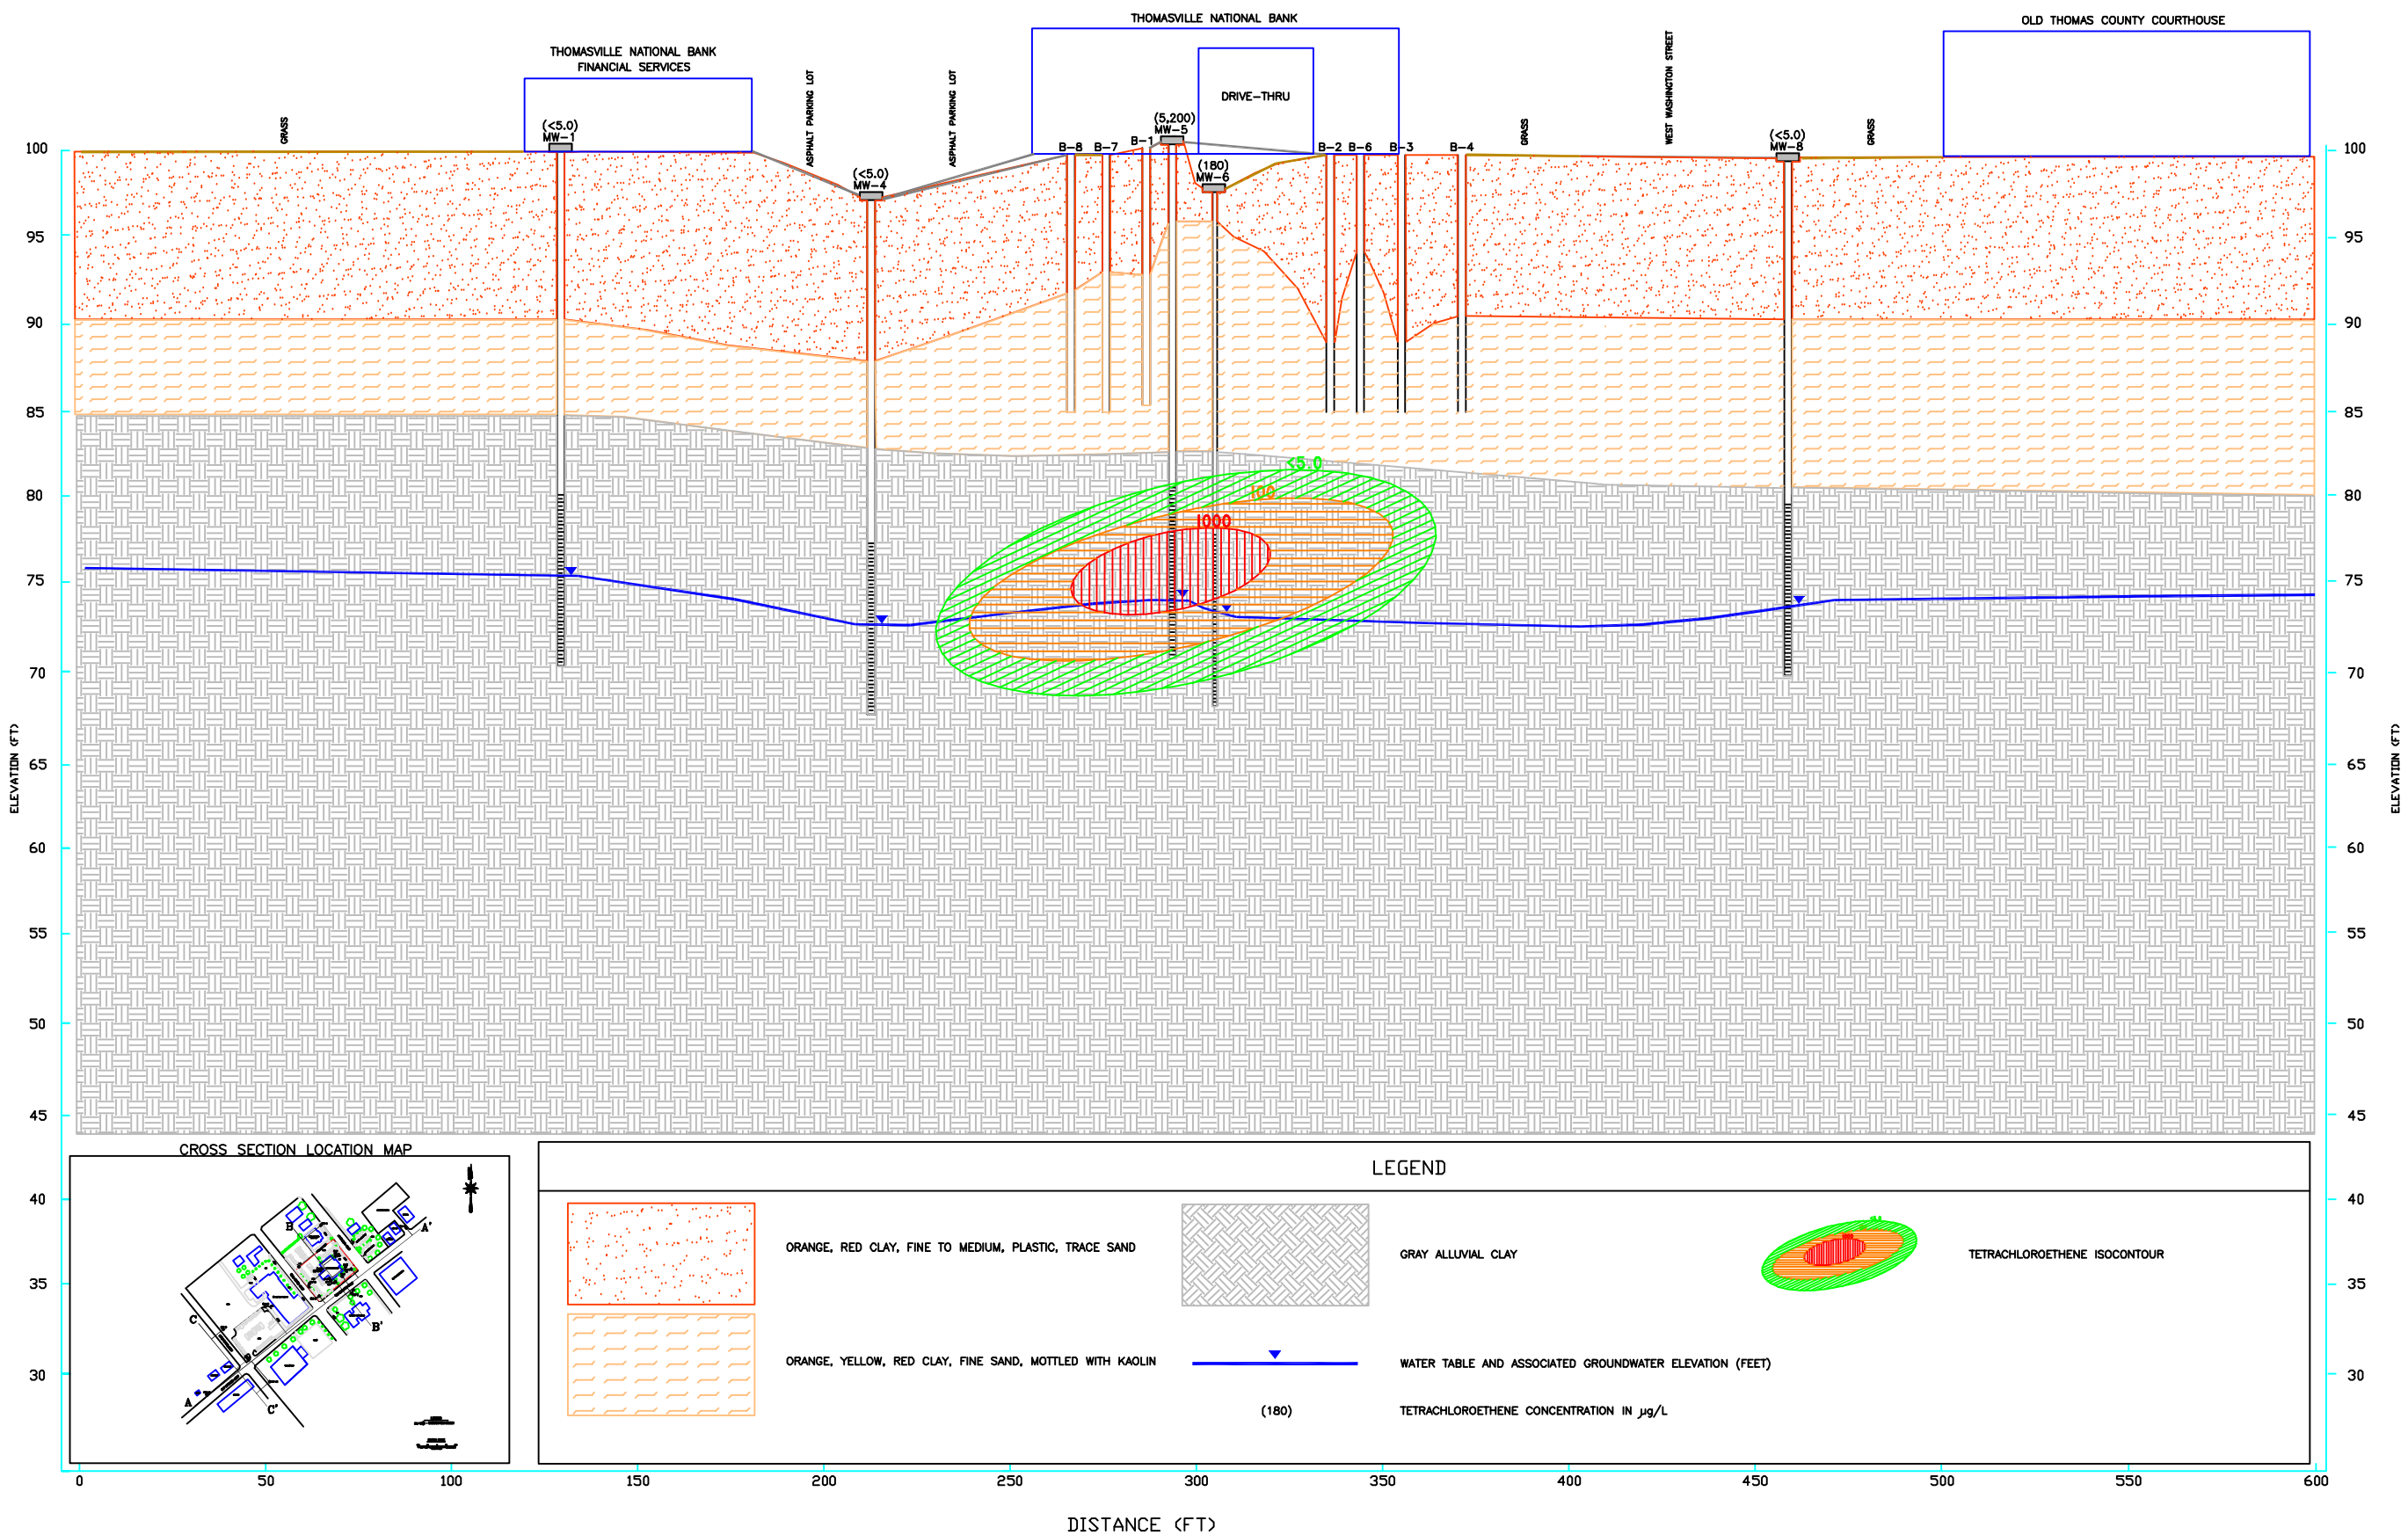

SCALE: 1" = 50' HORIZONTAL
1" = 10' VERTICAL

REV	DATE	DESCRIPTION	DWN BY	CHK BY	DES BY	APP BY
	DATE OF ISSUE 1/14/14		JPC	TAL		
			DES BY JPC	CHK BY JPM		

Peachtree Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

CSM CROSS-SECTION (B - B')

FIGURE NO. 6B

TNB 3151

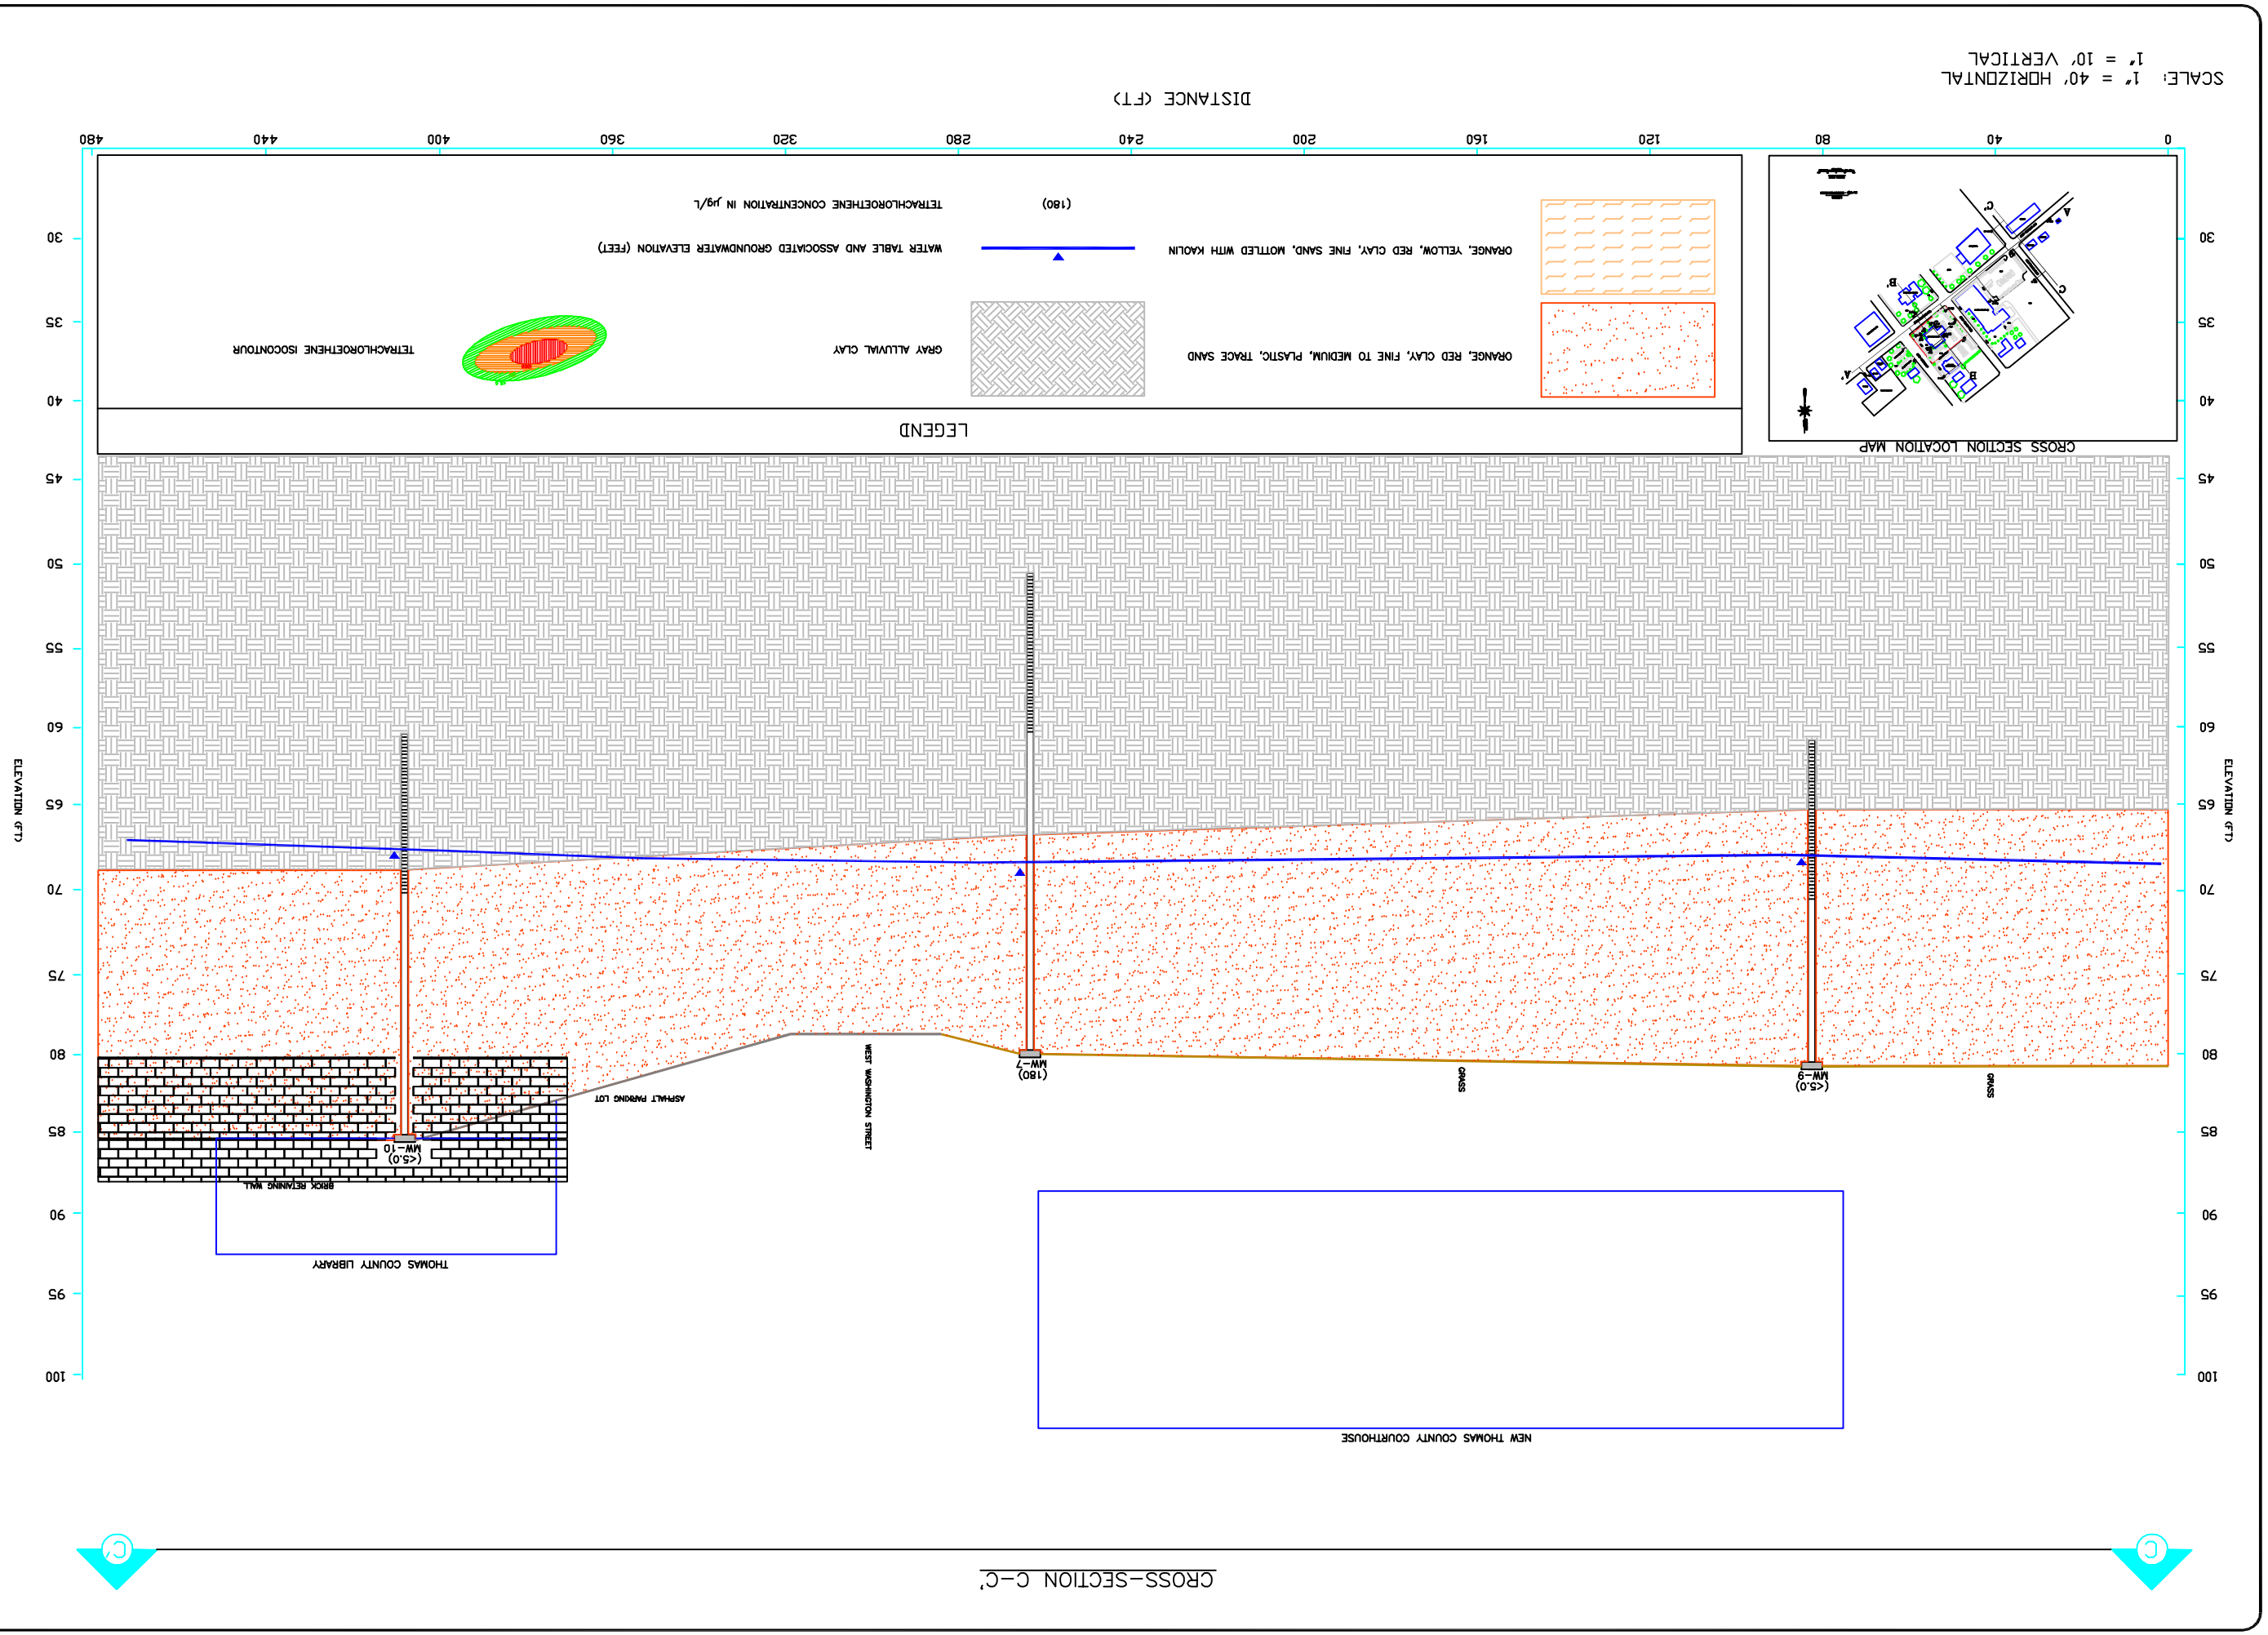

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

CSM CROSS-SECTION (C - C')

FIGURE NO.
6C
TNB
3151

Pandymer Environmental

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY

DATE OF ISSUE 1/14/14
DWN BY JPC
DES BY JPC
CHK BY TAL
APP BY JPCM

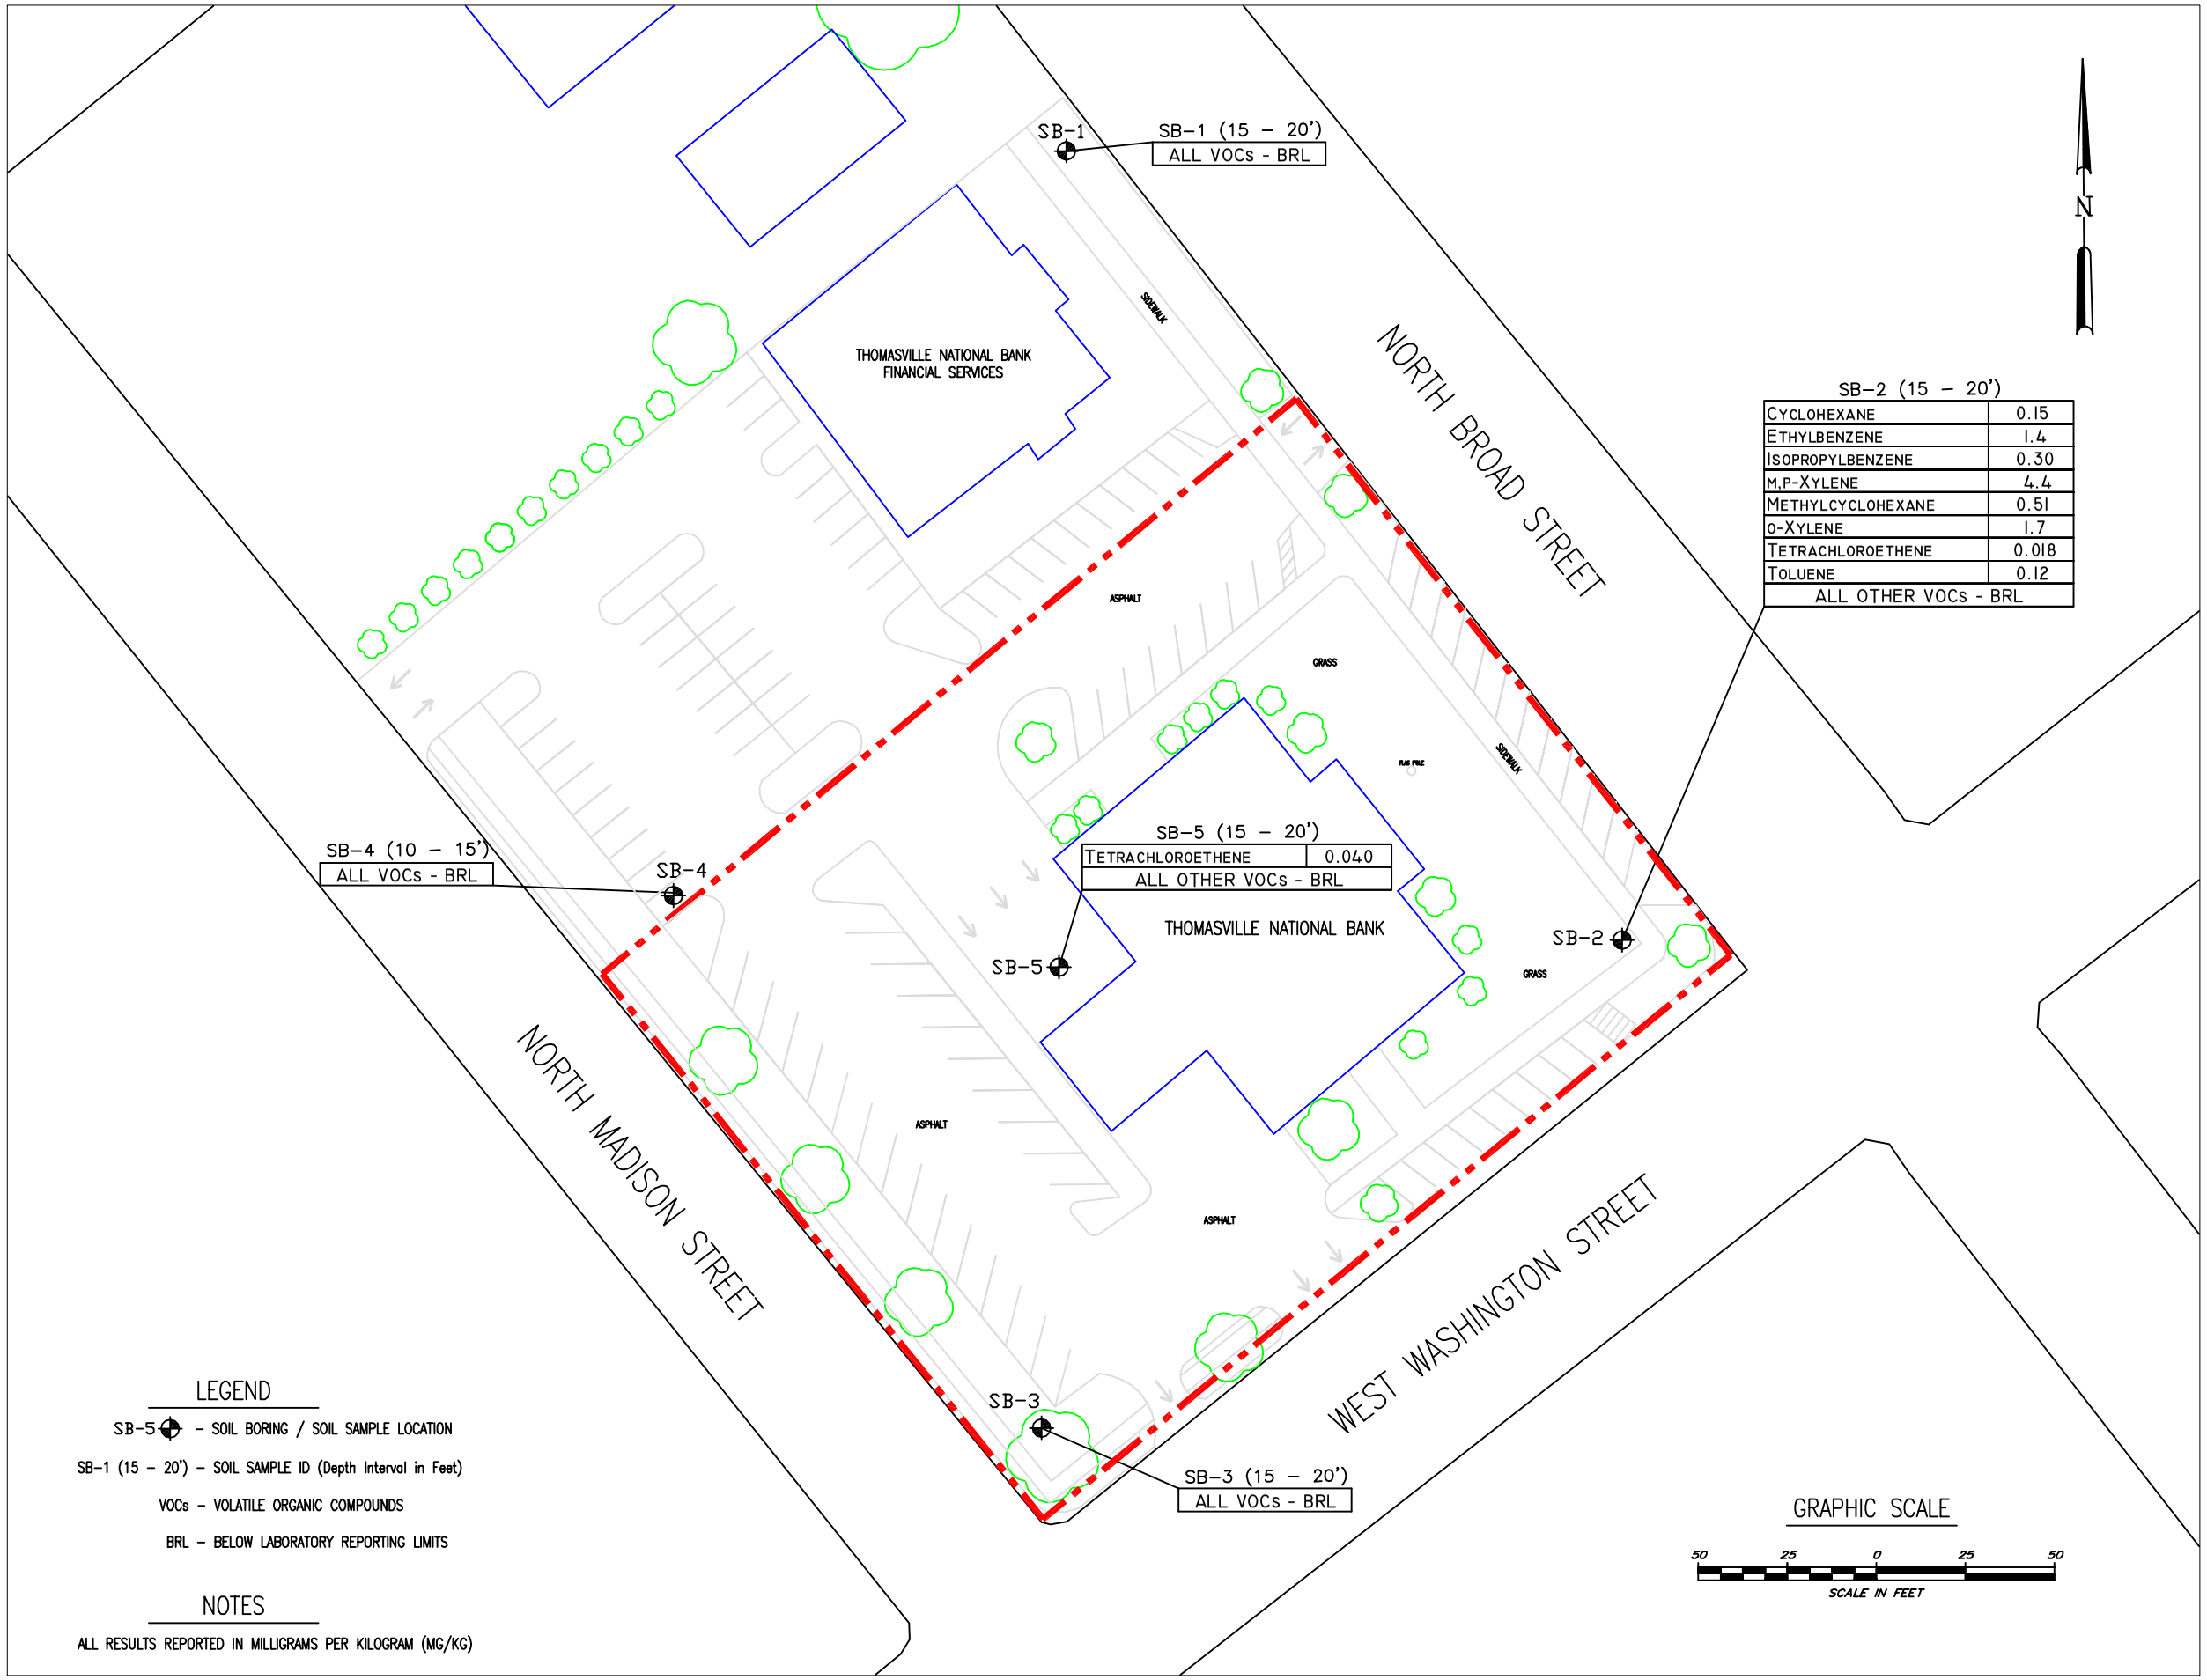

LEGEND

SB-5 ⊕ – SOIL BORING / SOIL SAMPLE LOCATION

SB-1 (15 – 20') – SOIL SAMPLE ID (Depth Interval in Feet)

VOCs – VOLATILE ORGANIC COMPOUNDS

BRL – BELOW LABORATORY REPORTING LIMITS

NOTES

ALL RESULTS REPORTED IN MILLIGRAMS PER KILOGRAM (MG/KG)

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY

DATE OF ISSUE 1/21/14
DWN BY JPC
DES BY JPC
CHK BY JPM
APP BY CHM

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

SOIL ANALTYICAL RESULTS - AUGUST 2009

FIGURE NO.
7A
THOMASVILLE
3151

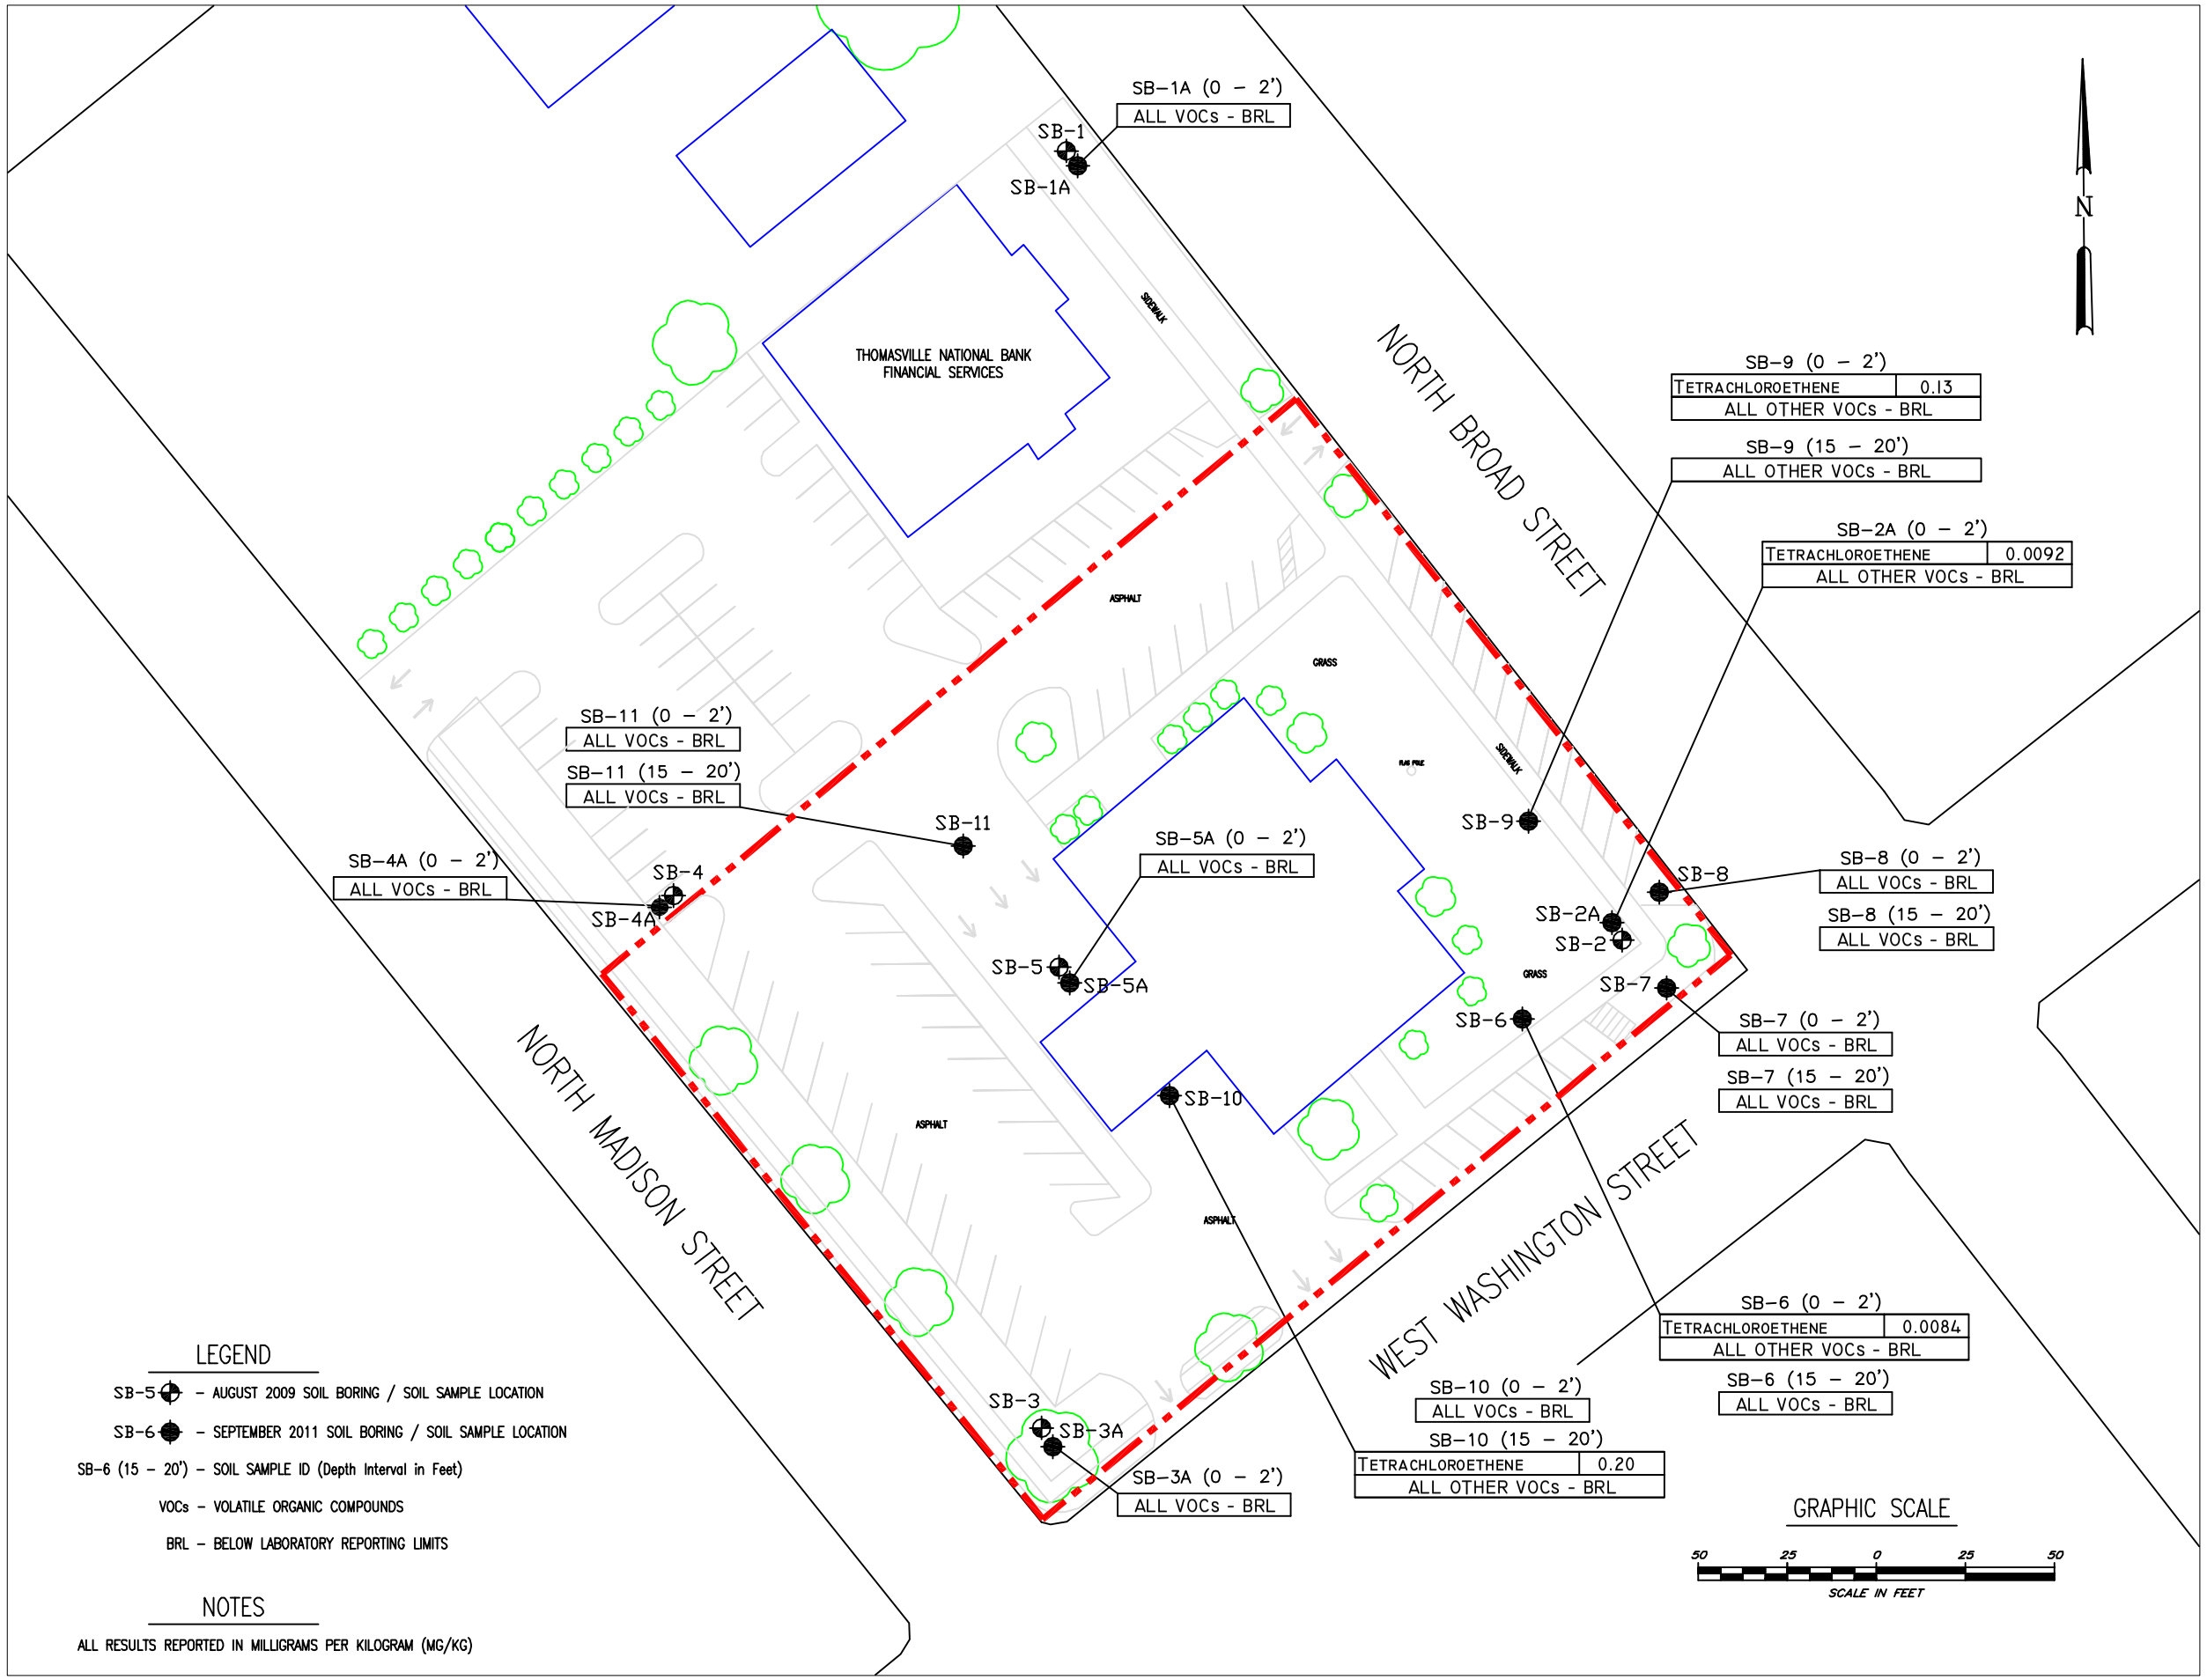

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 1/21/14		DWN BY JPC	DES BY JPC	CHK BY JPM	APP BY JPM

Peachtree Companies, Inc.

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

SOIL ANALTYICAL RESULTS - SEPTEMBER 2011

FIGURE NO. **7B**

THOMASVILLE 3151

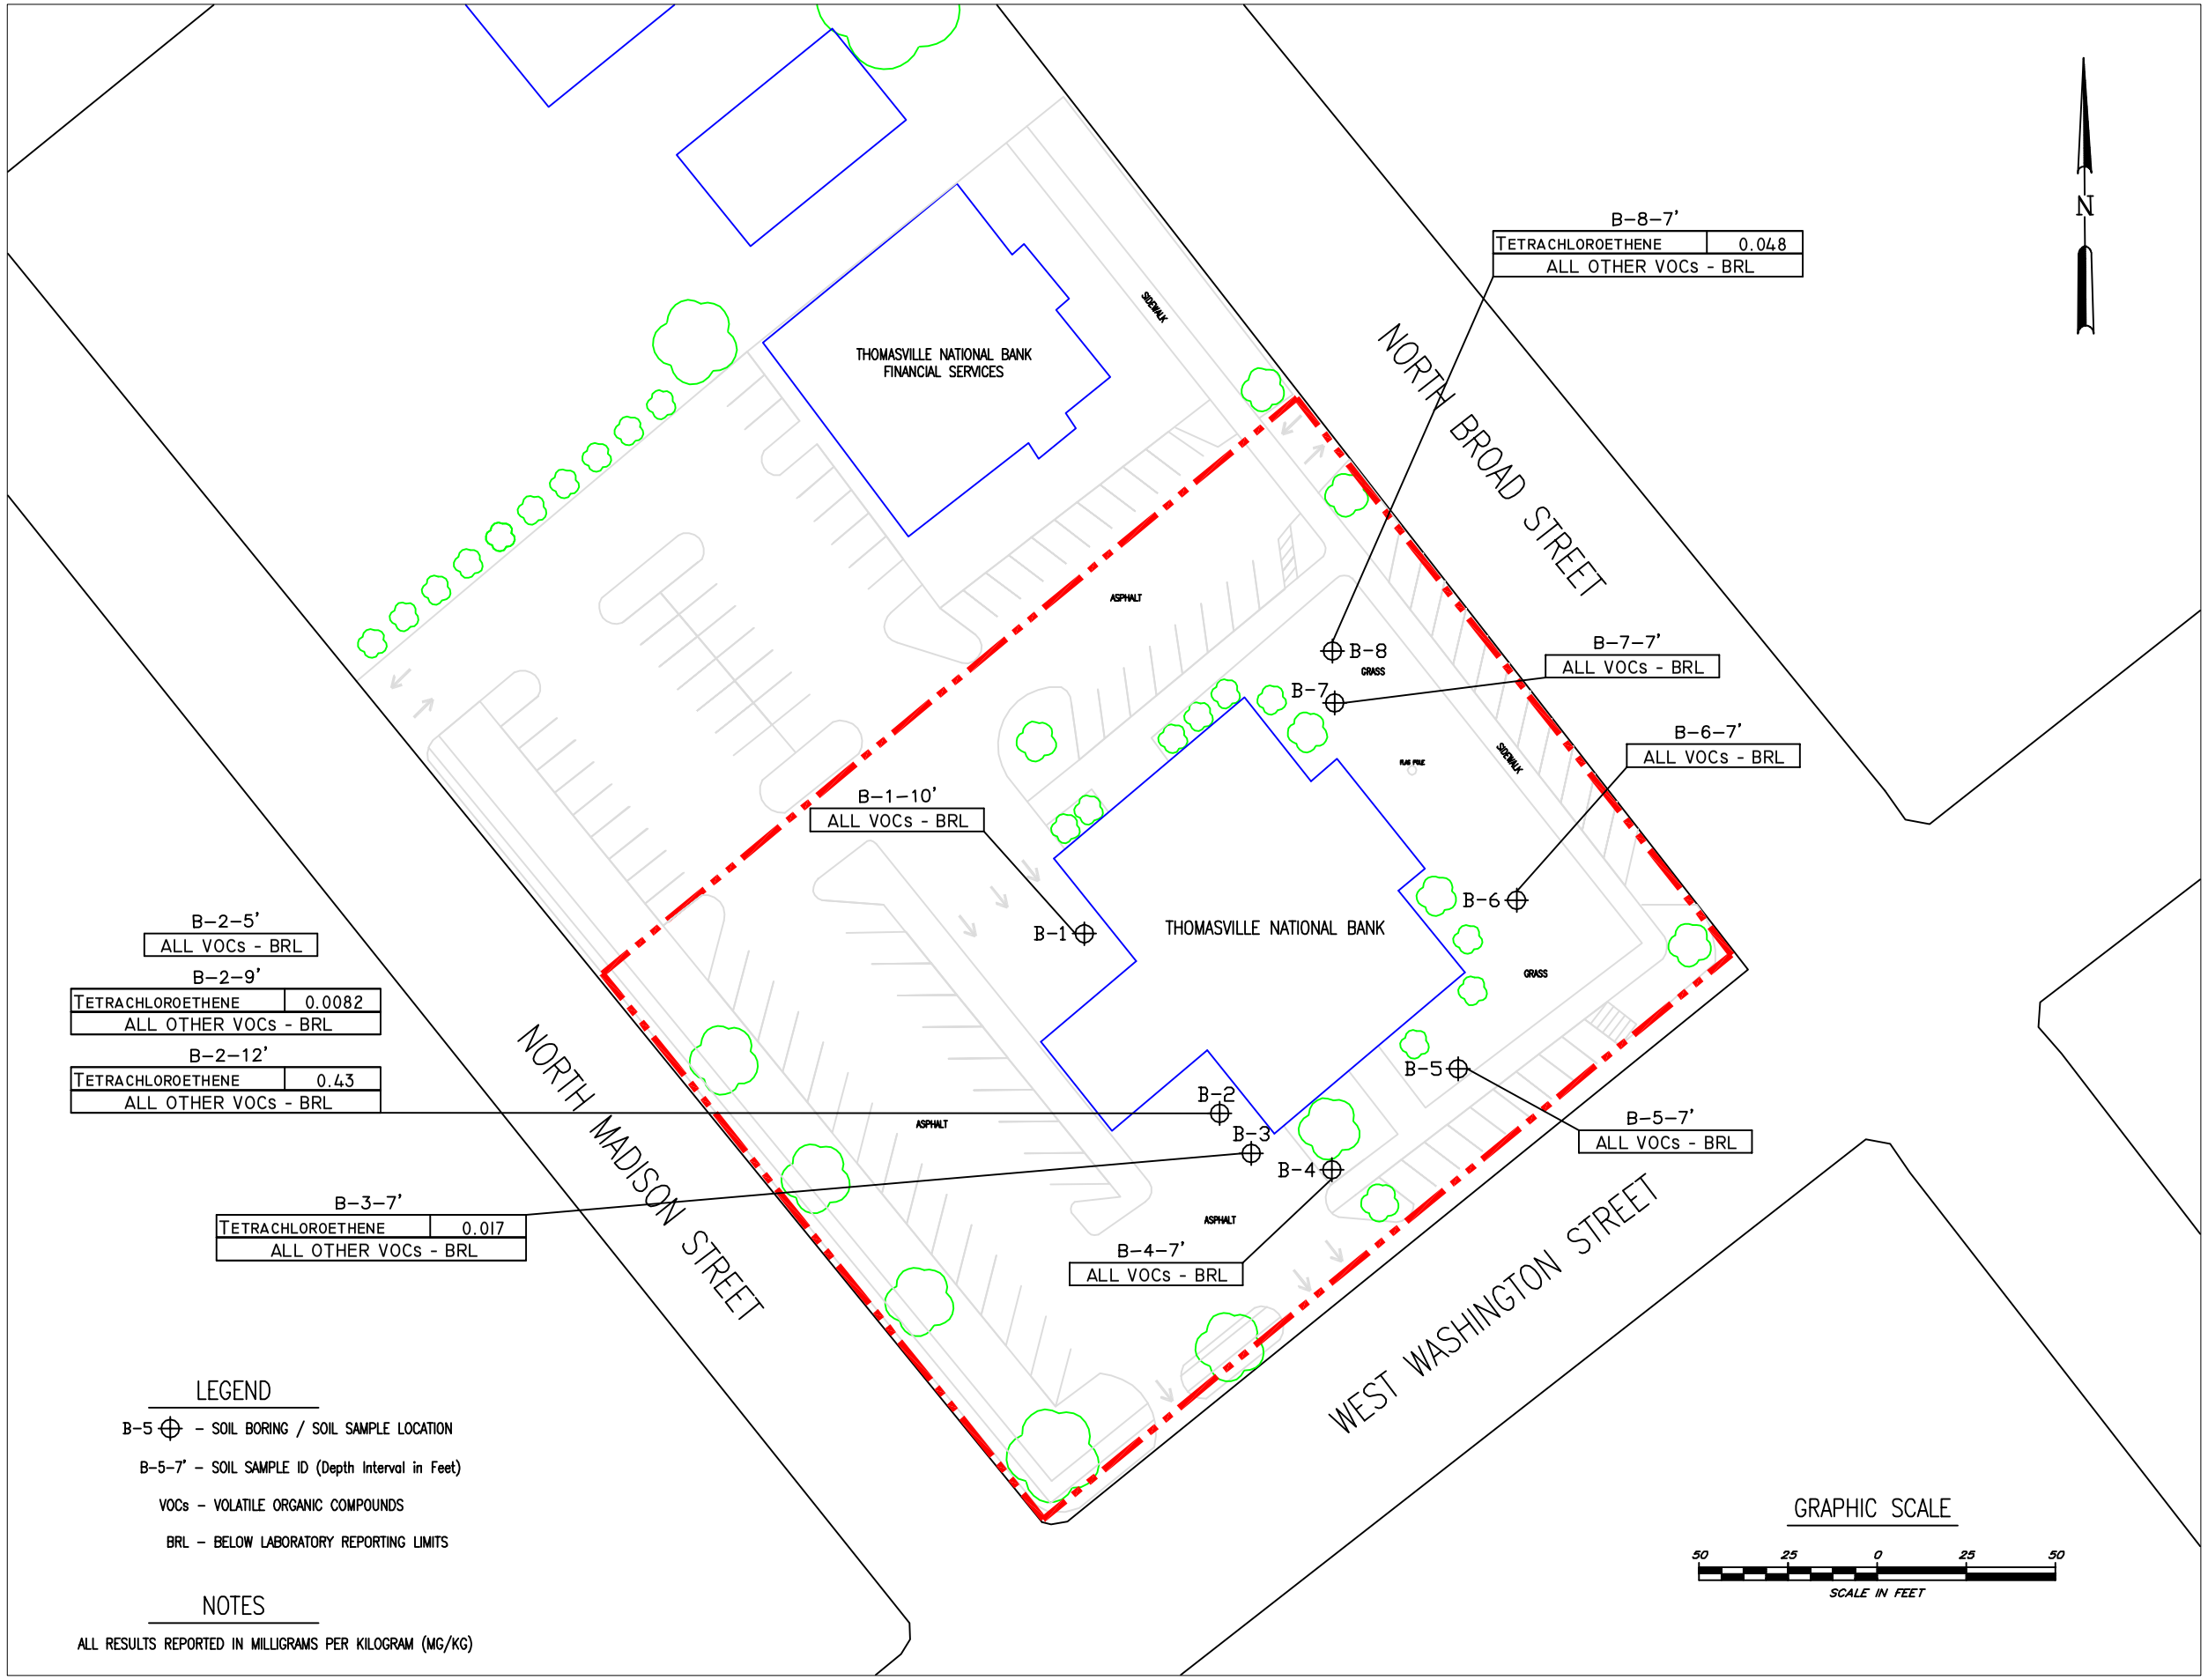

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 1/21/14		DWN BY JPC	DES BY JPC	CHK BY JPM	APP BY CHM

Pathfinder Consultants, Inc.

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

SOIL ANALTYICAL RESULTS - NOVEMBER 2013

FIGURE NO. **8**

THOMASVILLE 3151

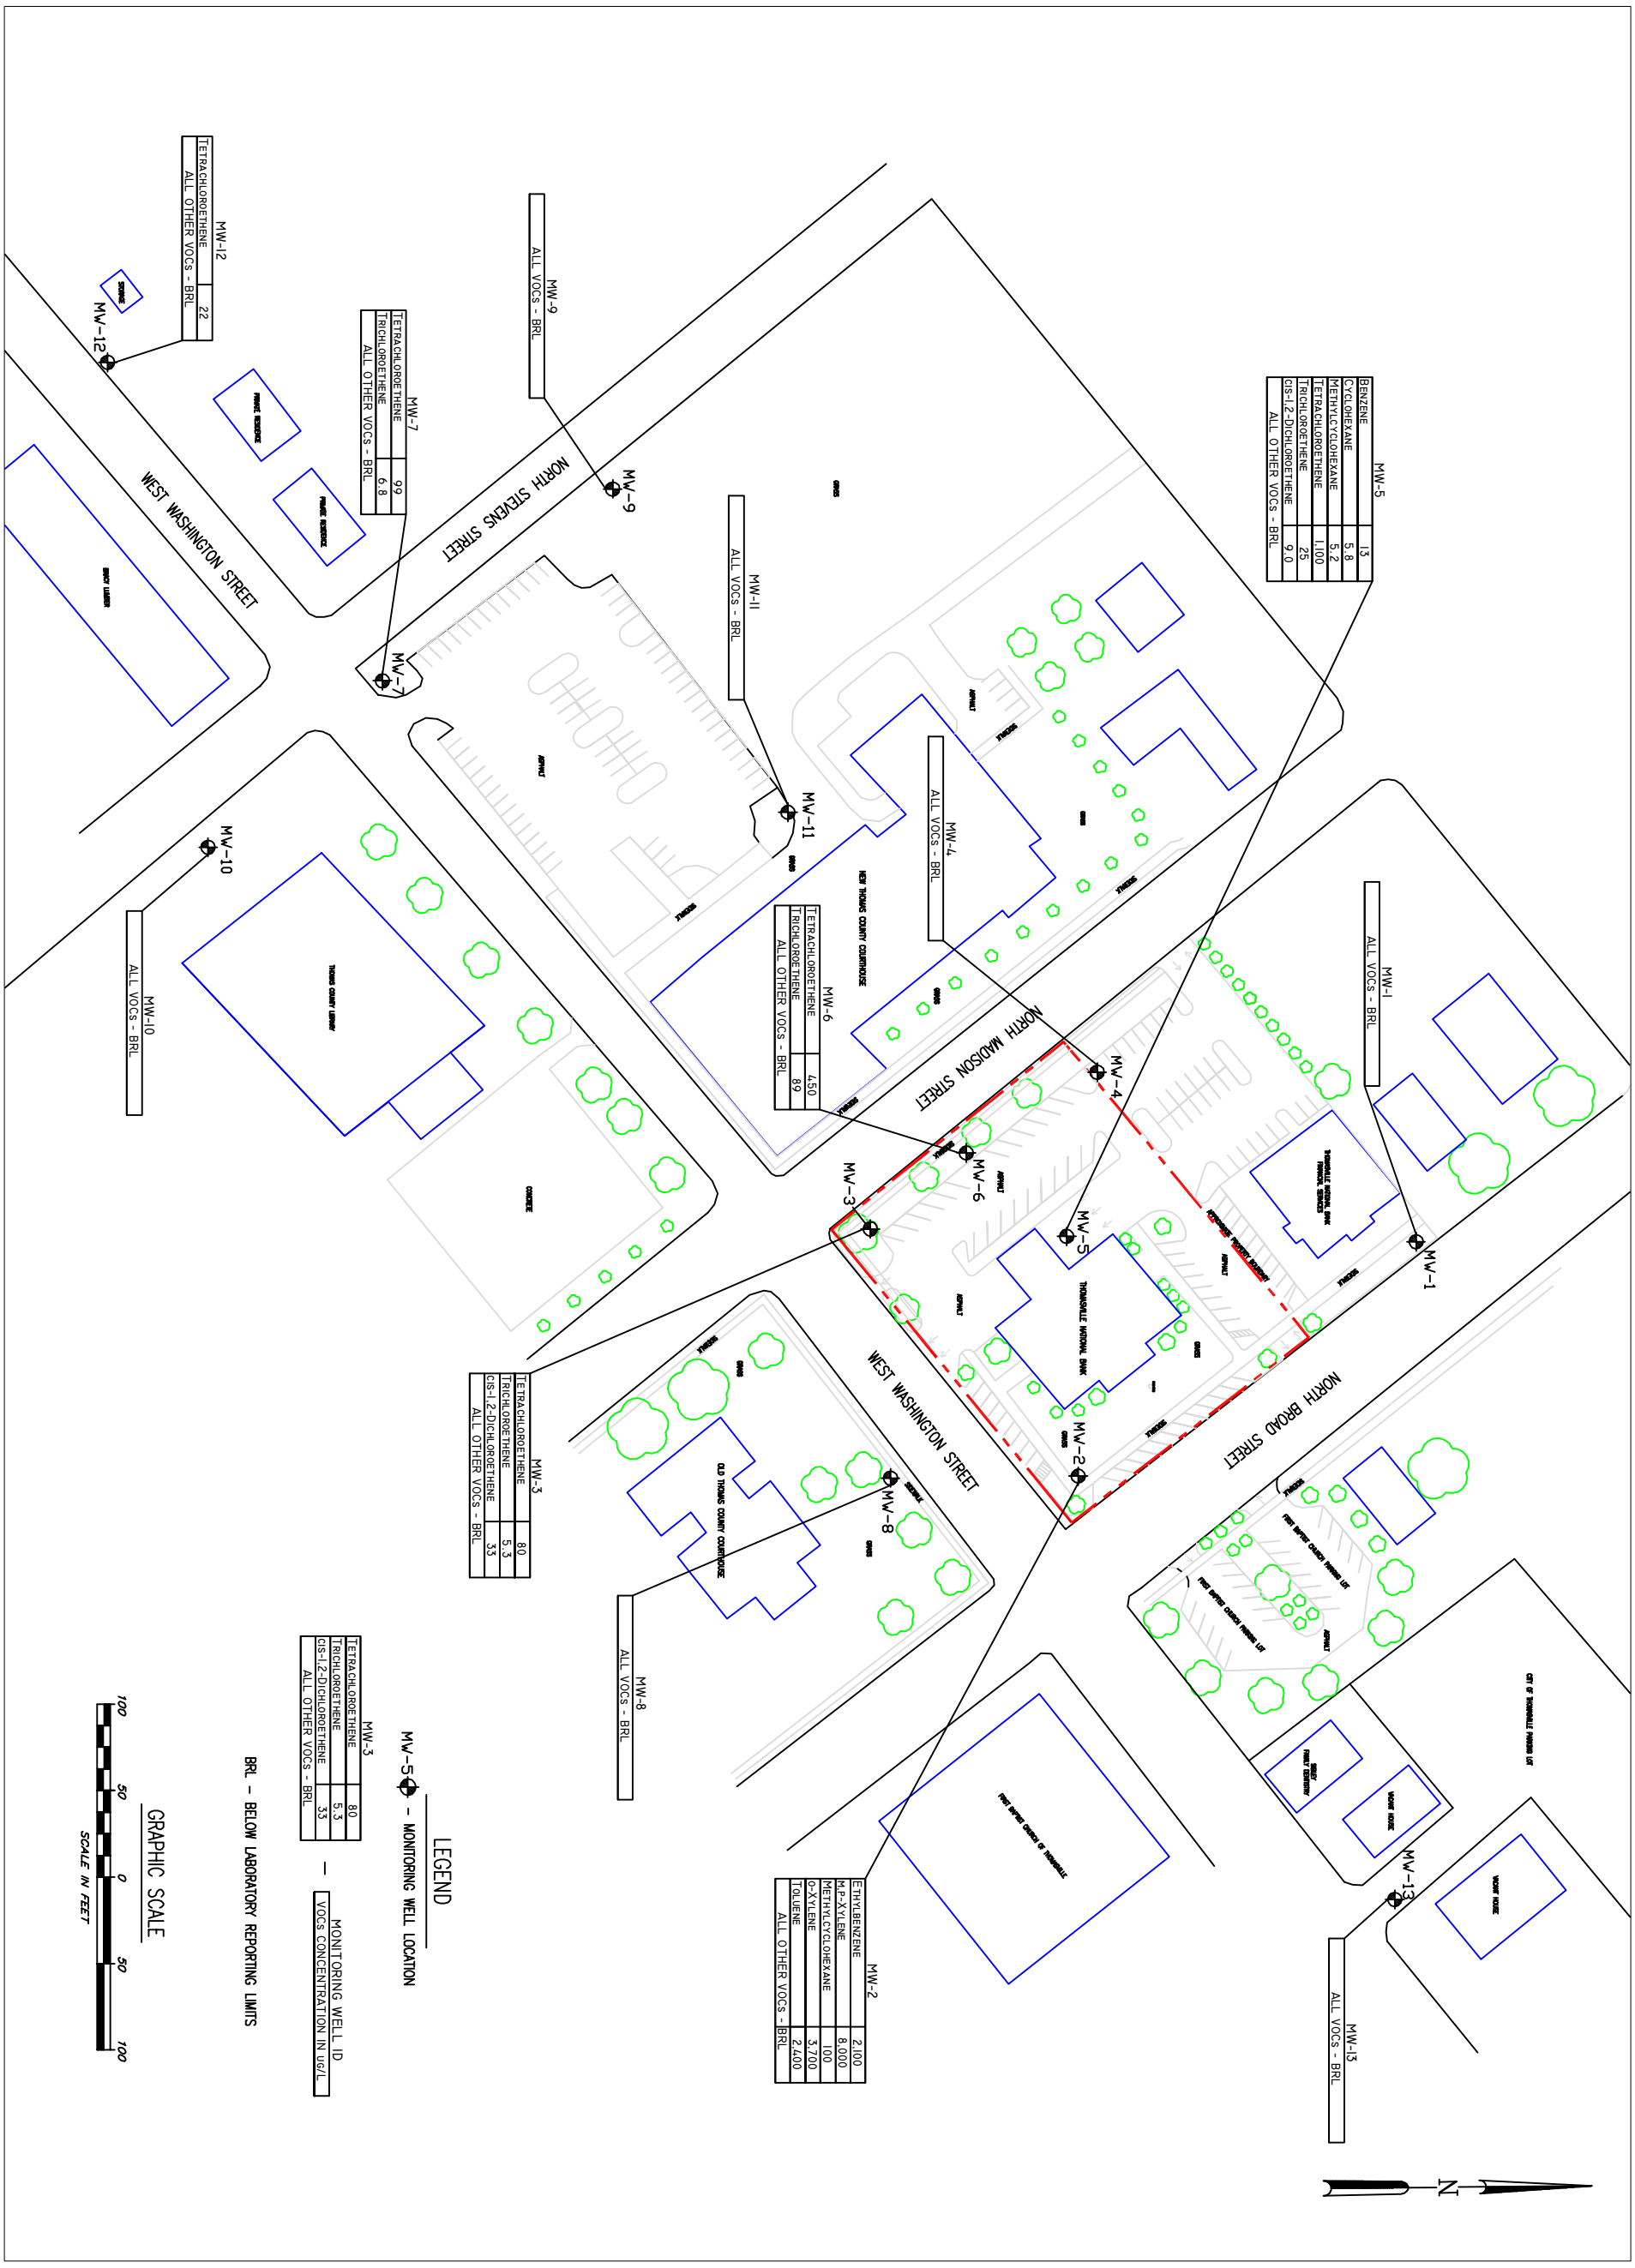

FIGURE NO.
9
THOMASVILLE
3151

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

GROUNDWATER ANALYTICAL RESULTS - JUNE 25, 2014

Peachtree Environmental

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY

DATE OF ISSUE 7/21/14 DWN BY JPC DES BY JPC CHK BY JPM APP BY CHM

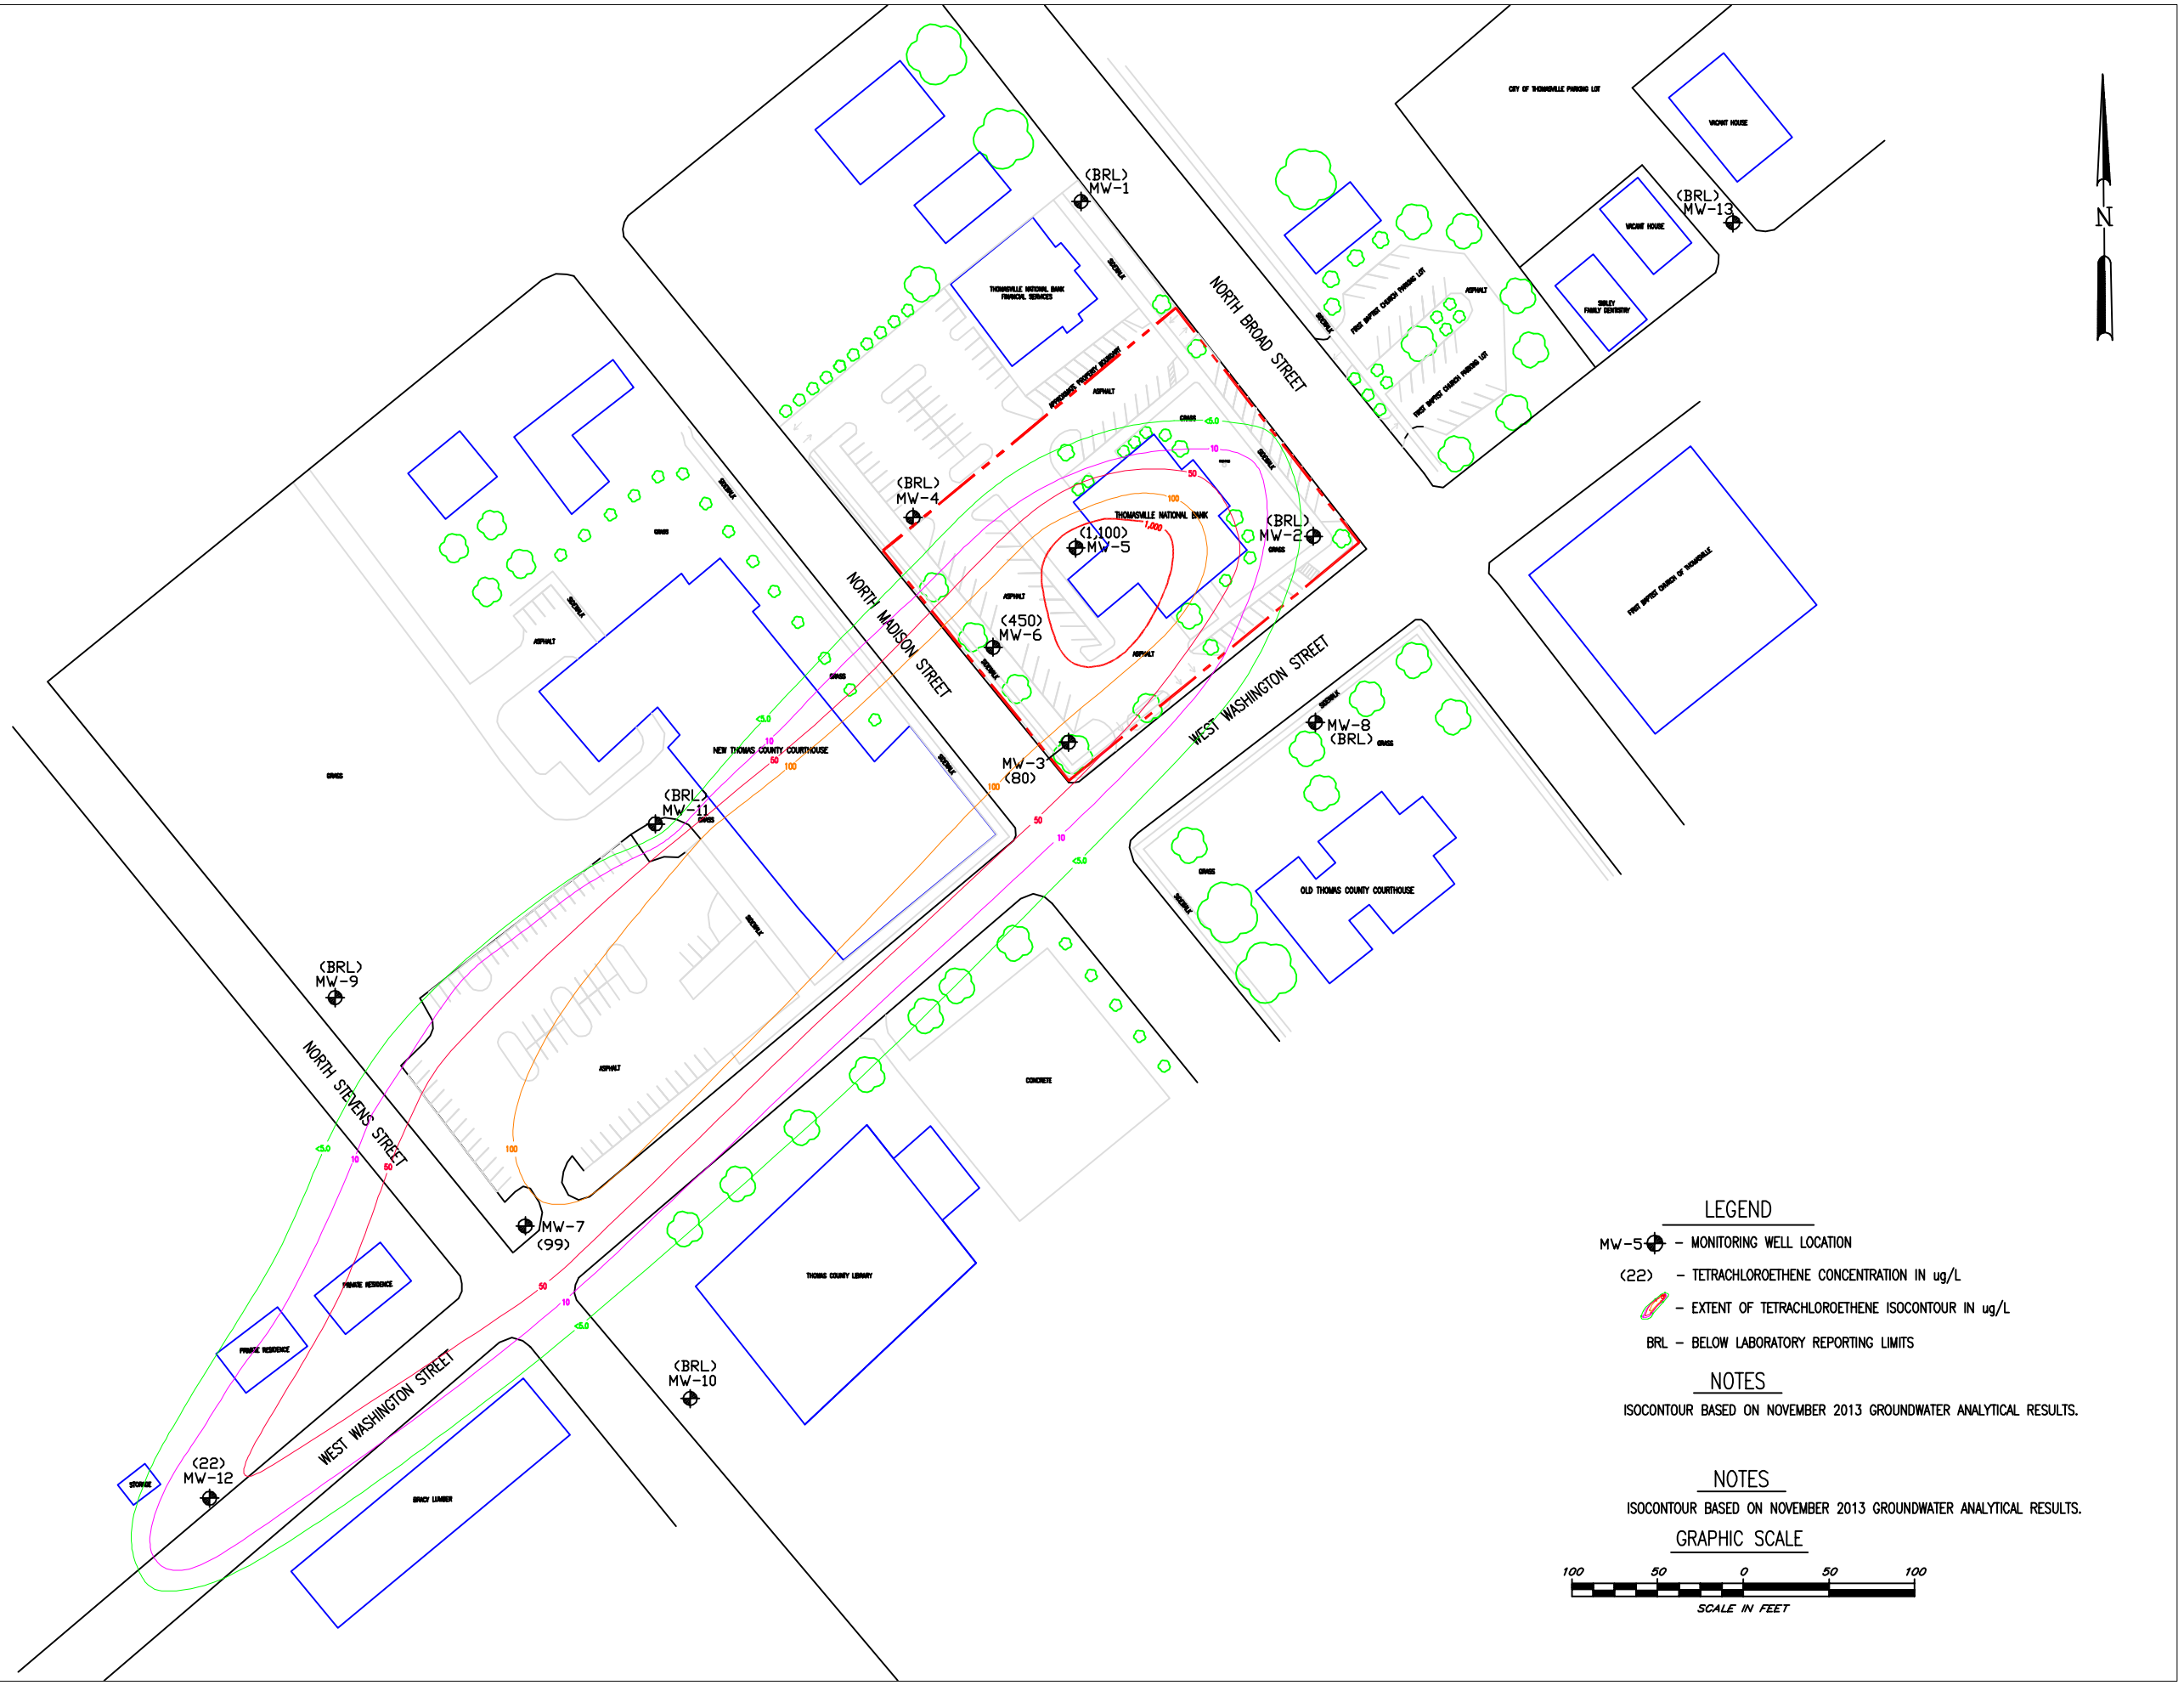

LEGEND

MW-5 – MONITORING WELL LOCATION

(22) – TETRACHLOROETHENE CONCENTRATION IN ug/L

– EXTENT OF TETRACHLOROETHENE ISOCONTOUR IN ug/L

BRL – BELOW LABORATORY REPORTING LIMITS

NOTES

ISOCONTOUR BASED ON NOVEMBER 2013 GROUNDWATER ANALYTICAL RESULTS.

NOTES

ISOCONTOUR BASED ON NOVEMBER 2013 GROUNDWATER ANALYTICAL RESULTS.

GRAPHIC SCALE

100 50 0 50 100

SCALE IN FEET

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/21/14		DWN BY JPC	DES BY JPC	CHK BY JPM	APP BY CHM

Pendleton Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

TETRACHLOROETHENE ISOCONCENTRATION MAP - JUNE 25, 2014

FIGURE NO. **10**

THOMASVILLE 3151

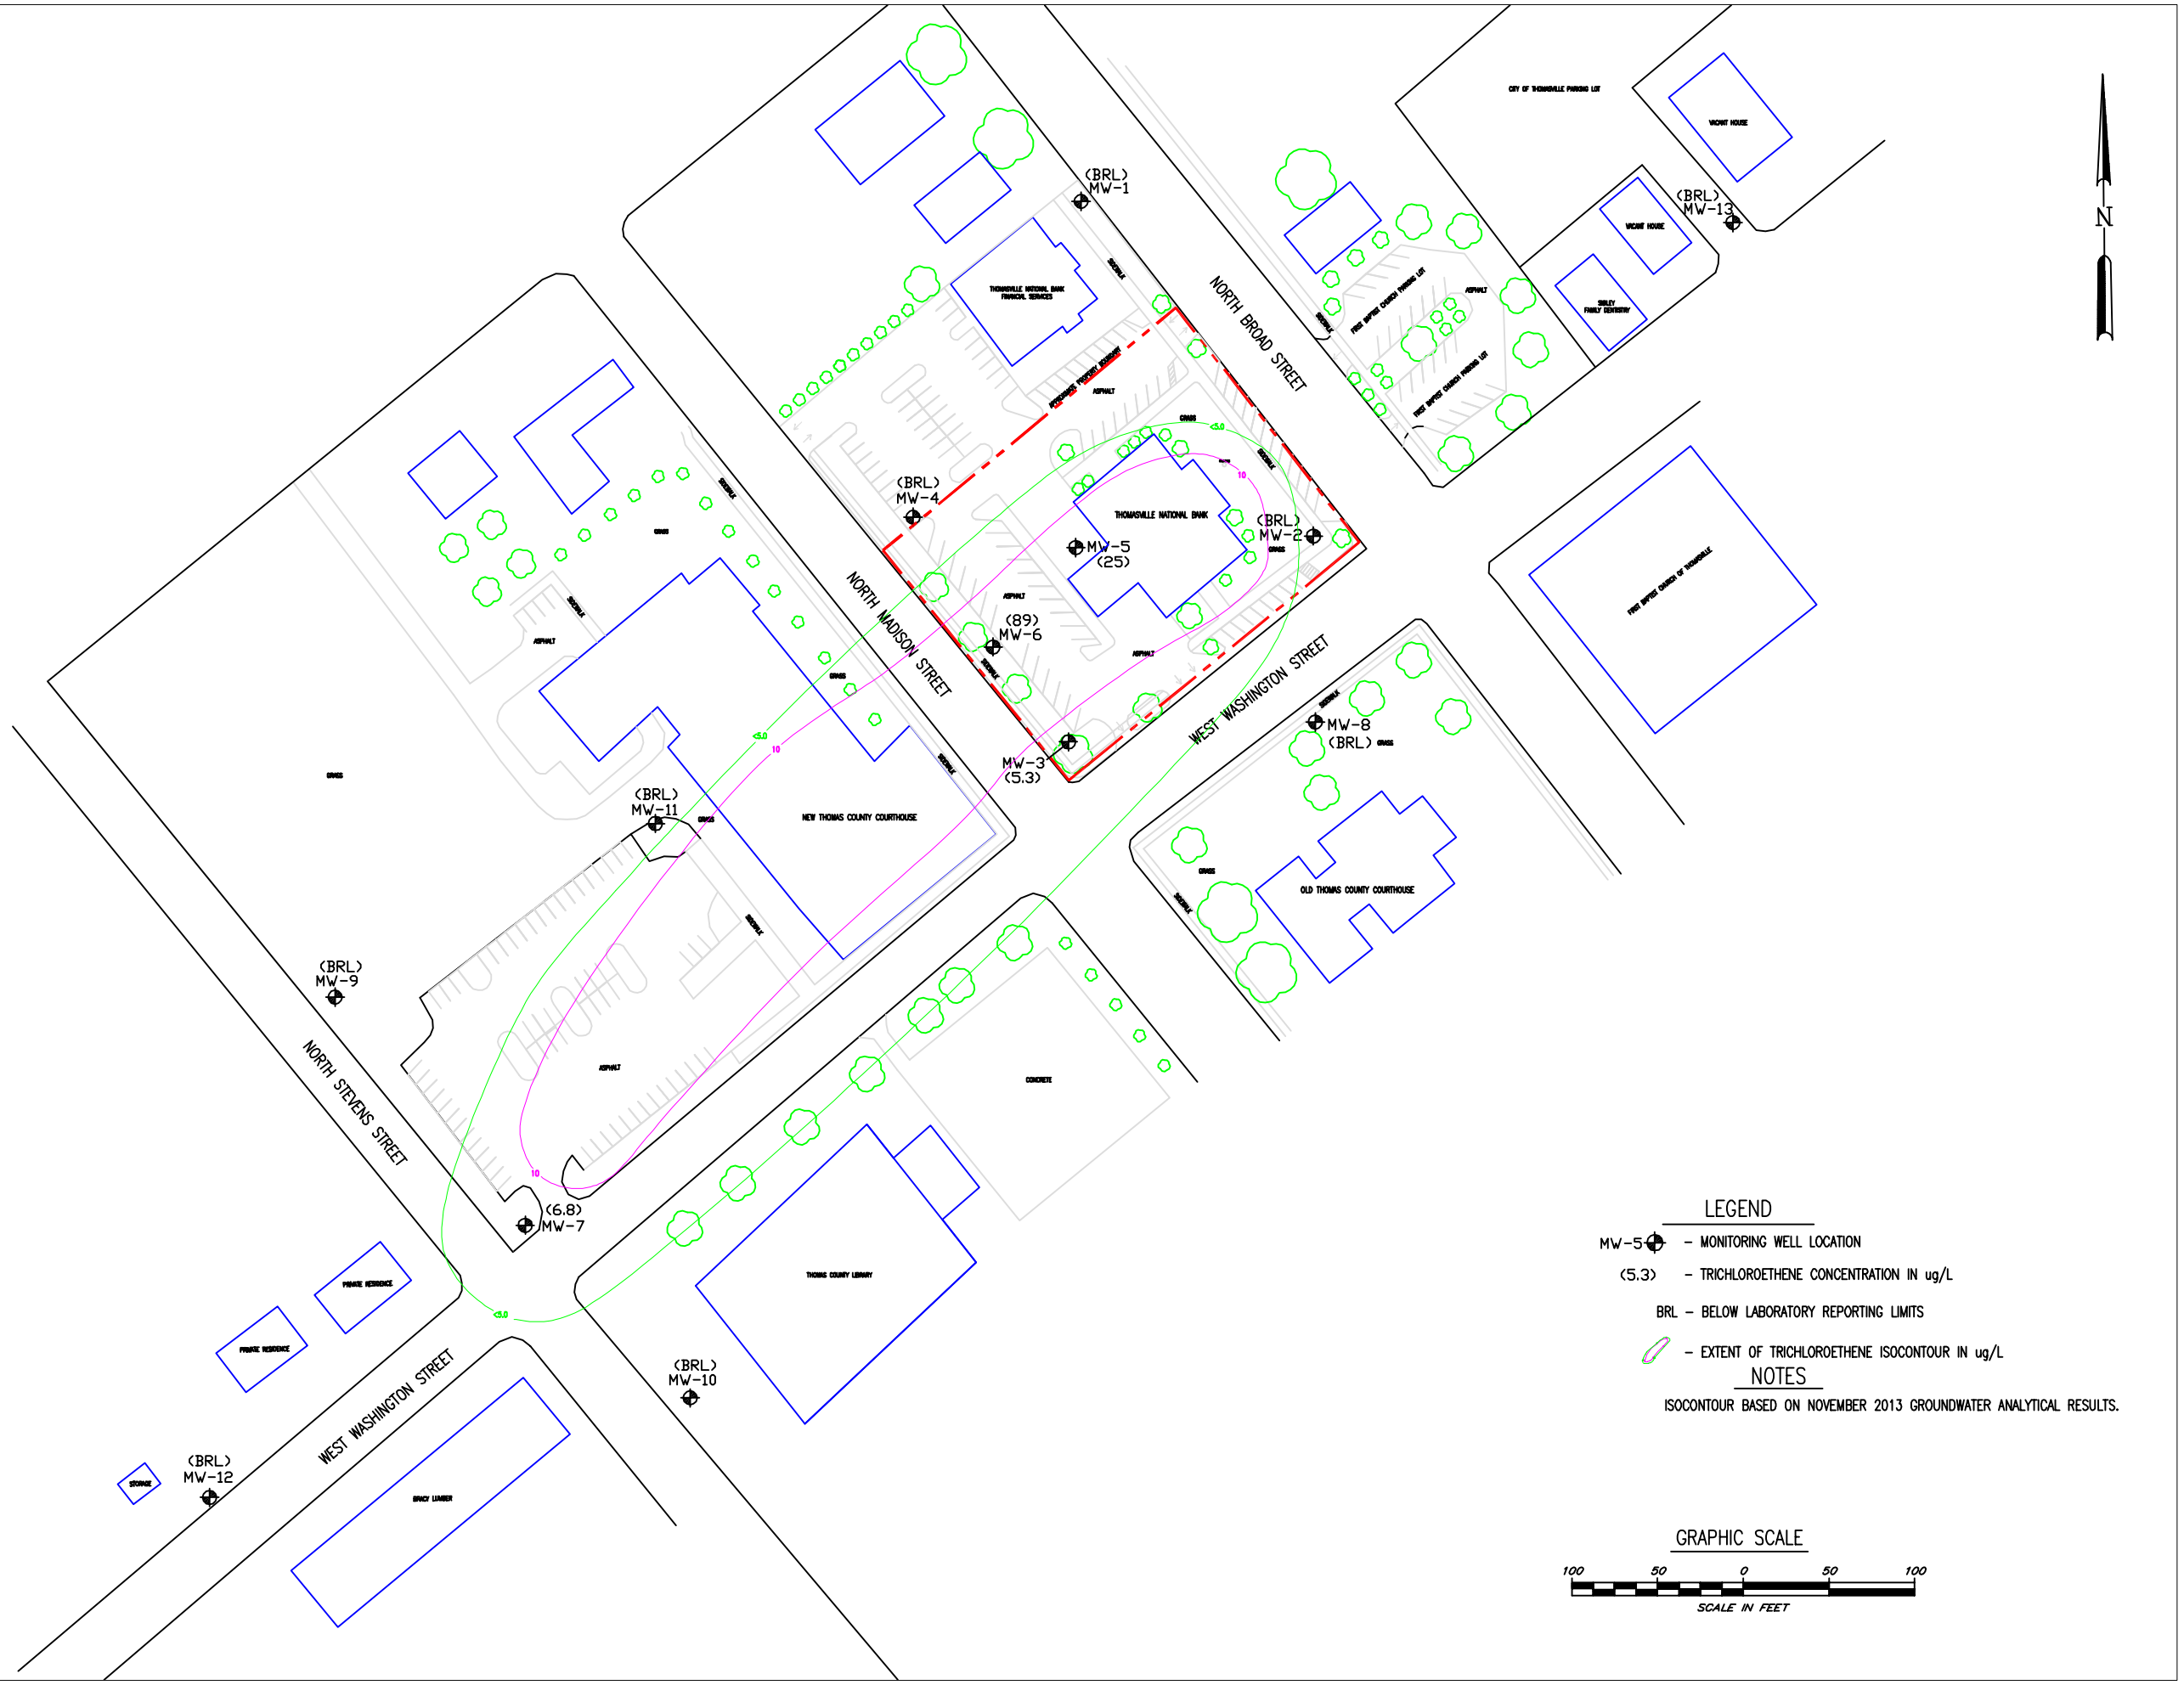

LEGEND

MW-5 – MONITORING WELL LOCATION

(5.3) – TRICHLOROETHENE CONCENTRATION IN ug/L

BRL – BELOW LABORATORY REPORTING LIMITS

– EXTENT OF TRICHLOROETHENE ISOCONTOUR IN ug/L

NOTES

ISOCONTOUR BASED ON NOVEMBER 2013 GROUNDWATER ANALYTICAL RESULTS.

GRAPHIC SCALE

100 50 0 50 100

SCALE IN FEET

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/21/14		DWN BY JPC	DES BY JPC	CHK BY JPM	APP BY CHM

Peachtree Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

TRICHLOROETHENE ISOCONCENTRATION MAP - JUNE 25, 2014

FIGURE NO. **11**

THOMASVILLE 3151

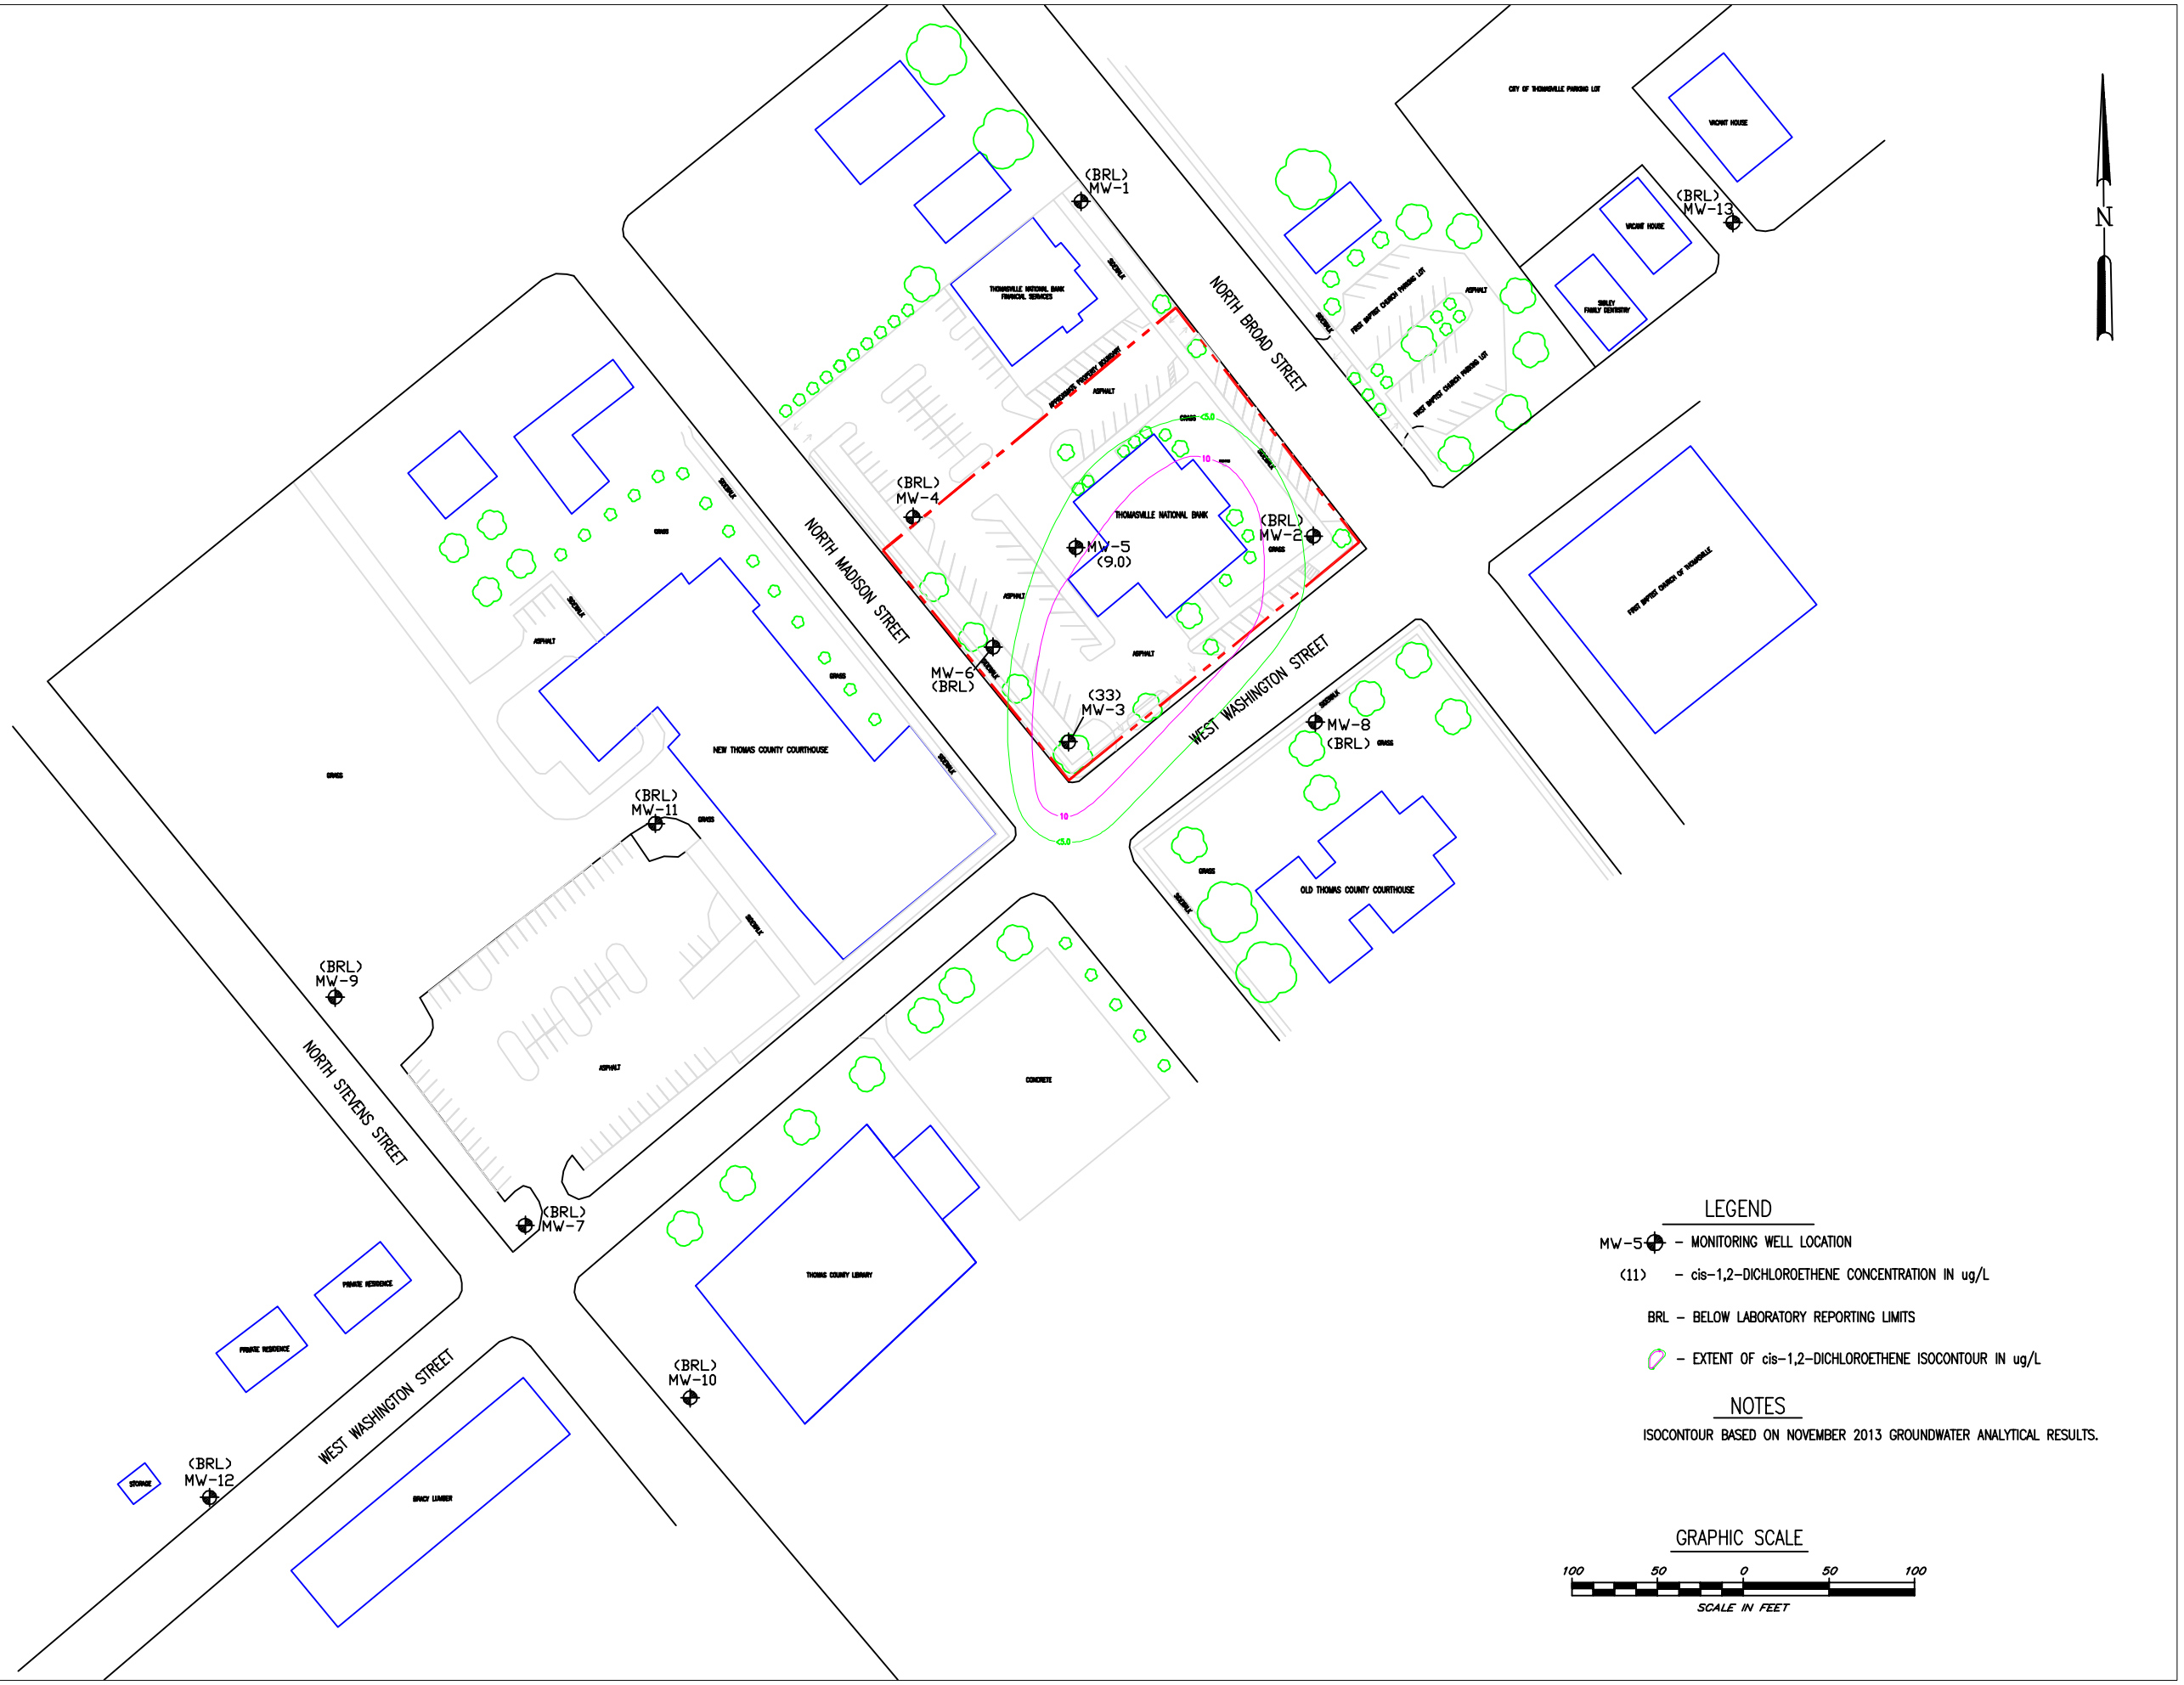

LEGEND

MW-5 – MONITORING WELL LOCATION

(11) – cis-1,2-DICHLOROETHENE CONCENTRATION IN ug/L

BRL – BELOW LABORATORY REPORTING LIMITS

– EXTENT OF cis-1,2-DICHLOROETHENE ISOCONTOUR IN ug/L

NOTES

ISOCONTOUR BASED ON NOVEMBER 2013 GROUNDWATER ANALYTICAL RESULTS.

GRAPHIC SCALE

100 50 0 50 100

SCALE IN FEET

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/21/14		DWN BY JPC	DES BY JPC	CHK BY JPM	APP BY CHM

Peachtree Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

cis-1,2-DICHLOROETHENE
ISOCONCENTRATION MAP -
JUNE 25, 2014

FIGURE NO. **12**

THOMASVILLE 3151

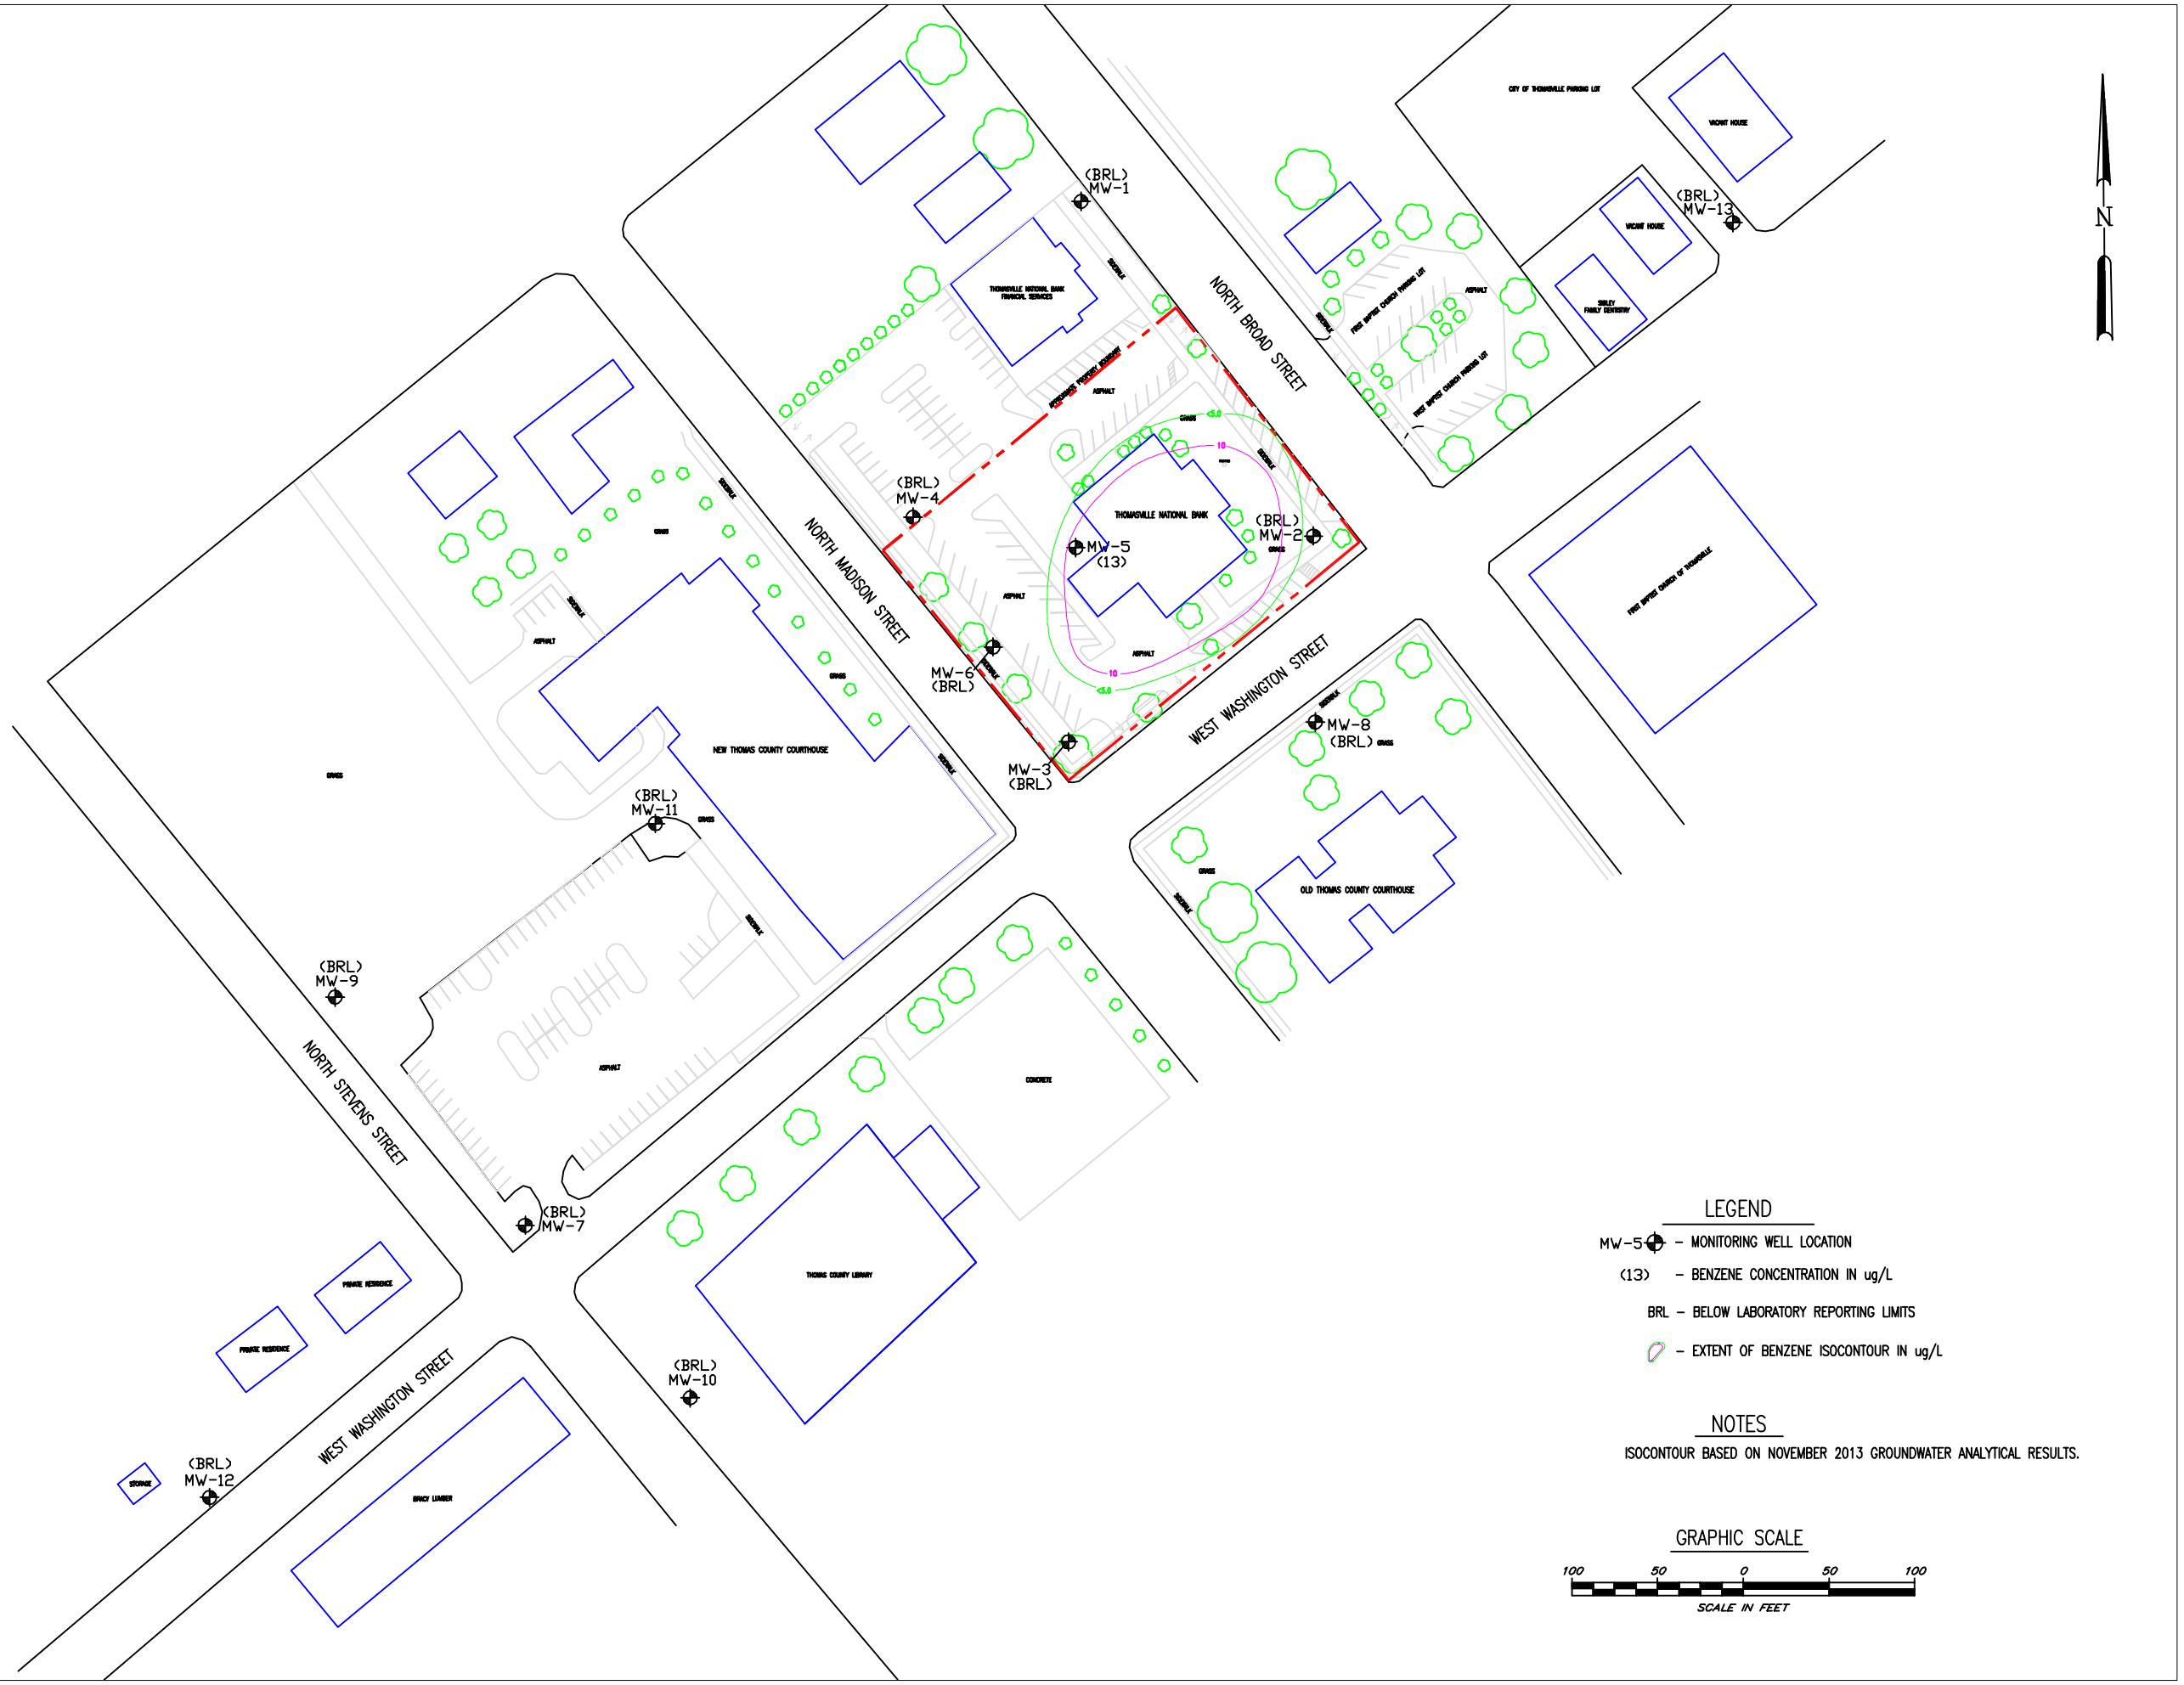

LEGEND

MW-5 – MONITORING WELL LOCATION

(13) – BENZENE CONCENTRATION IN ug/L

BRL – BELOW LABORATORY REPORTING LIMITS

– EXTENT OF BENZENE ISOCONTOUR IN ug/L

NOTES

ISOCONTOUR BASED ON NOVEMBER 2013 GROUNDWATER ANALYTICAL RESULTS.

GRAPHIC SCALE

100 50 0 50 100

SCALE IN FEET

REV	DATE	DESCRIPTION	DWN BY	DES BY	CHK BY	APP BY
	DATE OF ISSUE 7/21/14		JPC	JPC	JPM	CHM

Peachtree Environmental

THOMASVILLE NATIONAL BANK
301 NORTH BROAD STREET
THOMASVILLE, GEORGIA

BENZENE ISOCONCENTRATION MAP - JUNE 25, 2014

FIGURE NO. **13**

THOMASVILLE 3151

TABLES

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 1

Summary of Depth to Water Measurements and Monitoring Well Top of Casing Elevations

Well I.D.	Date	Top of Casing Elevation (feet)	Depth to Groundwater (feet)	Water Level Elevation (feet)
MW-1	08/21/09	100.00	24.00	76.00
	09/01/11		27.25	72.75
	06/27/12		27.08	72.92
	06/06/13		25.42	74.58
	11/22/13		24.61	75.39
	06/24/14		22.36	77.64
MW-2	08/21/09	100.00	24.75	75.25
	09/01/11		27.42	72.58
	06/27/12		27.34	72.66
	06/06/13		25.74	74.26
	11/22/13		25.14	74.86
	06/24/14		23.17	76.83
MW-3	08/21/09	98.22	24.11	74.11
	09/01/11		26.61	71.61
	06/27/12		26.49	71.73
	06/06/13		25.00	73.22
	11/22/13		24.37	73.85
	06/24/14		22.47	75.75
MW-4	08/21/09	97.36	23.21	74.15
	09/01/11		25.91	71.45
	06/27/12		25.72	71.64
	06/06/13		24.15	73.21
	11/22/13		23.50	73.86
	06/24/14		21.39	75.97
MW-5	08/21/09	100.40	25.72	74.68
	09/01/11		28.40	72.00
	06/27/12		28.28	72.12
	06/06/13		26.75	73.65
	11/22/13		26.03	74.37
	06/24/14		24.04	76.36
MW-6	06/27/12	97.92	26.20	71.72
	06/06/13		24.75	73.17
	11/22/13		24.07	73.85
	06/24/14		22.08	75.84
MW-7	06/27/12	80.74	12.41	68.33
	06/06/13		11.94	68.80
	11/22/13		12.47	68.27
	06/24/14		11.14	69.60
MW-8	06/27/12	99.90	27.53	72.37
	06/06/13		26.10	73.80
	11/22/13		25.48	74.42
	06/24/14		23.65	76.25
MW-9	11/22/13	81.19	12.71	68.48
	06/24/14		11.15	70.04
MW-10	11/22/13	85.67	18.17	67.50
	06/24/14		16.49	69.18
MW-11	11/22/13	90.65	19.91	70.74
	06/24/14		17.86	72.79
MW-12	11/22/13	65.53	3.57	61.96
	06/24/14		2.89	62.64
MW-13	11/22/13	97.16	21.54	75.62
	06/24/14		19.55	77.61

NOTES:

1. Top of casing elevation for MW-1 assigned an elevation of 100.00 feet above mean sea level and remaining monitoring well top of casing elevations were surveyed relative to MW-1 top of casing elevation by Peachtree Environmental personnel.

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 2

August 2009 and September 2011 Soil Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS (<2 FT / >2 FT-BGS)	TNB-0809-SB1 (15 - 20')	TNB-0809-SB2 (15 - 20')	TNB-0809-SB3 (15 - 20')	TNB-0809-SB4 (10 - 15')	TNB-0809-SB5 (15 - 20')
SAMPLE DATE		8/20/2009	8/20/2009	8/20/2009	8/21/2009	8/20/2009
ANALYTES	MG/KG	LABORATORY RESULTS (MG/KG)				
TCL Volatile Organics						
1,1,1-Trichloroethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,1,2,2-Tetrachloroethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,1,2-Trichloroethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,1-Dichloroethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,1-Dichloroethene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2,4-Trichlorobenzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2-Dibromo-3-chloropropane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2-Dibromoethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2-Dichlorobenzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2-Dichloroethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,2-Dichloropropane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,3-Dichlorobenzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
1,4-Dichlorobenzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
2-Butanone	NC	<0.069	<0.089	<0.15	<0.083	<0.063
2-Hexanone	NC	<0.014	<0.018	<0.031	<0.017	<0.013
4-Methyl-2-pentanone	NC	<0.014	<0.018	<0.031	<0.017	<0.013
Acetone	NC	<0.14	<0.18	<0.31	<0.17	<0.13
Benzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Bromodichloromethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Bromoform	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Bromomethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Carbon disulfide	NC	<0.014	<0.018	<0.031	<0.017	<0.013
Carbon tetrachloride	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Chlorobenzene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Chloroethane	NC	<0.014	<0.018	<0.031	<0.017	<0.013
Chloroform	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Chloromethane	NC	<0.014	<0.018	<0.031	<0.017	<0.013
cis-1,2-Dichloroethene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
cis-1,3-Dichloropropene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Cyclohexane	**20 / 20**	<0.0069	**0.15**	<0.015	<0.0083	<0.0063
Dibromochloromethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Dichlorodifluoromethane	NC	<0.014	<0.018	<0.031	<0.017	<0.013
Ethylbenzene	**70 / 70**	<0.0069	**1.4**	<0.015	<0.0083	<0.0063
Freon-113	NC	<0.014	<0.018	<0.031	<0.017	<0.013
Isopropylbenzene	**21.88 / 21.88**	<0.0069	**0.30**	<0.015	<0.0083	<0.0063
m,p-Xylene	**1,000 / 1,000**	<0.014	**4.4**	<0.031	<0.017	<0.013
Methyl acetate	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Methyl tert-butyl ether	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Methylcyclohexane	NR	<0.0069	**0.51**	<0.015	<0.0083	<0.0063
Methylene chloride	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
o-Xylene	**1,000 / 1,000**	<0.0069	**1.7**	<0.015	<0.0083	<0.0063
Styrene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Tetrachloroethene	**0.5 / 0.5**	<0.0069	**0.018**	<0.015	<0.0083	**0.040**
Toluene	**100 / 100**	<0.0069	**0.12**	<0.015	<0.0083	<0.0063
trans-1,2-Dichloroethene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
trans-1,3-Dichloropropene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Trichloroethene	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Trichlorofluoromethane	NC	<0.0069	<0.0089	<0.015	<0.0083	<0.0063
Vinyl chloride	NC	<0.014	<0.018	<0.031	<0.017	<0.013

NOTES:

Bolded numbers denote concetrations above laboratory detection limits

Bolded and bracketed numbers denote concentrations above Type 3 RRS

NC - Type 1/3 RRS were not calculated for analyte (Analyte was not detected above laboratory detection limits)

NR - Not Regulated, Compound not regulated by HSRA

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 2

August 2009 and September 2011 Soil Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS (<2 FT / >2 FT-BGS)	TNB-0911-SB6 (0 - 2')	TNB-0809-SB6 (15 - 20')	TNB-0911-SB7 (0 - 2')	TNB-0809-SB7 (15 - 20')	TNB-0911-SB8 (0 - 2')	TNB-0809-SB8 (15 - 20')
SAMPLE DATE		9/1/2011	9/1/2011	9/1/2011	8/20/2009	9/1/2011	8/20/2009
ANALYTES	MG/KG	LABORATORY RESULTS (MG/KG)					
TCL Volatile Organics							
1,1,1-Trichloroethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,1,2,2-Tetrachloroethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,1,2-Trichloroethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,1-Dichloroethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,1-Dichloroethene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2,4-Trichlorobenzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2-Dibromo-3-chloropropane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2-Dibromoethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2-Dichlorobenzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2-Dichloroethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,2-Dichloropropane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,3-Dichlorobenzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
1,4-Dichlorobenzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
2-Butanone	NC	<0.061	<0.069	<0.074	<0.081	<0.070	<0.071
2-Hexanone	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
4-Methyl-2-pentanone	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Acetone	NC	<0.12	<0.14	<0.15	<0.16	<0.14	<0.14
Benzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Bromodichloromethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Bromoform	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Bromomethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Carbon disulfide	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Carbon tetrachloride	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Chlorobenzene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Chloroethane	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Chloroform	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Chloromethane	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
cis-1,2-Dichloroethene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
cis-1,3-Dichloropropene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Cyclohexane	**20 / 20**	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Dibromochloromethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Dichlorodifluoromethane	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Ethylbenzene	**70 / 70**	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Freon-113	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Isopropylbenzene	**21.88 / 21.88**	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
m,p-Xylene	**1,000 / 1,000**	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014
Methyl acetate	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Methyl tert-butyl ether	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Methylcyclohexane	NR	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Methylene chloride	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
o-Xylene	**1,000 / 1,000**	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Styrene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Tetrachloroethene	**0.5 / 0.5**	**0.0084**	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Toluene	**100 / 100**	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
trans-1,2-Dichloroethene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
trans-1,3-Dichloropropene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Trichloroethene	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Trichlorofluoromethane	NC	<0.0061	<0.0069	<0.0074	<0.0081	<0.0070	<0.0071
Vinyl chloride	NC	<0.012	<0.014	<0.015	<0.016	<0.014	<0.014

NOTES:

Bolded numbers denote concetrations above laboratory detection limits

Bolded and bracketed numbers denote concentrations above Type 3 RRS

NC - Type 1/3 RRS were not calculated for analyte (Analyte was not detected above laboratory detection limits)

NR - Not Regulated, Compound not regulated by HSRA

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 2

August 2009 and September 2011 Soil Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS (<2 FT / >2 FT-BGS)	TNB-0911-SB9 (0 - 2')	TNB-0809-SB9 (15 - 20')	TNB-0911-SB10 (0 - 2')	TNB-0809-SB10 (15 - 20')	TNB-0911-SB11 (0 - 2')	TNB-0809-SB11 (15 - 20')
SAMPLE DATE		9/1/2011	9/1/2011	9/1/2011	9/1/2011	9/1/2011	9/1/2011
ANALYTES	MG/KG	LABORATORY RESULTS (MG/KG)					
TCL Volatile Organics							
1,1,1-Trichloroethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,1,2,2-Tetrachloroethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,1,2-Trichloroethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0074	<0.0089
1,1-Dichloroethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,1-Dichloroethene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2,4-Trichlorobenzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2-Dibromo-3-chloropropane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2-Dibromoethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2-Dichlorobenzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2-Dichloroethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,2-Dichloropropane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,3-Dichlorobenzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
1,4-Dichlorobenzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
2-Butanone	NC	<0.063	<0.084	<0.064	<0.080	<0.073	<0.089
2-Hexanone	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
4-Methyl-2-pentanone	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Acetone	NC	<0.13	<0.17	<0.13	<0.16	<0.15	<0.18
Benzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Bromodichloromethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Bromoform	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Bromomethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Carbon disulfide	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Carbon tetrachloride	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Chlorobenzene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Chloroethane	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Chloroform	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Chloromethane	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
cis-1,2-Dichloroethene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
cis-1,3-Dichloropropene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Cyclohexane	**20 / 20**	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Dibromochloromethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Dichlorodifluoromethane	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Ethylbenzene	**70 / 70**	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Freon-113	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Isopropylbenzene	**21.88 / 21.88**	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
m,p-Xylene	**1,000 / 1,000**	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018
Methyl acetate	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Methyl tert-butyl ether	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Methylcyclohexane	NR	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Methylene chloride	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
o-Xylene	**1,000 / 1,000**	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Styrene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Tetrachloroethene	**0.5 / 0.5**	**0.13**	<0.0084	<0.0064	**0.20**	<0.0073	<0.0089
Toluene	**100 / 100**	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
trans-1,2-Dichloroethene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
trans-1,3-Dichloropropene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Trichloroethene	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Trichlorofluoromethane	NC	<0.0063	<0.0084	<0.0064	<0.0080	<0.0073	<0.0089
Vinyl chloride	NC	<0.013	<0.017	<0.013	<0.016	<0.015	<0.018

NOTES:

Bolded numbers denote concetrations above laboratory detection limits

Bolded and bracketed numbers denote concentrations above Type 3 RRS

NC - Type 1/3 RRS were not calculated for analyte (Analyte was not detected above laboratory detection limits)

NR - Not Regulated, Compound not regulated by HSRA

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 3

November 2013 Soil Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS (<2 FT / >2 FT-BGS)	TNB-1113-B-1-10'	TNB-1113-B-2-5'	TNB-1113-B-2-9'	TNB-1113-B-2-12'	TNB-1113-B-3-7'	TNB-1113-B-4-7'	TNB-1113-B-5-7'	TNB-1113-B-6-7'	TNB-1113-B-7-7'	TNB-1113-B-8-7'
SAMPLE DATE		11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013	11/21/2013
ANALYTES	MG/KG	LABORATORY RESULTS (MG/KG)									
TCL Volatile Organics											
1,1,1-Trichloroethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,1,2,2-Tetrachloroethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,1,2-Trichloroethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,1-Dichloroethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,1-Dichloroethene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2,4-Trichlorobenzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2-Dibromo-3-chloropropane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2-Dibromoethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2-Dichlorobenzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2-Dichloroethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,2-Dichloropropane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,3-Dichlorobenzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
1,4-Dichlorobenzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
2-Butanone	NC	<0.042	<0.073	<0.073	<0.035	<0.045	<0.039	<0.043	<0.044	<0.041	<0.035
2-Hexanone	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
4-Methyl-2-pentanone	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Acetone	NC	<0.085	<0.15	<0.15	<0.070	<0.089	<0.078	<0.085	<0.089	<0.081	<0.070
Benzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Bromodichloromethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Bromoform	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Bromomethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Carbon disulfide	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Carbon tetrachloride	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Chlorobenzene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Chloroethane	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Chloroform	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Chloromethane	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
cis-1,2-Dichloroethene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
cis-1,3-Dichloropropene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Cyclohexane	**20 / 20**	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Dibromochloromethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Dichlorodifluoromethane	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Ethylbenzene	**70 / 70**	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Freon-113	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Isopropylbenzene	**21.88 / 21.88**	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
m,p-Xylene	**1,000 / 1,000**	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070
Methyl acetate	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Methyl tert-butyl ether	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Methylcyclohexane	NR	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Methylene chloride	NC	<0.017	<0.029	<0.029	<0.014	<0.018	<0.016	<0.017	<0.018	<0.016	<0.014
o-Xylene	**1,000 / 1,000**	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Styrene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Tetrachloroethene	**0.5 / 0.5**	<0.0042	<0.0073	<0.0073	**0.43**	**0.017**	<0.0039	<0.0043	<0.0044	<0.0041	**0.048**
Toluene	**100 / 100**	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
trans-1,2-Dichloroethene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
trans-1,3-Dichloropropene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Trichloroethene	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Trichlorofluoromethane	NC	<0.0042	<0.0073	<0.0073	<0.0035	<0.0045	<0.0039	<0.0043	<0.0044	<0.0041	<0.0035
Vinyl chloride	NC	<0.0085	<0.015	<0.015	<0.0070	<0.0089	<0.0078	<0.0085	<0.0089	<0.0081	<0.0070

NOTES:

Bolded numbers denote concetrations above laboratory detection limits

Bolded and bracketed numbers denote concentrations above Type 3 RRS

NC - Type 1/3 RRS were not calculated for analyte (Analyte was not detected above laboratory detection limits)

NR - Not Regulated, Compound not regulated by HSRA

Thomasville National Bank
301 North Broad Street, Thomasville, Thomas County, Georgia
HSI# 10902

TABLE 4
Groundwater Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS	MW-1						MW-2						MW-3						MW-4					
SAMPLE DATE		8/20/2009	9/1/2011	6/28/2012	6/6/2013	11/20/2013	6/24/2014	8/20/2009	9/1/2011	6/28/2012	6/6/2013	11/20/2013	6/25/2014	8/20/2009	9/1/2011	6/27/2012	6/7/2013	11/21/2013	6/25/2014	8/21/2009	9/1/2011	6/27/2012	6/6/2013	11/21/2013	6/25/2014
ANALYTES	ug/L	LABORATORY RESULTS (ug/L)																							
TCL Volatile Organics																									
1,1,1-Trichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1,2,2-Tetrachloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1,2-Trichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1-Dichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1-Dichloroethene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2,4-Trichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dibromo-3-chloropropane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dibromoethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichloropropane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,3-Dichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,4-Dichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
2-Butanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<50	<10.0	<10.0	<10.0	<10.0	<10.0	<1000	<10.0	<10.0	<10.0	<10.0	<10.0	<50	<10.0	<10.0	<10.0	<10.0	<10.0	<50
2-Hexanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
4-Methyl-2-pentanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Acetone	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<50	<5.0	<5.0	<5.0	<5.0	<5.0	<1000	<5.0	<5.0	<5.0	<5.0	<5.0	<50	<5.0	<5.0	<5.0	<5.0	<5.0	<50
Benzene	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**15**	**12**	**8.8**	**6.6**	**11**	<100	<5.0	**13**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromodichloromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromoform	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromomethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Carbon disulfide	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Carbon tetrachloride	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chloroethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Chloroform	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chloromethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
cis-1,2-Dichloroethene	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**12**	**10**	**17**	**9.9**	**16**	<100	**15**	**140**	**26**	<5.0	**18**	**33**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
cis-1,3-Dichloropropene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Cyclohexane	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**130**	**190**	**47**	**67**	**89**	<100	<5.0	**13**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Dibromochloromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Dichlorodifluoromethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Ethylbenzene	1,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**500**	**740**	**280**	**490**	**1,100**	**2,100**	<5.0	**62**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Freon-113	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<200	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Isopropylbenzene	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**41**	**77**	**36**	**65**	**60**	<100	<5.0	**20**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
m,p-Xylene	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<5.0	**1,700**	**2,800**	**1,000**	**1,800**	**4,100**	**8,000**	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Methyl acetate	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methyl tert-butyl ether	NR	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**90**	**23**	**12**	**25**	**22**	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methylcyclohexane	NR	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**190**	**190**	**52**	**100**	**150**	**100**	<5.0	**16**	**7.2**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methylene chloride	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
o-Xylene	10,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**730**	**1,100**	**440**	**680**	**1,900**	**3,700**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Styrene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Tetrachloroethene	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**19**	**18**	**5.1**	**14**	**13**	<100	**60**	**10**	**7.6**	**76**	**310**	**80**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Toluene	1,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**1,600**	**1,400**	**620**	**1,000**	**2,600**	2,400	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
trans-1,2-Dichloroethene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
trans-1,3-Dichloropropene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Trichloroethene	5	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**12**	**10**	<5.0	**5.2**	**10**	<100	**15**	**5**	<5.0	<5.0	**13**	**5.3**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Trichlorofluoromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Vinyl chloride	ND	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<40	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0

NOTES:
Bolded numbers denote concetrations above laboratory detection limits.
Bolded and bracketed numbers denote concentrations above Type 3 RRS.
DUP Sample collected from MW-5 in November 2013.

Thomasville National Bank
301 North Broad Street, Thomasville, Thomas County, Georgia
HSI# 10902

TABLE 4
Groundwater Analytical Testing Data Summary Table

SAMPLE DESIGNATION	TYPE 1/3 RRS	MW-5						MW-6				MW-7				MW-8				MW-9		MW-10		MW-11		MW-12		MW-13	
SAMPLE DATE		8/20/2009	9/1/2011	6/28/2012	6/7/2013	11/21/2013	6/25/2014	6/27/2012	6/7/2013	11/21/2013	6/25/2014	6/29/2012	6/7/2013	11/21/2013	6/25/2014	6/29/2012	6/6/2013	11/21/2013	6/25/2014	11/20/2013	6/25/2014	11/20/2013	6/25/2013	11/20/2013	6/25/2014	11/22/2013	6/25/2014	11/22/2013	6/25/2014
ANALYTES	ug/L	LABORATORY RESULTS (ug/L)																											
TCL Volatile Organics																													
1,1,1-Trichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1,2,2-Tetrachloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1,2-Trichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1-Dichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,1-Dichloroethene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2,4-Trichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dibromo-3-chloropropane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dibromoethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichlorobenzene	ND	<5.0	23.17	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichloroethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,2-Dichloropropane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,3-Dichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
1,4-Dichlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
2-Butanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<50	<10.0	<10.0	<10.0	<50	<10.0	<10.0	<10.0	<50	<10.0	<10.0	<10.0	<50	<10.0	<50	<10.0	<50	<10.0	<50	<10.0	<50	<10.0	<50
2-Hexanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
4-Methyl-2-pentanone	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Acetone	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<50	<5.0	<5.0	<5.0	<50	<5.0	<5.0	<5.0	<50	<5.0	<5.0	<5.0	<50	<5.0	<50	<5.0	<50	<5.0	<50	<5.0	<50	<5.0	<50
Benzene	5	**22**	**14**	**20**	**7.9**	**9.3**	**13**	**33**	**15**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromodichloromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromoform	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Bromomethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Carbon disulfide	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Carbon tetrachloride	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chlorobenzene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chloroethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Chloroform	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Chloromethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
cis-1,2-Dichloroethene	5	**23**	**9.5**	**30**	**16**	**11**	**9.0**	**44**	**56**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
cis-1,3-Dichloropropene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Cyclohexane	5	**73**	<5.0	<5.0	<5.0	**5.2**	**5.8**	<5.0	**6.9**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Dibromochloromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Dichlorodifluoromethane	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Ethylbenzene	1,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Freon-113	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Isopropylbenzene	5	**9.6**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
m,p-Xylene	ND	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0	<10.0
Methyl acetate	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methyl tert-butyl ether	NR	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methylcyclohexane	NR	**110**	**9.1**	<5.0	<5.0	**5.4**	**5.2**	**6.3**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Methylene chloride	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
o-Xylene	10,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Styrene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Tetrachloroethene	5	**480**	**170**	**34**	**990**	**5,200**	**1,100**	**340**	**660**	**180**	**450**	**150**	**280**	**180**	**99**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**74**	<5.0	**40**	**22**	<5.0	<5.0
Toluene	1,000	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
trans-1,2-Dichloroethene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
trans-1,3-Dichloropropene	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Trichloroethene	5	**30**	**6.8**	**11**	**53**	**36**	**25**	**67**	**100**	**21**	**89**	**22**	**47**	**21**	**6.8**	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	**7.4**	<5.0	<5.0	<5.0	<5.0	<5.0
Trichlorofluoromethane	ND	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
Vinyl chloride	ND	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0

NOTES:
Bolded numbers denote concetrations above laboratory detection limits.
Bolded and bracketed numbers denote concentrations above Type 3 RRS.
DUP Sample collected from MW-6 in June 2013.

Thomasville National Bank

301 North Broad Street, Thomasville, Thomas County, Georgia

HSI# 10902

TABLE 5

Summary of Field Readings and Monitored Natural Attenuation Parameter Analytical Testing Results

Well Number / Sample ID	Date	pH	Temperature (°C)	Dissolved Oxygen (g/L)	Oxidation-Reduction Potential (mV)	Conductivity (ms/cm)	Ethane	Ethene	Methane	Total Organic Carbon	Iron II	Chloride	Nitrate	Sulfate	Sulfide
		FIELD-MEASURED PARAMETERS					LABORATORY ANALYTICAL RESULTS (mg/L)								
Optimal MNA Range		5 to 9	>20	<0.5	<50	NA	>0.1	>0.1	>0.5	>20	>1	<1	<1	<20	>1
MW-1	11/20/2013	4.70	23.00	2.77	235	0.066	<0.009	<0.007	5	<1.00	0	15	0.56	2.9	NA
	6/25/2014	3.98	22.97	3.8	23.9	0.161	-	-	-	-	-	-	-	-	-
MW-2	9/1/2011	6.16	27.02	0.18	-65	0.275	<0.009	<0.007	1,800	10.7	24.4	NA	<0.25	<1.0	NA
	6/28/2012	5.85	27.19	1.32	-67	0.303	<0.009	<0.007	290	<1.00	<0.100	21	<0.25	<1.0	<2.00
	6/6/2012	5.77	23.99	0.00	-67	0.161	NA	NA	NA	NA	NA	NA	NA	NA	NA
	11/20/2013	5.83	23.35	0.00	-54	0.138	NA	NA	NA	NA	NA	NA	NA	NA	NA
	6/25/2014	5.86	25.13	0.4	-19.6	0.536	NA	NA	NA	NA	NA	NA	NA	NA	NA
MW-3	9/1/2011	5.95	28.49	2.49	35	0.250	<0.009	<0.007	130	<5.0	4.20	NA	<0.25	<1.0	NA
	6/27/2012	5.58	27.92	0.91	177	0.285	<0.009	<0.007	190	1.53	<0.100	17	<0.25	22	<2.00
	6/7/2013	5.32	22.90	0.59	270	0.172	NA	NA	NA	NA	NA	NA	NA	NA	NA
	11/21/2013	4.89	23.96	0.00	197	0.124	NA	NA	NA	NA	NA	NA	NA	NA	NA
	6/25/2014	4.93	24.29	1.00	65.4	0.379	-	-	-	-	-	-	-	-	-
MW-4	6/25/2014	5.78	23.77	2.35	114	0.598	-	-	-	-	-	-	-	-	-
MW-5	9/1/2011	5.00	26.40	0.00	182	0.105	<0.009	<0.007	130	1.64	4.11	NA	<0.25	18	NA
	6/28/2012	4.56	26.62	2.56	450	0.131	<0.009	<0.007	16	1.60	0.686	13	0.83	22	<2.00
	6/7/2013	4.79	23.56	0.00	208	0.181	NA	NA	NA	NA	NA	NA	NA	NA	NA
	11/21/2003	4.88	24.30	0.00	138	0.137	<0.009	<0.007	41	<1.00	4.0	19	2.6	33	NA
	6/25/2014	4.40	23.88	1.01	48.7	0.182	-	-	-	-	-	-	-	-	-
MW-6	6/27/2012	5.73	30.53	5.03	135	0.260	<0.009	<0.007	<0.004	2.06	1.77	15	<0.25	55	<2.00
	6/7/2013	5.78	23.93	2.25	46	0.252	NA	NA	NA	NA	NA	NA	NA	NA	NA
	11/21/2013	5.50	23.82	2.01	39	0.195	NA	NA	NA	NA	NA	NA	NA	NA	NA
	6/25/2014	4.52	23.62	1.08	116.7	0.187	-	-	-	-	-	-	-	-	-
MW-7	11/21/2013	4.81	24.30	1.60	263	0.061	<0.009	<0.007	<0.004	<1.00	0.00	14	0.64	1.3	NA
	6/25/2014	4.01	23.84	1.44	156.6	0.092	-	-	-	-	-	-	-	-	-
MW-8	6/25/2014	5.59	22.97	1.73	100.2	0.553	-	-	-	-	-	-	-	-	-
MW-9	6/25/2014	3.72	22.06	0.71	179	0.112	-	-	-	-	-	-	-	-	-
MW-10	6/25/2014	5.11	24.62	0.63	101	0.420	-	-	-	-	-	-	-	-	-
MW-11	6/25/2014	4.48	22.77	1.05	165.5	0.099	-	-	-	-	-	-	-	-	-
MW-12	11/21/2013	5.03	24.01	1.57	221	0.156	<0.009	<0.007	30	<1.00	0.00	12.00	0.84	42	NA
	6/25/2014	4.86	24.08	0.71	122.4	0.277	-	-	-	-	-	-	-	-	-
MW-13	9/1/2011	5.00	26.40	0.00	182	0.105	-	-	-	-	-	-	-	-	-
	6/24/2014	3.86	21.36	3.52	74.8	0.071	-	-	-	-	-	-	-	-	-
AVERAGES		5.07	24.60	1.33	117.93	0.220	<0.009	<0.007	292.44	3.508	6.528	18.00	1.094	24.163	<2.00

NOTES:

NA - Not Applicable and/or Not Analyzed.

3) Source area includes MW-5

4) Downgradient of source area average includes MW-3, MW-6, MW-7 and MW-12

5) Iron II was measured using field test kits in November 2013

APPENDIX A

NOVEMBER 2013 - SOIL LABORATORY ANALYTICAL REPORT

AES

ANALYTICAL ENVIRONMENTAL SERVICES, INC.

December 03, 2013

John Martiniere
Peachtree Environmental
3000 Northwoods Parkway, Suite 105
Norcross GA 30071

TEL: (770) 449-6100
FAX: (770) 449-6119

RE: Thomasville National Bank

Dear John Martiniere: Order No: 1311I96

Analytical Environmental Services, Inc. received □□ samples on 11/22/2013 3:40:00 PM for the analyses presented in following report.

No problems were encountered during the analyses. Additionally, all results for the associated Quality Control samples were within EPA and/or AES established limits. Any discrepancies associated with the analyses contained herein will be noted and submitted in the form of a project Case Narrative.
AES' certifications are as follows:
-NELAC/Florida Certification number E87582 for analysis of Environmental Water, soil/hazardous waste, and Drinking Water Microbiology, effective 07/01/13-06/30/14.
-AIHA-LAP, LLC Laboratory ID: 100671 for Industrial Hygiene samples (Organics, Inorganics), Environmental Lead (Paint, Soil, Dust Wipes, Air), and Environmental Microbiology (Fungal) effective until 09/01/15.

These results relate only to the items tested. This report may only be reproduced in full.

If you have any questions regarding these test results, please feel free to call.

Dorothy deBruyn
Project Manager

ANALYTICAL ENVIRONMENTAL SERVICES, INC
3785 Presidential Parkway, Atlanta GA 30340-3704
AES TEL.: (770) 457-8177 / TOLL-FREE (800) 972-4889 / FAX: (770) 457-8188

CHAIN OF CUSTODY

Work Order: 1311396

Date: 11/21/13 Page 1 of 1

COMPANY: PEACHTREE ENVIRONMENTAL

ADDRESS: 3000 NORTHWOODS PKWY. Suite 105 NORCROSS, GA 30071

PHONE: 770-449-6100

FAX: 770-449-6119

SAMPLED BY: Jason Chappell / Thom Chalkley

SIGNATURE: [signature]

ANALYSIS REQUESTED: 8260

PRESERVATION (See codes): S/M+I

Visit our website www.aesatlanta.com to check on the status of your results, place bottle orders, etc.

#	SAMPLE ID	SAMPLED DATE	SAMPLED TIME	Grab	Composite	Matrix (See codes)	8260 S/M+I	REMARKS	No # of Containers
1	TNB-1113-B-1-10'	11/21/13	800	✓		SO	✓		4
2	TNB-1113-B-2-12'		820	✓		SO	✓		4
3	TNB-1113-B-3-7'		835	✓		SO	✓		4
4	TNB-1113-B-4-7'		850	✓		SO	✓		4
5	TNB-1113-B-5-7'		910	✓		SO	✓		4
6	TNB-1113-B-6-7'		925	✓		SO	✓		4
7	TNB-1113-B-7-7'		945	✓		SO	✓		4
8	TNB-1113-B-8-7'		1000	✓		SO	✓		4
9	TNB-1113-B-2-5'		810	✓		SO	✓		4
10	TNB-1113-B-2-9'		815	✓		SO	✓		4
11									
12									
13									
14									

RELINQUISHED BY	DATE/TIME	RECEIVED BY	DATE/TIME
1: [signature]	1540 11-22-13	1: [signature]	11/22/13 3:40
2:		2:	
3:		3:	

SPECIAL INSTRUCTIONS/COMMENTS:

SHIPMENT METHOD
OUT / / VIA:
IN / / VIA:
CLIENT FedEx UPS MAIL COURIER
GREYHOUND OTHER _____

PROJECT INFORMATION
PROJECT NAME: Thomasville National Bank
PROJECT #: 3151
SITE ADDRESS: Thomasville, Georgia
SEND REPORT TO: Jason Chappell
INVOICE TO: (IF DIFFERENT FROM ABOVE)
QUOTE #: _____ PO#: _____

RECEIPT
Total # of Containers

Turnaround Time Request
- (✓) Standard 5 Business Days
- ( ) 2 Business Day Rush
- ( ) Next Business Day Rush
- ( ) Same Day Rush (auth req.)
- ( ) Other _____

STATE PROGRAM (if any): _____
E-mail? Y / N; Fax? Y / N
DATA PACKAGE: I II III IV

SAMPLES RECEIVED AFTER 3PM OR ON SATURDAY ARE CONSIDERED RECEIVED THE NEXT BUSINESS DAY. IF TURNAROUND TIME IS NOT INDICATED, AES WILL PROCEED WITH STANDARD TAT OF SAMPLES. SAMPLES ARE DISPOSED 30 DAYS AFTER REPORT COMPLETION UNLESS OTHER ARRANGEMENTS ARE MADE.

MATRIX CODES: A = Air GW = Groundwater SE = Sediment SO = Soil SW = Surface Water W = Water (Blanks) DW = Drinking Water (Blanks) O = Other (specify) WW = Waste Water
PRESERVATIVE CODES: H+I = Hydrochloric acid + ice I = Ice only N = Nitric acid S+I = Sulfuric acid + ice S/M+I = Sodium Bisulfate/Methanol + ice O = Other (specify) NA = None

White Copy - Original; Yellow Copy - Client

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-1-10'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:00:00 AM
Lab ID:	1311I96-001	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,1,2,2-Tetrachloroethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,1,2-Trichloroethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,1-Dichloroethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,1-Dichloroethene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2,4-Trichlorobenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2-Dibromo-3-chloropropane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2-Dibromoethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2-Dichlorobenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2-Dichloroethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,2-Dichloropropane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,3-Dichlorobenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
1,4-Dichlorobenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
2-Butanone	BRL	0.042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
2-Hexanone	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
4-Methyl-2-pentanone	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Acetone	BRL	0.085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Benzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Bromodichloromethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Bromoform	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Bromomethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Carbon disulfide	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Carbon tetrachloride	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Chlorobenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Chloroethane	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Chloroform	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Chloromethane	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
cis-1,2-Dichloroethene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
cis-1,3-Dichloropropene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Cyclohexane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Dibromochloromethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Dichlorodifluoromethane	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Ethylbenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Freon-113	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Isopropylbenzene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
m,p-Xylene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Methyl acetate	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Methyl tert-butyl ether	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Methylcyclohexane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Methylene chloride	BRL	0.017		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
o-Xylene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-1-10'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:00:00 AM
Lab ID:	1311I96-001	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Tetrachloroethene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Toluene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
trans-1,2-Dichloroethene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
trans-1,3-Dichloropropene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Trichloroethene	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Trichlorofluoromethane	BRL	0.0042		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Vinyl chloride	BRL	0.0085		mg/Kg-dry	184105	1	11/26/2013 17:52	MD
Surr: 4-Bromofluorobenzene	88.8	70-128		%REC	184105	1	11/26/2013 17:52	MD
Surr: Dibromofluoromethane	125	78.2-128		%REC	184105	1	11/26/2013 17:52	MD
Surr: Toluene-d8	93.1	76.5-116		%REC	184105	1	11/26/2013 17:52	MD
PERCENT MOISTURE D2216								
Percent Moisture	21.2	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-12'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:20:00 AM
Lab ID:	1311I96-002	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,1,2,2-Tetrachloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,1,2-Trichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,1-Dichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,1-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2,4-Trichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2-Dibromo-3-chloropropane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2-Dibromoethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2-Dichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,2-Dichloropropane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,3-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
1,4-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
2-Butanone	BRL	0.035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
2-Hexanone	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
4-Methyl-2-pentanone	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Acetone	BRL	0.070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Benzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Bromodichloromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Bromoform	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Bromomethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Carbon disulfide	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Carbon tetrachloride	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Chlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Chloroethane	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Chloroform	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Chloromethane	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
cis-1,2-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
cis-1,3-Dichloropropene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Cyclohexane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Dibromochloromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Dichlorodifluoromethane	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Ethylbenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Freon-113	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Isopropylbenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
m,p-Xylene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Methyl acetate	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Methyl tert-butyl ether	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Methylcyclohexane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Methylene chloride	BRL	0.014		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
o-Xylene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-12'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:20:00 AM
Lab ID:	1311I96-002	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Tetrachloroethene	0.43	0.22		mg/Kg-dry	184153	50	11/27/2013 11:07	GK
Toluene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
trans-1,2-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
trans-1,3-Dichloropropene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Trichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Trichlorofluoromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Vinyl chloride	BRL	0.0070		mg/Kg-dry	184105	1	11/27/2013 17:42	MD
Surr: 4-Bromofluorobenzene	98.3	70-128		%REC	184105	1	11/27/2013 17:42	MD
Surr: 4-Bromofluorobenzene	99.1	70-128		%REC	184153	50	11/27/2013 11:07	GK
Surr: Dibromofluoromethane	120	78.2-128		%REC	184105	1	11/27/2013 17:42	MD
Surr: Dibromofluoromethane	98	78.2-128		%REC	184153	50	11/27/2013 11:07	GK
Surr: Toluene-d8	91.9	76.5-116		%REC	184105	1	11/27/2013 17:42	MD
Surr: Toluene-d8	100	76.5-116		%REC	184153	50	11/27/2013 11:07	GK
PERCENT MOISTURE D2216								
Percent Moisture	21.5	0		wt%	R256665	1	11/26/2013 19:00	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-3-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:35:00 AM
Lab ID:	1311I96-003	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,1,2,2-Tetrachloroethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,1,2-Trichloroethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,1-Dichloroethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,1-Dichloroethene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2,4-Trichlorobenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2-Dibromo-3-chloropropane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2-Dibromoethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2-Dichlorobenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2-Dichloroethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,2-Dichloropropane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,3-Dichlorobenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
1,4-Dichlorobenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
2-Butanone	BRL	0.045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
2-Hexanone	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
4-Methyl-2-pentanone	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Acetone	BRL	0.089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Benzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Bromodichloromethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Bromoform	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Bromomethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Carbon disulfide	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Carbon tetrachloride	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Chlorobenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Chloroethane	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Chloroform	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Chloromethane	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
cis-1,2-Dichloroethene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
cis-1,3-Dichloropropene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Cyclohexane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Dibromochloromethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Dichlorodifluoromethane	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Ethylbenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Freon-113	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Isopropylbenzene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
m,p-Xylene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Methyl acetate	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Methyl tert-butyl ether	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Methylcyclohexane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Methylene chloride	BRL	0.018		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
o-Xylene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-3-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:35:00 AM
Lab ID:	1311I96-003	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Tetrachloroethene	0.017	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Toluene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
trans-1,2-Dichloroethene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
trans-1,3-Dichloropropene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Trichloroethene	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Trichlorofluoromethane	BRL	0.0045		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Vinyl chloride	BRL	0.0089		mg/Kg-dry	184105	1	11/26/2013 18:53	MD
Surr: 4-Bromofluorobenzene	84.9	70-128		%REC	184105	1	11/26/2013 18:53	MD
Surr: Dibromofluoromethane	126	78.2-128		%REC	184105	1	11/26/2013 18:53	MD
Surr: Toluene-d8	91.8	76.5-116		%REC	184105	1	11/26/2013 18:53	MD
PERCENT MOISTURE D2216								
Percent Moisture	31.7	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-4-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:50:00 AM
Lab ID:	1311I96-004	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,1,2,2-Tetrachloroethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,1,2-Trichloroethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,1-Dichloroethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,1-Dichloroethene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2,4-Trichlorobenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2-Dibromo-3-chloropropane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2-Dibromoethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2-Dichlorobenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2-Dichloroethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,2-Dichloropropane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,3-Dichlorobenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
1,4-Dichlorobenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
2-Butanone	BRL	0.039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
2-Hexanone	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
4-Methyl-2-pentanone	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Acetone	BRL	0.078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Benzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Bromodichloromethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Bromoform	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Bromomethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Carbon disulfide	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Carbon tetrachloride	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Chlorobenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Chloroethane	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Chloroform	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Chloromethane	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
cis-1,2-Dichloroethene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
cis-1,3-Dichloropropene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Cyclohexane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Dibromochloromethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Dichlorodifluoromethane	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Ethylbenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Freon-113	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Isopropylbenzene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
m,p-Xylene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Methyl acetate	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Methyl tert-butyl ether	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Methylcyclohexane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Methylene chloride	BRL	0.016		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
o-Xylene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-4-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:50:00 AM
Lab ID:	1311I96-004	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Tetrachloroethene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Toluene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
trans-1,2-Dichloroethene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
trans-1,3-Dichloropropene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Trichloroethene	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Trichlorofluoromethane	BRL	0.0039		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Vinyl chloride	BRL	0.0078		mg/Kg-dry	184105	1	11/27/2013 17:12	MD
Surr: 4-Bromofluorobenzene	89.8	70-128		%REC	184105	1	11/27/2013 17:12	MD
Surr: Dibromofluoromethane	114	78.2-128		%REC	184105	1	11/27/2013 17:12	MD
Surr: Toluene-d8	87.7	76.5-116		%REC	184105	1	11/27/2013 17:12	MD
PERCENT MOISTURE D2216								
Percent Moisture	19.5	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-5-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:10:00 AM
Lab ID:	1311I96-005	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,1,2,2-Tetrachloroethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,1,2-Trichloroethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,1-Dichloroethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,1-Dichloroethene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2,4-Trichlorobenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2-Dibromo-3-chloropropane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2-Dibromoethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2-Dichlorobenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2-Dichloroethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,2-Dichloropropane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,3-Dichlorobenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
1,4-Dichlorobenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
2-Butanone	BRL	0.043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
2-Hexanone	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
4-Methyl-2-pentanone	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Acetone	BRL	0.085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Benzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Bromodichloromethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Bromoform	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Bromomethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Carbon disulfide	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Carbon tetrachloride	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Chlorobenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Chloroethane	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Chloroform	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Chloromethane	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
cis-1,2-Dichloroethene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
cis-1,3-Dichloropropene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Cyclohexane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Dibromochloromethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Dichlorodifluoromethane	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Ethylbenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Freon-113	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Isopropylbenzene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
m,p-Xylene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Methyl acetate	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Methyl tert-butyl ether	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Methylcyclohexane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Methylene chloride	BRL	0.017		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
o-Xylene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-5-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:10:00 AM
Lab ID:	1311I96-005	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Tetrachloroethene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Toluene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
trans-1,2-Dichloroethene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
trans-1,3-Dichloropropene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Trichloroethene	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Trichlorofluoromethane	BRL	0.0043		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Vinyl chloride	BRL	0.0085		mg/Kg-dry	184105	1	11/27/2013 16:37	MD
Surr: 4-Bromofluorobenzene	92.9	70-128		%REC	184105	1	11/27/2013 16:37	MD
Surr: Dibromofluoromethane	116	78.2-128		%REC	184105	1	11/27/2013 16:37	MD
Surr: Toluene-d8	89.1	76.5-116		%REC	184105	1	11/27/2013 16:37	MD
PERCENT MOISTURE D2216								
Percent Moisture	23.6	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-6-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:25:00 AM
Lab ID:	1311I96-006	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,1,2,2-Tetrachloroethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,1,2-Trichloroethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,1-Dichloroethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,1-Dichloroethene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2,4-Trichlorobenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2-Dibromo-3-chloropropane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2-Dibromoethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2-Dichlorobenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2-Dichloroethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,2-Dichloropropane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,3-Dichlorobenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
1,4-Dichlorobenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
2-Butanone	BRL	0.044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
2-Hexanone	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
4-Methyl-2-pentanone	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Acetone	BRL	0.089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Benzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Bromodichloromethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Bromoform	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Bromomethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Carbon disulfide	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Carbon tetrachloride	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Chlorobenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Chloroethane	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Chloroform	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Chloromethane	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
cis-1,2-Dichloroethene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
cis-1,3-Dichloropropene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Cyclohexane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Dibromochloromethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Dichlorodifluoromethane	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Ethylbenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Freon-113	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Isopropylbenzene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
m,p-Xylene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Methyl acetate	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Methyl tert-butyl ether	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Methylcyclohexane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Methylene chloride	BRL	0.018		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
o-Xylene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-6-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:25:00 AM
Lab ID:	1311I96-006	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Tetrachloroethene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Toluene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
trans-1,2-Dichloroethene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
trans-1,3-Dichloropropene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Trichloroethene	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Trichlorofluoromethane	BRL	0.0044		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Vinyl chloride	BRL	0.0089		mg/Kg-dry	184105	1	11/27/2013 16:05	MD
Surr: 4-Bromofluorobenzene	94.9	70-128		%REC	184105	1	11/27/2013 16:05	MD
Surr: Dibromofluoromethane	114	78.2-128		%REC	184105	1	11/27/2013 16:05	MD
Surr: Toluene-d8	87.2	76.5-116		%REC	184105	1	11/27/2013 16:05	MD
PERCENT MOISTURE D2216								
Percent Moisture	18.6	0		wt%	R256665	1	11/26/2013 19:00	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-7-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:45:00 AM
Lab ID:	1311I96-007	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,1,2,2-Tetrachloroethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,1,2-Trichloroethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,1-Dichloroethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,1-Dichloroethene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2,4-Trichlorobenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2-Dibromo-3-chloropropane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2-Dibromoethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2-Dichlorobenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2-Dichloroethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,2-Dichloropropane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,3-Dichlorobenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
1,4-Dichlorobenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
2-Butanone	BRL	0.041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
2-Hexanone	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
4-Methyl-2-pentanone	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Acetone	BRL	0.081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Benzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Bromodichloromethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Bromoform	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Bromomethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Carbon disulfide	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Carbon tetrachloride	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Chlorobenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Chloroethane	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Chloroform	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Chloromethane	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
cis-1,2-Dichloroethene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
cis-1,3-Dichloropropene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Cyclohexane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Dibromochloromethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Dichlorodifluoromethane	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Ethylbenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Freon-113	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Isopropylbenzene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
m,p-Xylene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Methyl acetate	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Methyl tert-butyl ether	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Methylcyclohexane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Methylene chloride	BRL	0.016		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
o-Xylene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-7-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 9:45:00 AM
Lab ID:	1311I96-007	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Tetrachloroethene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Toluene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
trans-1,2-Dichloroethene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
trans-1,3-Dichloropropene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Trichloroethene	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Trichlorofluoromethane	BRL	0.0041		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Vinyl chloride	BRL	0.0081		mg/Kg-dry	184105	1	11/27/2013 13:38	MD
Surr: 4-Bromofluorobenzene	83.7	70-128		%REC	184105	1	11/27/2013 13:38	MD
Surr: Dibromofluoromethane	121	78.2-128		%REC	184105	1	11/27/2013 13:38	MD
Surr: Toluene-d8	93.5	76.5-116		%REC	184105	1	11/27/2013 13:38	MD
PERCENT MOISTURE D2216								
Percent Moisture	18.9	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-8-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 10:00:00 AM
Lab ID:	1311I96-008	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,1,2,2-Tetrachloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,1,2-Trichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,1-Dichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,1-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2,4-Trichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2-Dibromo-3-chloropropane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2-Dibromoethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2-Dichloroethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,2-Dichloropropane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,3-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
1,4-Dichlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
2-Butanone	BRL	0.035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
2-Hexanone	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
4-Methyl-2-pentanone	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Acetone	BRL	0.070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Benzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Bromodichloromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Bromoform	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Bromomethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Carbon disulfide	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Carbon tetrachloride	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Chlorobenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Chloroethane	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Chloroform	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Chloromethane	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
cis-1,2-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
cis-1,3-Dichloropropene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Cyclohexane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Dibromochloromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Dichlorodifluoromethane	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Ethylbenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Freon-113	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Isopropylbenzene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
m,p-Xylene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Methyl acetate	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Methyl tert-butyl ether	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Methylcyclohexane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Methylene chloride	BRL	0.014		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
o-Xylene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-8-7'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 10:00:00 AM
Lab ID:	1311I96-008	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Tetrachloroethene	0.048	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Toluene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
trans-1,2-Dichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
trans-1,3-Dichloropropene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Trichloroethene	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Trichlorofluoromethane	BRL	0.0035		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Vinyl chloride	BRL	0.0070		mg/Kg-dry	184105	1	11/26/2013 21:23	MD
Surr: 4-Bromofluorobenzene	80.8	70-128		%REC	184105	1	11/26/2013 21:23	MD
Surr: Dibromofluoromethane	133	78.2-128	S	%REC	184105	1	11/26/2013 21:23	MD
Surr: Toluene-d8	92.2	76.5-116		%REC	184105	1	11/26/2013 21:23	MD
PERCENT MOISTURE D2216								
Percent Moisture	12.3	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-5'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:10:00 AM
Lab ID:	1311I96-009	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,1,2,2-Tetrachloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,1,2-Trichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,1-Dichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,1-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2,4-Trichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2-Dibromo-3-chloropropane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2-Dibromoethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2-Dichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,2-Dichloropropane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,3-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
1,4-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
2-Butanone	BRL	0.073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
2-Hexanone	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
4-Methyl-2-pentanone	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Acetone	BRL	0.15		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Benzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Bromodichloromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Bromoform	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Bromomethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Carbon disulfide	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Carbon tetrachloride	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Chlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Chloroethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Chloroform	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Chloromethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
cis-1,2-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
cis-1,3-Dichloropropene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Cyclohexane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Dibromochloromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Dichlorodifluoromethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Ethylbenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Freon-113	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Isopropylbenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
m,p-Xylene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Methyl acetate	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Methyl tert-butyl ether	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Methylcyclohexane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Methylene chloride	BRL	0.029		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
o-Xylene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-5'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:10:00 AM
Lab ID:	1311I96-009	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Tetrachloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Toluene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
trans-1,2-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
trans-1,3-Dichloropropene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Trichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Trichlorofluoromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Vinyl chloride	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:07	MD
Surr: 4-Bromofluorobenzene	86.7	70-128		%REC	184105	1	11/27/2013 12:07	MD
Surr: Dibromofluoromethane	116	78.2-128		%REC	184105	1	11/27/2013 12:07	MD
Surr: Toluene-d8	90.8	76.5-116		%REC	184105	1	11/27/2013 12:07	MD
PERCENT MOISTURE D2216								
Percent Moisture	17.6	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-9'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:15:00 AM
Lab ID:	1311I96-010	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
1,1,1-Trichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,1,2,2-Tetrachloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,1,2-Trichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,1-Dichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,1-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2,4-Trichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2-Dibromo-3-chloropropane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2-Dibromoethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2-Dichloroethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,2-Dichloropropane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,3-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
1,4-Dichlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
2-Butanone	BRL	0.073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
2-Hexanone	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
4-Methyl-2-pentanone	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Acetone	BRL	0.15		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Benzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Bromodichloromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Bromoform	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Bromomethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Carbon disulfide	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Carbon tetrachloride	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Chlorobenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Chloroethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Chloroform	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Chloromethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
cis-1,2-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
cis-1,3-Dichloropropene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Cyclohexane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Dibromochloromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Dichlorodifluoromethane	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Ethylbenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Freon-113	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Isopropylbenzene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
m,p-Xylene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Methyl acetate	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Methyl tert-butyl ether	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Methylcyclohexane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Methylene chloride	BRL	0.029		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
o-Xylene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 3-Dec-13

Client:	Peachtree Environmental	**Client Sample ID:**	TNB-1113-B-2-9'
Project Name:	Thomasville National Bank	**Collection Date:**	11/21/2013 8:15:00 AM
Lab ID:	1311I96-010	**Matrix:**	Soil

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5035)**				
Styrene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Tetrachloroethene	0.0082	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Toluene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
trans-1,2-Dichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
trans-1,3-Dichloropropene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Trichloroethene	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Trichlorofluoromethane	BRL	0.0073		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Vinyl chloride	BRL	0.015		mg/Kg-dry	184105	1	11/27/2013 12:37	MD
Surr: 4-Bromofluorobenzene	86.8	70-128		%REC	184105	1	11/27/2013 12:37	MD
Surr: Dibromofluoromethane	126	78.2-128		%REC	184105	1	11/27/2013 12:37	MD
Surr: Toluene-d8	90.3	76.5-116		%REC	184105	1	11/27/2013 12:37	MD
PERCENT MOISTURE D2216								
Percent Moisture	19.3	0		wt%	R256735	1	11/27/2013 09:30	EH

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc.

Sample/Cooler Receipt Checklist

Client Peachtree Environmental Work Order Number 1311796

Checklist completed by [signature] 11.23.13
Signature Date

Carrier name: FedEx __ UPS __ Courier __ Client __ ✓ US Mail __ Other _____

Shipping container/cooler in good condition? Yes ✓ No __ Not Present __

Custody seals intact on shipping container/cooler? Yes __ No __ Not Present ✓

Custody seals intact on sample bottles? Yes __ No __ Not Present ✓

Container/Temp Blank temperature in compliance? (4°C±2)* Yes ✓ No __

Cooler #1 3.3 Cooler #2 _____ Cooler #3 _____ Cooler #4 _____ Cooler#5 _____ Cooler #6 _____

Chain of custody present? Yes ✓ No __

Chain of custody signed when relinquished and received? Yes ✓ No __

Chain of custody agrees with sample labels? Yes ✓ No __

Samples in proper container/bottle? Yes ✓ No __

Sample containers intact? Yes ✓ No __

Sufficient sample volume for indicated test? Yes ✓ No __

All samples received within holding time? Yes ✓ No __

Was TAT marked on the COC? Yes ✓ No __

Proceed with Standard TAT as per project history? Yes __ No __ Not Applicable ✓

Water - VOA vials have zero headspace? No VOA vials submitted ✓ Yes __ No __

Water - pH acceptable upon receipt? Yes __ No __ Not Applicable ✓

Adjusted? _____ Checked by _____

Sample Condition: Good ✓ Other(Explain) _____

(For diffusive samples or AIHA lead) Is a known blank included? Yes __ No ✓

See Case Narrative for resolution of the Non-Conformance.

* Samples do not have to comply with the given range for certain parameters.

\L\Quality Assurance\Checklists Procedures Sign-Off Templates\Checklists\Sample Receipt Checklists\Sample_Cooler_Receipt_Checklist

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample ID: **MB-184105**	Client ID:	Units: **mg/Kg**	Prep Date: **11/23/2013** Run No: **256450**
Sample Type: **MBLK**	Test Code: **TCL VOLATILE ORGANICS SW8260B**	Batch ID: **184105**	Analysis Date: **11/23/2013** Seq No: **5386963**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1,1-Trichloroethane	BRL	0.0050									
1,1,2,2-Tetrachloroethane	BRL	0.0050									
1,1,2-Trichloroethane	BRL	0.0050									
1,1-Dichloroethane	BRL	0.0050									
1,1-Dichloroethene	BRL	0.0050									
1,2,4-Trichlorobenzene	BRL	0.0050									
1,2-Dibromo-3-chloropropane	BRL	0.0050									
1,2-Dibromoethane	BRL	0.0050									
1,2-Dichlorobenzene	BRL	0.0050									
1,2-Dichloroethane	BRL	0.0050									
1,2-Dichloropropane	BRL	0.0050									
1,3-Dichlorobenzene	BRL	0.0050									
1,4-Dichlorobenzene	BRL	0.0050									
2-Butanone	BRL	0.050									
2-Hexanone	BRL	0.010									
4-Methyl-2-pentanone	BRL	0.010									
Acetone	BRL	0.10									
Benzene	BRL	0.0050									
Bromodichloromethane	BRL	0.0050									
Bromoform	BRL	0.0050									
Bromomethane	BRL	0.0050									
Carbon disulfide	BRL	0.010									
Carbon tetrachloride	BRL	0.0050									
Chlorobenzene	BRL	0.0050									
Chloroethane	BRL	0.010									
Chloroform	BRL	0.0050									
Chloromethane	BRL	0.010									

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample ID: MB-184105 Client ID: Units: mg/Kg Prep Date: 11/23/2013 Run No: 256450
Sample Type: MBLK Test Code: TCL VOLATILE ORGANICS SW8260B Batch ID: 184105 Analysis Date: 11/23/2013 Seq No: 5386963

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
cis-1,2-Dichloroethene	BRL	0.0050									
cis-1,3-Dichloropropene	BRL	0.0050									
Cyclohexane	BRL	0.0050									
Dibromochloromethane	BRL	0.0050									
Dichlorodifluoromethane	BRL	0.010									
Ethylbenzene	BRL	0.0050									
Freon-113	BRL	0.010									
Isopropylbenzene	BRL	0.0050									
m,p-Xylene	BRL	0.0050									
Methyl acetate	BRL	0.0050									
Methyl tert-butyl ether	BRL	0.0050									
Methylcyclohexane	BRL	0.0050									
Methylene chloride	BRL	0.020									
o-Xylene	BRL	0.0050									
Styrene	BRL	0.0050									
Tetrachloroethene	BRL	0.0050									
Toluene	BRL	0.0050									
trans-1,2-Dichloroethene	BRL	0.0050									
trans-1,3-Dichloropropene	BRL	0.0050									
Trichloroethene	BRL	0.0050									
Trichlorofluoromethane	BRL	0.0050									
Vinyl chloride	BRL	0.010									
Surr: 4-Bromofluorobenzene	0.04487	0	0.0500		89.7	70	128				
Surr: Dibromofluoromethane	0.05376	0	0.0500		108	78.2	128				
Surr: Toluene-d8	0.04510	0	0.0500		90.2	76.5	116				

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample ID: **LCS-184105** Client ID: Units: **mg/Kg** Prep Date: **11/23/2013** Run No: **256450**
Sample Type: **LCS** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184105** Analysis Date: **11/23/2013** Seq No: **5386959**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	0.05065	0.0050	0.0500		101	69.9	145				
Benzene	0.05055	0.0050	0.0500		101	72.3	130				
Chlorobenzene	0.05419	0.0050	0.0500		108	69	130				
Toluene	0.04807	0.0050	0.0500		96.1	71.1	130				
Trichloroethene	0.04646	0.0050	0.0500		92.9	71.7	136				
Surr: 4-Bromofluorobenzene	0.05170	0	0.0500		103	70	128				
Surr: Dibromofluoromethane	0.05214	0	0.0500		104	78.2	128				
Surr: Toluene-d8	0.04682	0	0.0500		93.6	76.5	116				

Sample ID: **1311G87-007AMS** Client ID: Units: **mg/Kg-dry** Prep Date: **11/23/2013** Run No: **256450**
Sample Type: **MS** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184105** Analysis Date: **11/23/2013** Seq No: **5387029**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	0.06252	0.0060	0.0605		103	56.6	151				
Benzene	0.06371	0.0060	0.0605		105	70.4	130				
Chlorobenzene	0.06324	0.0060	0.0605		105	67.5	132				
Toluene	0.05821	0.0060	0.0605		96.3	70.4	130				
Trichloroethene	0.05695	0.0060	0.0605		94.2	70.1	137				
Surr: 4-Bromofluorobenzene	0.06861	0	0.0605		113	70	128				
Surr: Dibromofluoromethane	0.06914	0	0.0605		114	78.2	128				
Surr: Toluene-d8	0.06027	0	0.0605		99.7	76.5	116				

Sample ID: **1311G87-007AMSD** Client ID: Units: **mg/Kg-dry** Prep Date: **11/23/2013** Run No: **256450**
Sample Type: **MSD** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184105** Analysis Date: **11/23/2013** Seq No: **5387037**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	0.05938	0.0060	0.0605		98.2	56.6	151	0.06252	5.14	20.4	
Benzene	0.05948	0.0060	0.0605		98.4	70.4	130	0.06371	6.87	16.9	

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311I96

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample **1311G87-007AMSD** Client ID: Units: **mg/Kg-dry** Prep Date: **11/23/2013** Run No: **256450**
Sample Type: **MSD** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **R94105** Analysis Date: **11/23/2013** Seq No: **5387037**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
Chlorobenzene	0.06030	0.0060	0.0605		99.7	67.5	132	0.06324	4.76	14.6	
Toluene	0.05534	0.0060	0.0605		91.5	70.4	130	0.05821	5.05	16.6	
Trichloroethene	0.05279	0.0060	0.0605		87.3	70.1	137	0.05695	7.58	17	
Surr: 4-Bromofluorobenzene	0.06631	0	0.0605		110	70	128	0.06861	0	0	
Surr: Dibromofluoromethane	0.06718	0	0.0605		111	78.2	128	0.06914	0	0	
Surr: Toluene-d8	0.05694	0	0.0605		94.2	76.5	116	0.06027	0	0	

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample ID: MB-184153 Client ID: Units: mg/Kg Prep Date: 11/25/2013 Run No: 256455
Sample Type: MBLK Test Code: TCL VOLATILE ORGANICS SW8260B Batch ID: 184153 Analysis Date: 11/25/2013 Seq No: 5388347

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1,1-Trichloroethane	BRL	0.25									
1,1,2,2-Tetrachloroethane	BRL	0.25									
1,1,2-Trichloroethane	BRL	0.25									
1,1-Dichloroethane	BRL	0.25									
1,1-Dichloroethene	BRL	0.25									
1,2,4-Trichlorobenzene	BRL	0.25									
1,2-Dibromo-3-chloropropane	BRL	0.25									
1,2-Dibromoethane	BRL	0.25									
1,2-Dichlorobenzene	BRL	0.25									
1,2-Dichloroethane	BRL	0.25									
1,2-Dichloropropane	BRL	0.25									
1,3-Dichlorobenzene	BRL	0.25									
1,4-Dichlorobenzene	BRL	0.25									
2-Butanone	BRL	2.5									
2-Hexanone	BRL	0.50									
4-Methyl-2-pentanone	BRL	0.50									
Acetone	BRL	5.0									
Benzene	BRL	0.25									
Bromodichloromethane	BRL	0.25									
Bromoform	BRL	0.25									
Bromomethane	BRL	0.25									
Carbon disulfide	BRL	0.50									
Carbon tetrachloride	BRL	0.25									
Chlorobenzene	BRL	0.25									
Chloroethane	BRL	0.50									
Chloroform	BRL	0.25									
Chloromethane	BRL	0.50									

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID: 184153

Sample ID: MB-184153 Client ID: Units: mg/Kg Prep Date: 11/25/2013 Run No: 256455
Sample Type: MBLK Test Code: TCL VOLATILE ORGANICS SW8260B Batch ID: 184153 Analysis Date: 11/25/2013 Seq No: 5388347

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
cis-1,2-Dichloroethene	BRL	0.25									
cis-1,3-Dichloropropene	BRL	0.25									
Cyclohexane	BRL	0.25									
Dibromochloromethane	BRL	0.25									
Dichlorodifluoromethane	BRL	0.50									
Ethylbenzene	BRL	0.25									
Freon-113	BRL	0.50									
Isopropylbenzene	BRL	0.25									
m,p-Xylene	BRL	0.25									
Methyl acetate	BRL	0.25									
Methyl tert-butyl ether	BRL	0.25									
Methylcyclohexane	BRL	0.25									
Methylene chloride	BRL	1.0									
o-Xylene	BRL	0.25									
Styrene	BRL	0.25									
Tetrachloroethene	BRL	0.25									
Toluene	BRL	0.25									
trans-1,2-Dichloroethene	BRL	0.25									
trans-1,3-Dichloropropene	BRL	0.25									
Trichloroethene	BRL	0.25									
Trichlorofluoromethane	BRL	0.25									
Vinyl chloride	BRL	0.50									
Surr: 4-Bromofluorobenzene	1.975	0	2.500		79.0	70	128				
Surr: Dibromofluoromethane	2.924	0	2.500		117	78.2	128				
Surr: Toluene-d8	2.378	0	2.500		95.1	76.5	116				

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311196

ANALYTICAL QC SUMMARY REPORT

Batch ID:

Sample **LCS-184153** Client ID: Units: **mg/Kg** Prep Date: **11/25/2013** Run No: **256455**
Sample Type: **LCS** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184153** Analysis Date: **11/25/2013** Seq No: **5388403**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	2.386	0.25	2.500		95.4	69.9	145				
Benzene	2.663	0.25	2.500		107	72.3	130				
Chlorobenzene	2.903	0.25	2.500		116	69	130				
Toluene	2.748	0.25	2.500		110	71.1	130				
Trichloroethene	2.627	0.25	2.500		105	71.7	136				
Surr: 4-Bromofluorobenzene	2.596	0	2.500		104	70	128				
Surr: Dibromofluoromethane	2.788	0	2.500		112	78.2	128				
Surr: Toluene-d8	2.469	0	2.500		98.8	76.5	116				

Sample **1311188-003AMS** Client ID: Units: **mg/Kg-dry** Prep Date: **11/25/2013** Run No: **256455**
Sample Type: **MS** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184153** Analysis Date: **11/25/2013** Seq No: **5388949**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	1.320	0.15	1.501		88.0	56.6	151				
Benzene	1.621	0.15	1.501		108	70.4	130				
Chlorobenzene	1.706	0.15	1.501		114	67.5	132				
Toluene	1.644	0.15	1.501		110	70.4	130				
Trichloroethene	1.558	0.15	1.501		104	70.1	137				
Surr: 4-Bromofluorobenzene	1.480	0	1.501		98.6	70	128				
Surr: Dibromofluoromethane	1.626	0	1.501		108	78.2	128				
Surr: Toluene-d8	1.494	0	1.501		99.6	76.5	116				

Sample **1311188-003AMSD** Client ID: Units: **mg/Kg-dry** Prep Date: **11/25/2013** Run No: **256455**
Sample Type: **MSD** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **184153** Analysis Date: **11/25/2013** Seq No: **5388950**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	1.318	0.15	1.501		87.8	56.6	151	1.320	0.159	20.4	
Benzene	1.543	0.15	1.501		103	70.4	130	1.621	4.95	16.9	

Qualifiers:
> Greater than Result value
< Less than Result value
B Analyte detected in the associated method bl
BRL Below reporting limit
E Estimated (value above quantitation range)
H Holding times for preparation or analysis ex
J Estimated value detected below Reporting Limit
N Analyte not NELAC certified
R RPD outside limits due to matrix
Rpt Lim Reporting Limit
S Spike Recovery outside limits due to matrix

Analytical Environmental Services, Inc

Date: 3-Dec-13

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1311I96

ANALYTICAL QC SUMMARY REPORT

BatchID:

Sample **1311I88-003AMSD** Client ID: Units: **mg/Kg-dry** Prep Date: **11/25/2013** Run No: **256455**
Sample Type: **MSD** Test Code: **TCL VOLATILE ORGANICS SW8260B** Batch ID: **19415 3** Analysis Date: **11/25/2013** Seq No: **5388950**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
Chlorobenzene	1.647	0.15	1.501		110	67.5	132	1.706	3.53	14.6	
Toluene	1.590	0.15	1.501		106	70.4	130	1.644	3.36	16.6	
Trichloroethene	1.548	0.15	1.501		103	70.1	137	1.558	0.638	17	
Surr: 4-Bromofluorobenzene	1.51	0	1.501		101	70	128	1.480	0	0	
Surr: Dibromofluoromethane	1.549	0	1.501		103	78.2	128	1.626	0	0	
Surr: Toluene-d8	1.471	0	1.501		98.0	76.5	116	1.494	0	0	

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method bl
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis ex
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

APPENDIX B

JUNE 2014 - GROUNDWATER LABORATORY ANALYTICAL REPORT

AES

ANALYTICAL ENVIRONMENTAL SERVICES, INC.

June 30, 2014

John Martiniere
Peachtree Environmental
3000 Northwoods Parkway, Suite 105
Norcross GA 30071

TEL: (770) 449-6100
FAX: (770) 449-6119

RE: Thomasville National Bank

Dear John Martiniere: Order No: 1406N48

Analytical Environmental Services, Inc. received 14 samples on 6/26/2014 11:10:00 AM for the analyses presented in following report.

No problems were encountered during the analyses. Additionally, all results for the associated Quality Control samples were within EPA and/or AES established limits. Any discrepancies associated with the analyses contained herein will be noted and submitted in the form of a project Case Narrative.
AES' certifications are as follows:
-NELAC/Florida Certification number E87582 for analysis of Environmental Water, soil/hazardous waste, and Drinking Water Microbiology, effective 07/01/14-06/30/15.
-AIHA-LAP, LLC Laboratory ID: 100671 for Industrial Hygiene samples (Organics, Inorganics), Environmental Lead (Paint, Soil, Dust Wipes, Air), and Environmental Microbiology (Fungal) Direct Examination, effective until 09/01/15.

These results relate only to the items tested. This report may only be reproduced in full.

If you have any questions regarding these test results, please feel free to call.

Dorothy deBruyn
Project Manager

3080 Presidential Drive • Atlanta, Georgia 30340 • Tel: 770.457.8177 • Fax: 770.457.8188 • Toll Free: 800.972.4889
www.aesatlanta.com

ANALYTICAL ENVIRONMENTAL SERVICES, INC
3785 Presidential Parkway, Atlanta GA 30340-3704
AES TEL.: (770) 457-8177 / TOLL-FREE (800) 972-4889 / FAX: (770) 457-8188

CHAIN OF CUSTODY

Work Order: 1406N48

Date: 6-26-14 Page 1 of 1

COMPANY: Peachtree Environmental
ADDRESS: 3000 Northwoods Pkwy Suite 105 Norcross GA 30071
PHONE: 770 449-6180
FAX:
SAMPLED BY: Thom Lawrence
SIGNATURE:

ANALYSIS REQUESTED: TCL VOC

Visit our website www.aesatlanta.com to check on the status of your results, place bottle orders, etc.

#	SAMPLE ID	SAMPLED DATE	SAMPLED TIME	Grab	Composite	Matrix (See codes)	PRESERVATION (See codes) H+I	REMARKS	No # of Containers
1	MW-1	6-24-14	1610	X		GW	X		2
2	MW-2	6-25-14	1200	X		GW	X		2
3	MW-3	6-25-14	1105	X		GW	X		2
4	MW-4	6-25-14	855	X		GW	X		2
5	MW-5	6-25-14	815	X		GW	X		2
6	MW-6	6-25-14	935	X		GW	X		2
7	MW-7	6-25-14	1620	X		GW	X		2
8	MW-8	6-25-14	1025	X		GW	X		2
9	MW-9	6-25-14	1455	X		GW	X		2
10	MW-10	6-25-14	1330	X		GW	X		2
11	MW-11	6-25-14	1410	X		GW	X		2
12	MW-12	6-25-14	1540	X		GW	X		2
13	MW-13	6-24-14	1650	X		GW	X		2
14	trip								2

RELINQUISHED BY	DATE/TIME	RECEIVED BY	DATE/TIME
1:	1110 6-26-14	1: Cateaya R	6/26/14 11:10a
2:		2:	
3:		3:	

SPECIAL INSTRUCTIONS/COMMENTS:

SHIPMENT METHOD
OUT / / VIA:
IN / / VIA:
CLIENT FedEx UPS MAIL COURIER
GREYHOUND OTHER_____

PROJECT INFORMATION
PROJECT NAME: Thomasville NB
PROJECT #: 3151
SITE ADDRESS: Thomasville GA
SEND REPORT TO: John Martiniere
INVOICE TO: (IF DIFFERENT FROM ABOVE)
QUOTE #:_____ PO#:_____

RECEIPT
Total # of Containers 28

Turnaround Time Request
X Standard 5 Business Days
2 Business Day Rush
Next Business Day Rush
Same Day Rush (auth req.)
Other _____

STATE PROGRAM (if any): _____
E-mail? Y / N; Fax? Y / N
DATA PACKAGE: I II III IV

SAMPLES RECEIVED AFTER 3PM OR ON SATURDAY ARE CONSIDERED RECEIVED THE NEXT BUSINESS DAY. IF TURNAROUND TIME IS NOT INDICATED, AES WILL PROCEED WITH STANDARD TAT OF SAMPLES. SAMPLES ARE DISPOSED 30 DAYS AFTER REPORT COMPLETION UNLESS OTHER ARRANGEMENTS ARE MADE.

MATRIX CODES: A = Air GW = Groundwater SE = Sediment SO = Soil SW = Surface Water W = Water (Blanks) DW = Drinking Water (Blanks) O = Other (specify) WW = Waste Water
PRESERVATIVE CODES: H+I = Hydrochloric acid + ice I = Ice only N = Nitric acid S+I = Sulfuric acid + ice S/M+I = Sodium Bisulfate/Methanol + ice O = Other (specify) NA = None

White Copy - Original; Yellow Copy - Client

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client: Peachtree Environmental
Project: Thomasville National Bank
Lab ID: 1406N48

Case Narrative

Sample Receiving Nonconformance:

Sample(s) [MW-4], were listed on the chain of custody but not present.

Received two set of MW-6 samples. One set of MW-6, matches the collection date/time as the COC but the other set of MW-6 had no collection time. Sample was logged in as MW-4.

Sample (1406N48-004 had MW6 on label.

Volatiles Organic Compounds Analysis by Method 8260B:

Due to sample matrix, sample 1406N48-002A required dilution during preparation and/or analysis resulting in elevated reporting limits.

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-1
Project Name:	Thomasville National Bank	**Collection Date:**	6/24/2014 4:10:00 PM
Lab ID:	1406N48-001	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 21:19	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 21:19	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 21:19	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-1
Project Name:	Thomasville National Bank	**Collection Date:**	6/24/2014 4:10:00 PM
Lab ID:	1406N48-001	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:19	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 21:19	GK
Surr: 4-Bromofluorobenzene	90.4	66.2-120		%REC	192977	1	06/27/2014 21:19	GK
Surr: Dibromofluoromethane	95.1	79.5-121		%REC	192977	1	06/27/2014 21:19	GK
Surr: Toluene-d8	97.5	77-117		%REC	192977	1	06/27/2014 21:19	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-2
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 12:00:00 PM
Lab ID:	1406N48-002	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,1,2,2-Tetrachloroethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,1,2-Trichloroethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,1-Dichloroethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,1-Dichloroethene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2,4-Trichlorobenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2-Dibromo-3-chloropropane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2-Dibromoethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2-Dichlorobenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2-Dichloroethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,2-Dichloropropane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,3-Dichlorobenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
1,4-Dichlorobenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
2-Butanone	BRL	1000		ug/L	192977	20	06/27/2014 15:40	GK
2-Hexanone	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
4-Methyl-2-pentanone	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
Acetone	BRL	1000		ug/L	192977	20	06/27/2014 15:40	GK
Benzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Bromodichloromethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Bromoform	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Bromomethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Carbon disulfide	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Carbon tetrachloride	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Chlorobenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Chloroethane	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
Chloroform	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Chloromethane	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
cis-1,2-Dichloroethene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
cis-1,3-Dichloropropene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Cyclohexane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Dibromochloromethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Dichlorodifluoromethane	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
Ethylbenzene	2100	100		ug/L	192977	20	06/27/2014 15:40	GK
Freon-113	BRL	200		ug/L	192977	20	06/27/2014 15:40	GK
Isopropylbenzene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
m,p-Xylene	8000	250		ug/L	192977	50	06/28/2014 03:14	GK
Methyl acetate	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Methyl tert-butyl ether	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Methylcyclohexane	100	100		ug/L	192977	20	06/27/2014 15:40	GK
Methylene chloride	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
o-Xylene	3700	100		ug/L	192977	20	06/27/2014 15:40	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-2
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 12:00:00 PM
Lab ID:	1406N48-002	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Tetrachloroethene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Toluene	2400	100		ug/L	192977	20	06/27/2014 15:40	GK
trans-1,2-Dichloroethene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
trans-1,3-Dichloropropene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Trichloroethene	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Trichlorofluoromethane	BRL	100		ug/L	192977	20	06/27/2014 15:40	GK
Vinyl chloride	BRL	40		ug/L	192977	20	06/27/2014 15:40	GK
Surr: 4-Bromofluorobenzene	98.5	66.2-120		%REC	192977	50	06/28/2014 03:14	GK
Surr: 4-Bromofluorobenzene	97	66.2-120		%REC	192977	20	06/27/2014 15:40	GK
Surr: Dibromofluoromethane	98.4	79.5-121		%REC	192977	50	06/28/2014 03:14	GK
Surr: Dibromofluoromethane	90.8	79.5-121		%REC	192977	20	06/27/2014 15:40	GK
Surr: Toluene-d8	100	77-117		%REC	192977	50	06/28/2014 03:14	GK
Surr: Toluene-d8	99.2	77-117		%REC	192977	20	06/27/2014 15:40	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-3
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 11:05:00 AM
Lab ID:	1406N48-003	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 03:42	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 03:42	GK
Benzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
cis-1,2-Dichloroethene	33	5.0		ug/L	192977	1	06/28/2014 03:42	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 03:42	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-3
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 11:05:00 AM
Lab ID:	1406N48-003	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Tetrachloroethene	80	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Trichloroethene	5.3	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 03:42	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 03:42	GK
Surr: 4-Bromofluorobenzene	89.9	66.2-120		%REC	192977	1	06/28/2014 03:42	GK
Surr: Dibromofluoromethane	97.8	79.5-121		%REC	192977	1	06/28/2014 03:42	GK
Surr: Toluene-d8	99.9	77-117		%REC	192977	1	06/28/2014 03:42	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-4
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 8:55:00 AM
Lab ID:	1406N48-004	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 21:46	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 21:46	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 21:46	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-4
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 8:55:00 AM
Lab ID:	1406N48-004	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 21:46	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 21:46	GK
Surr: 4-Bromofluorobenzene	92.8	66.2-120		%REC	192977	1	06/27/2014 21:46	GK
Surr: Dibromofluoromethane	96.5	79.5-121		%REC	192977	1	06/27/2014 21:46	GK
Surr: Toluene-d8	101	77-117		%REC	192977	1	06/27/2014 21:46	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-5
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 8:15:00 AM
Lab ID:	1406N48-005	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 04:09	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 04:09	GK
Benzene	13	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
cis-1,2-Dichloroethene	9.0	5.0		ug/L	192977	1	06/28/2014 04:09	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Cyclohexane	5.8	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 04:09	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Methylcyclohexane	5.2	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-5
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 8:15:00 AM
Lab ID:	1406N48-005	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Tetrachloroethene	1100	250		ug/L	192977	50	06/27/2014 15:12	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Trichloroethene	25	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:09	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 04:09	GK
Surr: 4-Bromofluorobenzene	89.5	66.2-120		%REC	192977	50	06/27/2014 15:12	GK
Surr: 4-Bromofluorobenzene	91.8	66.2-120		%REC	192977	1	06/28/2014 04:09	GK
Surr: Dibromofluoromethane	94.8	79.5-121		%REC	192977	50	06/27/2014 15:12	GK
Surr: Dibromofluoromethane	97.3	79.5-121		%REC	192977	1	06/28/2014 04:09	GK
Surr: Toluene-d8	99	77-117		%REC	192977	50	06/27/2014 15:12	GK
Surr: Toluene-d8	101	77-117		%REC	192977	1	06/28/2014 04:09	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-6
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 9:35:00 AM
Lab ID:	1406N48-006	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 04:36	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 04:36	GK
Benzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 04:36	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-6
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 9:35:00 AM
Lab ID:	1406N48-006	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Tetrachloroethene	450	50		ug/L	192977	10	06/27/2014 16:35	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Trichloroethene	89	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 04:36	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 04:36	GK
Surr: 4-Bromofluorobenzene	90.7	66.2-120		%REC	192977	1	06/28/2014 04:36	GK
Surr: 4-Bromofluorobenzene	91.4	66.2-120		%REC	192977	10	06/27/2014 16:35	GK
Surr: Dibromofluoromethane	93.1	79.5-121		%REC	192977	10	06/27/2014 16:35	GK
Surr: Dibromofluoromethane	96.2	79.5-121		%REC	192977	1	06/28/2014 04:36	GK
Surr: Toluene-d8	95.9	77-117		%REC	192977	10	06/27/2014 16:35	GK
Surr: Toluene-d8	100	77-117		%REC	192977	1	06/28/2014 04:36	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-7
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 4:20:00 PM
Lab ID:	1406N48-007	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 22:14	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 22:14	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 22:14	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-7
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 4:20:00 PM
Lab ID:	1406N48-007	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Tetrachloroethene	99	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Trichloroethene	6.8	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:14	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 22:14	GK
Surr: 4-Bromofluorobenzene	90.3	66.2-120		%REC	192977	1	06/27/2014 22:14	GK
Surr: Dibromofluoromethane	98.5	79.5-121		%REC	192977	1	06/27/2014 22:14	GK
Surr: Toluene-d8	102	77-117		%REC	192977	1	06/27/2014 22:14	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-8
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 10:25:00 AM
Lab ID:	1406N48-008	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 22:41	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 22:41	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 22:41	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-8
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 10:25:00 AM
Lab ID:	1406N48-008	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 22:41	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 22:41	GK
Surr: 4-Bromofluorobenzene	90.8	66.2-120		%REC	192977	1	06/27/2014 22:41	GK
Surr: Dibromofluoromethane	98.1	79.5-121		%REC	192977	1	06/27/2014 22:41	GK
Surr: Toluene-d8	100	77-117		%REC	192977	1	06/27/2014 22:41	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-9
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 2:55:00 PM
Lab ID:	1406N48-009	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 23:08	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 23:08	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 23:08	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-9
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 2:55:00 PM
Lab ID:	1406N48-009	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:08	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 23:08	GK
Surr: 4-Bromofluorobenzene	90.4	66.2-120		%REC	192977	1	06/27/2014 23:08	GK
Surr: Dibromofluoromethane	100	79.5-121		%REC	192977	1	06/27/2014 23:08	GK
Surr: Toluene-d8	103	77-117		%REC	192977	1	06/27/2014 23:08	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-10
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 1:30:00 PM
Lab ID:	1406N48-010	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 23:35	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 23:35	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 23:35	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-10
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 1:30:00 PM
Lab ID:	1406N48-010	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 23:35	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 23:35	GK
Surr: 4-Bromofluorobenzene	93.2	66.2-120		%REC	192977	1	06/27/2014 23:35	GK
Surr: Dibromofluoromethane	98.3	79.5-121		%REC	192977	1	06/27/2014 23:35	GK
Surr: Toluene-d8	98.3	77-117		%REC	192977	1	06/27/2014 23:35	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-11
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 2:10:00 PM
Lab ID:	1406N48-011	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 00:03	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 00:03	GK
Benzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 00:03	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-11
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 2:10:00 PM
Lab ID:	1406N48-011	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:03	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 00:03	GK
Surr: 4-Bromofluorobenzene	93	66.2-120		%REC	192977	1	06/28/2014 00:03	GK
Surr: Dibromofluoromethane	102	79.5-121		%REC	192977	1	06/28/2014 00:03	GK
Surr: Toluene-d8	98.2	77-117		%REC	192977	1	06/28/2014 00:03	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-12
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 3:40:00 PM
Lab ID:	1406N48-012	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 00:30	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 00:30	GK
Benzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 00:30	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-12
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 3:40:00 PM
Lab ID:	1406N48-012	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Tetrachloroethene	22	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:30	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 00:30	GK
Surr: 4-Bromofluorobenzene	89.8	66.2-120		%REC	192977	1	06/28/2014 00:30	GK
Surr: Dibromofluoromethane	97.3	79.5-121		%REC	192977	1	06/28/2014 00:30	GK
Surr: Toluene-d8	100	77-117		%REC	192977	1	06/28/2014 00:30	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc **Date:** 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-13
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 4:50:00 PM
Lab ID:	1406N48-013	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
2-Butanone	BRL	50		ug/L	192977	1	06/28/2014 00:58	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
Acetone	BRL	50		ug/L	192977	1	06/28/2014 00:58	GK
Benzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Chloroethane	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Chloromethane	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Freon-113	BRL	10		ug/L	192977	1	06/28/2014 00:58	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	MW-13
Project Name:	Thomasville National Bank	**Collection Date:**	6/25/2014 4:50:00 PM
Lab ID:	1406N48-013	**Matrix:**	Groundwater

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Toluene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/28/2014 00:58	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/28/2014 00:58	GK
Surr: 4-Bromofluorobenzene	90.5	66.2-120		%REC	192977	1	06/28/2014 00:58	GK
Surr: Dibromofluoromethane	96.7	79.5-121		%REC	192977	1	06/28/2014 00:58	GK
Surr: Toluene-d8	100	77-117		%REC	192977	1	06/28/2014 00:58	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	TRIP BLANK
Project Name:	Thomasville National Bank	**Collection Date:**	6/26/2014 11:10:00 AM
Lab ID:	1406N48-014	**Matrix:**	Aqueous

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
1,1,1-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,1,2,2-Tetrachloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,1,2-Trichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,1-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,1-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2,4-Trichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2-Dibromo-3-chloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2-Dibromoethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2-Dichloroethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,2-Dichloropropane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,3-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
1,4-Dichlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
2-Butanone	BRL	50		ug/L	192977	1	06/27/2014 14:45	GK
2-Hexanone	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
4-Methyl-2-pentanone	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
Acetone	BRL	50		ug/L	192977	1	06/27/2014 14:45	GK
Benzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Bromodichloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Bromoform	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Bromomethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Carbon disulfide	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Carbon tetrachloride	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Chlorobenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Chloroethane	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
Chloroform	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Chloromethane	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
cis-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
cis-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Cyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Dibromochloromethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Dichlorodifluoromethane	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
Ethylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Freon-113	BRL	10		ug/L	192977	1	06/27/2014 14:45	GK
Isopropylbenzene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
m,p-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Methyl acetate	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Methyl tert-butyl ether	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Methylcyclohexane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Methylene chloride	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
o-Xylene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client:	Peachtree Environmental	**Client Sample ID:**	TRIP BLANK
Project Name:	Thomasville National Bank	**Collection Date:**	6/26/2014 11:10:00 AM
Lab ID:	1406N48-014	**Matrix:**	Aqueous

Analyses	Result	Reporting Limit	Qual	Units	BatchID	Dilution Factor	Date Analyzed	Analyst
TCL VOLATILE ORGANICS SW8260B				**(SW5030B)**				
Styrene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Tetrachloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Toluene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
trans-1,2-Dichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
trans-1,3-Dichloropropene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Trichloroethene	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Trichlorofluoromethane	BRL	5.0		ug/L	192977	1	06/27/2014 14:45	GK
Vinyl chloride	BRL	2.0		ug/L	192977	1	06/27/2014 14:45	GK
Surr: 4-Bromofluorobenzene	90.5	66.2-120		%REC	192977	1	06/27/2014 14:45	GK
Surr: Dibromofluoromethane	92.6	79.5-121		%REC	192977	1	06/27/2014 14:45	GK
Surr: Toluene-d8	99.1	77-117		%REC	192977	1	06/27/2014 14:45	GK

Qualifiers:

*	Value exceeds maximum contaminant level	E	Estimated (value above quantitation range)
BRL	Below reporting limit	S	Spike Recovery outside limits due to matrix
H	Holding times for preparation or analysis exceeded	Narr	See case narrative
N	Analyte not NELAC certified	NC	Not confirmed
B	Analyte detected in the associated method blank	<	Less than Result value
>	Greater than Result value	J	Estimated value detected below Reporting Limit

Analytical Environmental Services, Inc.

Sample/Cooler Receipt Checklist

Client Peachtree Environmental Work Order Number 1406N48

Checklist completed by JOANA 6/26/14
Signature Date

Carrier name: FedEx __ UPS __ Courier __ Client ✓ US Mail __ Other _____

Shipping container/cooler in good condition? Yes ✓ No __ Not Present __

Custody seals intact on shipping container/cooler? Yes __ No __ Not Present ✓

Custody seals intact on sample bottles? Yes __ No __ Not Present ✓

Container/Temp Blank temperature in compliance? (4°C±2)* Yes ✓ No __

Cooler #1 3.4 Cooler #2 _____ Cooler #3 _____ Cooler #4 _____ Cooler#5 _____ Cooler #6 _____

Chain of custody present? Yes ✓ No __

Chain of custody signed when relinquished and received? Yes ✓ No __

Chain of custody agrees with sample labels? Yes ✓ No __

Samples in proper container/bottle? Yes ✓ No __

Sample containers intact? Yes ✓ No __

Sufficient sample volume for indicated test? Yes ✓ No __

All samples received within holding time? Yes ✓ No __

Was TAT marked on the COC? Yes ✓ No __

Proceed with Standard TAT as per project history? Yes __ No __ Not Applicable ✓

Water - VOA vials have zero headspace? No VOA vials submitted __ Yes ✓ No __

Water - pH acceptable upon receipt? Yes ✓ No __ Not Applicable __

Adjusted? _____ Checked by _____

Sample Condition: Good ✓ Other(Explain) _____

(For diffusive samples or AIHA lead) Is a known blank included? Yes ✓ No __

See Case Narrative for resolution of the Non-Conformance.

* Samples do not have to comply with the given range for certain parameters.

\L\Quality Assurance\Checklists Procedures Sign-Off Templates\Checklists\Sample Receipt Checklists\Sample_Cooler_Receipt_Checklist

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1406N48

ANALYTICAL QC SUMMARY REPORT

BatchID: 192977

Sample ID: **MB-192977** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **MBLK** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/26/2014** Seq No: **5711976**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1,1-Trichloroethane	BRL	5.0									
1,1,2,2-Tetrachloroethane	BRL	5.0									
1,1,2-Trichloroethane	BRL	5.0									
1,1-Dichloroethane	BRL	5.0									
1,1-Dichloroethene	BRL	5.0									
1,2,4-Trichlorobenzene	BRL	5.0									
1,2-Dibromo-3-chloropropane	BRL	5.0									
1,2-Dibromoethane	BRL	5.0									
1,2-Dichlorobenzene	BRL	5.0									
1,2-Dichloroethane	BRL	5.0									
1,2-Dichloropropane	BRL	5.0									
1,3-Dichlorobenzene	BRL	5.0									
1,4-Dichlorobenzene	BRL	5.0									
2-Butanone	BRL	50									
2-Hexanone	BRL	10									
4-Methyl-2-pentanone	BRL	10									
Acetone	BRL	50									
Benzene	BRL	5.0									
Bromodichloromethane	BRL	5.0									
Bromoform	BRL	5.0									
Bromomethane	BRL	5.0									
Carbon disulfide	BRL	5.0									
Carbon tetrachloride	BRL	5.0									
Chlorobenzene	BRL	5.0									
Chloroethane	BRL	10									
Chloroform	BRL	5.0									
Chloromethane	BRL	10									

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method blank
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis exceeded
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1406N48

ANALYTICAL QC SUMMARY REPORT

BatchID: 192977

Sample ID: **MB-192977** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **MBLK** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/26/2014** Seq No: **5711976**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
cis-1,2-Dichloroethene	BRL	5.0									
cis-1,3-Dichloropropene	BRL	5.0									
Cyclohexane	BRL	5.0									
Dibromochloromethane	BRL	5.0									
Dichlorodifluoromethane	BRL	10									
Ethylbenzene	BRL	5.0									
Freon-113	BRL	10									
Isopropylbenzene	BRL	5.0									
m,p-Xylene	BRL	5.0									
Methyl acetate	BRL	5.0									
Methyl tert-butyl ether	BRL	5.0									
Methylcyclohexane	BRL	5.0									
Methylene chloride	BRL	5.0									
o-Xylene	BRL	5.0									
Styrene	BRL	5.0									
Tetrachloroethene	BRL	5.0									
Toluene	BRL	5.0									
trans-1,2-Dichloroethene	BRL	5.0									
trans-1,3-Dichloropropene	BRL	5.0									
Trichloroethene	BRL	5.0									
Trichlorofluoromethane	BRL	5.0									
Vinyl chloride	BRL	2.0									
Surr: 4-Bromofluorobenzene	46.74	0	50.00		93.5	66.2	120				
Surr: Dibromofluoromethane	48.36	0	50.00		96.7	79.5	121				
Surr: Toluene-d8	51.42	0	50.00		103	77	117				

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method blank
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis exceeded
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1406N48

ANALYTICAL QC SUMMARY REPORT

BatchID: 192977

Sample ID: **LCS-192977** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **LCS** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/26/2014** Seq No: **5711975**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	47.64	5.0	50.00		95.3	63.1	140				
Benzene	48.24	5.0	50.00		96.5	74.2	129				
Chlorobenzene	47.39	5.0	50.00		94.8	70	129				
Toluene	50.47	5.0	50.00		101	74.2	129				
Trichloroethene	49.00	5.0	50.00		98.0	71.2	135				
Surr: 4-Bromofluorobenzene	47.74	0	50.00		95.5	66.2	120				
Surr: Dibromofluoromethane	48.03	0	50.00		96.1	79.5	121				
Surr: Toluene-d8	50.85	0	50.00		102	77	117				

Sample ID: **1406M90-001AMS** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **MS** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/27/2014** Seq No: **5711977**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	48.04	5.0	50.00		96.1	60.2	159				
Benzene	47.84	5.0	50.00		95.7	70.2	138				
Chlorobenzene	46.01	5.0	50.00		92.0	70.1	133				
Toluene	49.41	5.0	50.00		98.8	70	139				
Trichloroethene	53.11	5.0	50.00		106	70.1	144				
Surr: 4-Bromofluorobenzene	46.39	0	50.00		92.8	66.2	120				
Surr: Dibromofluoromethane	49.45	0	50.00		98.9	79.5	121				
Surr: Toluene-d8	51.14	0	50.00		102	77	117				

Sample ID: **1406M90-001AMSD** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **MSD** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/27/2014** Seq No: **5711978**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
1,1-Dichloroethene	45.74	5.0	50.00		91.5	60.2	159	48.04	4.91	19.2	
Benzene	47.10	5.0	50.00		94.2	70.2	138	47.84	1.56	20	

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method blank
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis exceeded
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

Analytical Environmental Services, Inc

Date: 30-Jun-14

Client: Peachtree Environmental
Project Name: Thomasville National Bank
Workorder: 1406N48

ANALYTICAL QC SUMMARY REPORT

BatchID: 192977

Sample ID: **1406M90-001AMSD** Client ID: Units: **ug/L** Prep Date: **06/26/2014** Run No: **270696**
SampleType: **MSD** TestCode: **TCL VOLATILE ORGANICS SW8260B** BatchID: **192977** Analysis Date: **06/27/2014** Seq No: **5711978**

Analyte	Result	RPT Limit	SPK value	SPK Ref Val	%REC	Low Limit	High Limit	RPD Ref Val	%RPD	RPD Limit	Qual
Chlorobenzene	45.74	5.0	50.00		91.5	70.1	133	46.01	0.589	20	
Toluene	48.99	5.0	50.00		98.0	70	139	49.41	0.854	20	
Trichloroethene	50.16	5.0	50.00		100	70.1	144	53.11	5.71	20	
Surr: 4-Bromofluorobenzene	45.62	0	50.00		91.2	66.2	120	46.39	0	0	
Surr: Dibromofluoromethane	48.74	0	50.00		97.5	79.5	121	49.45	0	0	
Surr: Toluene-d8	51.00	0	50.00		102	77	117	51.14	0	0	

Qualifiers:

>	Greater than Result value	<	Less than Result value	B	Analyte detected in the associated method blank
BRL	Below reporting limit	E	Estimated (value above quantitation range)	H	Holding times for preparation or analysis exceeded
J	Estimated value detected below Reporting Limit	N	Analyte not NELAC certified	R	RPD outside limits due to matrix
Rpt Lim	Reporting Limit	S	Spike Recovery outside limits due to matrix		

APPENDIX C

MONITORING WELL PURGING AND SAMPLING INFORMATION SHEETS

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/24/14

WELL INFORMATION

Well Identification No:	**MW-1**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	30.00 feet		
Depth to Water from TOC:	22.36 feet		
Length of Static Water Column:	7.64 feet		
Screen Interval:	20.00 - 30.00 feet		

WELL OBSERVATIONS

General Condition of Well: Good — General Condition of surrounding area: Good

LNAPL observation: None — Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.25 gallons	3.74 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 27 feet

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	15:50	4.25	23.00	0.164	8.14	23.56	-24		
1	15:55	4.07	22.90	0.165	4.51	4.80	-5.4		0.4
2	16:00	3.95	28.87	0.167	3.56	4.03	8.0		0.8
3	16:05	3.93	22.90	0.165	2.43	3.75	18.9		1.2
4	16:10	3.98	22.97	0.161	1.80	3.80	23.9		1.6
5									
6									
7									

Purged Volume: Purged approximately 1.6 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW1	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. — Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-2**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	30.00 feet		
Depth to Water from TOC:	23.17 feet		
Length of Static Water Column:	6.83 feet		
Screen Interval:	20.00 - 30.00 feet		

WELL OBSERVATIONS

General Condition of Well: Good | General Condition of surrounding area: Good

LNAPL observation: None | Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652 (4-inch well)
	0.163 (2-inch well)	1.02 (5-inch well)
	0.367 (3-inch well)	1.469 (6-inch well)

Volume of water in well (Ht. x K): 1.11 gallons (1 well volume) | 3.34 gallons (3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 27 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	11:35	6.09	24.77	0.546	11.90	1.73	12.1	23.17	
1	11:40	5.90	24.70	0.549	11.5	1.55	14.7	23.20	0.40
2	11:45	5.68	24.82	0.550	6.9	0.62	13.1	23.20	0.80
3	11:50	5.73	24.75	0.549	5.1	0.52	2.3	23.21	1.20
4	11:55	5.81	24.94	0.547	4.22	0.45	-11.8	23.24	1.60
5	12:00	5.86	25.13	0.536	2.98	0.40	-19.6	23.25	2.00
6									
7									

Purged Volume: Purged approximately 2.0 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-2	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. | Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-3**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	29.00 feet		
Depth to Water from TOC:	22.47 feet		
Length of Static Water Column:	6.53 feet		
Screen Interval:	19.00 - 29.00 feet		

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.06 gallons	3.19 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 27 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	10:45	5.35	25.61	0.412	18.8	3.02	94.0	0.29	
1	10:50	5.03	24.18	0.392	7.40	1.39	88.9	0.27	0.4
2	10:55	4.86	24.35	0.394	5.22	1.30	91.7	0.28	0.8
3	11:00	4.86	24.02	0.394	5.57	1.23	82.1	0.28	1.2
4	11:05	4.93	24.29	0.379	3.39	1.00	65.4	0.27	1.6
5									
6									
7									

Purged Volume: Purged approximately 1.6 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-3	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-4**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	30.00 feet		
Depth to Water from TOC:	21.39 feet		
Length of Static Water Column:	8.61 feet		
Screen Interval:	20.00 - 30.00 feet		

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.40 gallons	4.21 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 27 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	8:30	5.84	24.12	0.549	70.7	7.72	143.5		
1	8:35	5.72	23.91	0.599	40.3	2.74	136.7		0.5
2	8:40	5.72	23.86	0.599	28.8	2.50	132.3		1.0
3	8:45	5.73	23.83	0.598	18.5	2.42	126.6		1.5
4	8:50	5.77	23.79	0.598	11.6	2.34	118.7		2.0
5	8:55	5.78	23.77	0.598	9.51	2.35	114.0		2.5
6									
7									

Purged Volume: Purged approximately 2.5 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-4	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-5**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	34.00 feet		
Depth to Water from TOC:	24.04 feet		
Length of Static Water Column:	9.96 feet		
Screen Interval:	24.00 - 34.00 feet		

WELL OBSERVATIONS

General Condition of Well: Good — General Condition of surrounding area: Good

LNAPL observation: None — Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.62 gallons	4.87 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 30 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	7:50	4.20	24.37	0.217	2403	18.77	91.1		
1	7:55	4.25	23.89	0.163	71.8	18.51	65.8		0.5
2	8:00	4.24	23.89	0.162	19.1	2.05	61.9		1.0
3	8:05	4.27	23.88	0.170	10.5	1.98	55.4		1.5
4	8:10	4.36	23.88	0.180	7.72	1.01	50.9		2.0
5	8:15	4.40	23.88	0.182	6.75	1.01	48.7		2.5
6									
7									

Purged Volume: Purged approximately 2.5 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-5			
	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. — Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-6**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	1-Inch	Well Construction:	Schedule 40 PVC

Total Well Depth from TOC:	30.00 feet
Depth to Water from TOC:	22.08 feet
Length of Static Water Column:	7.92 feet
Screen Interval:	20.00 - 30.00 feet

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	**0.041 (1-inch well)**	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	0.32 gallons	0.97 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 27 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	9:15	4.91	23.80	0.152	63.9	4.22	81.1		
1	9:20	4.49	23.42	0.138	44.9	2.12	107.7		0.3
2	9:25	4.35	23.52	0.159	27.8	1.48	126.6		0.6
3	9:30	4.41	23.55	0.178	9.67	1.20	122.6		0.9
4	9:35	4.52	23.62	0.187	4.04	1.08	116.7		1.2
5									
6									
7									

Purged Volume: Purged approximately 1.2 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-6	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-7**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC

Total Well Depth from TOC:	30.00 feet
Depth to Water from TOC:	11.14 feet
Length of Static Water Column:	18.86 feet
Screen Interval:	20.00 - 30.00 feet

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	3.07 gallons	9.22 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 28 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	16:00	4.95	23.89	0.095	10.51	2.40	98.1	11.34	
1	16:05	4.56	23.69	0.096	10.56	1.82	118.3	12.59	0.50
2	16:10	3.99	23.80	0.095	7.98	1.53	153.6	13.54	1.00
3	16:15	3.93	23.74	0.094	6.52	1.46	160.3	14.11	1.50
4	16:20	4.01	23.84	0.092	5.11	1.44	156.6	14.71	2.00
5									
6									
7									

Purged Volume: Purged approximately 2 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-7	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No: **MW-8** | Location: Thomasville, Thomas County, Georgia

Well Diameter: 2-Inch | Well Construction: Schedule 40 PVC

Total Well Depth from TOC: 35.00 feet

Depth to Water from TOC: 23.65 feet

Length of Static Water Column: 11.35 feet

Screen Interval: 25.00 - 35.00 feet

WELL OBSERVATIONS

General Condition of Well: Good | General Condition of surrounding area: Good

LNAPL observation: None | Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K = 0.041 (1-inch well) 0.652 (4-inch well)

0.163 (2-inch well) 1.02 (5-inch well)

0.367 (3-inch well) 1.469 (6-inch well)

Volume of water in well (Ht. x K): 1.85 gallons (1 well volume) 5.55 gallons (3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 32 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	10:05	5.93	23.40	0.573	28.6	4.01	132.1	23.65	
1	10:10	5.64	22.92	0.564	11.19	2.05	127.3	23.70	0.3
2	10:15	5.54	22.92	0.559	4.98	1.84	114.2	23.71	0.7
3	10:20	5.56	22.94	0.556	3.18	1.76	108.0	23.71	1.0
4	10:25	5.59	22.97	0.553	2.78	1.73	100.2	23.71	1.3
5									
6									
7									

Purged Volume: Purged approximately 1.3 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-8	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-9**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	20.00 feet		
Depth to Water from TOC:	11.15 feet		
Length of Static Water Column:	8.85 feet		
Screen Interval:	10.00 - 20.00 feet		

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.44 gallons	4.33 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 30 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	14:35	4.70	22.51	0.110	26.80	2.10	111	11.24	
1	14:40	3.92	22.20	0.111	19.70	0.99	162	11.35	0.50
2	14:45	3.63	22.17	0.109	9.88	0.81	183	11.36	1.00
3	14:50	3.66	22.12	0.110	8.05	0.74	183	11.36	1.50
4	14:55	3.72	22.06	0.112	4.86	0.71	179	11.36	2.00
5									
6									
7									

Purged Volume: Purged approximately 2 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-9	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No: **MW-10** | Location: Thomasville, Thomas County, Georgia

Well Diameter: 2-Inch | Well Construction: Schedule 40 PVC

Total Well Depth from TOC: 25.00 feet

Depth to Water from TOC: 16.49 feet

Length of Static Water Column: 8.51 feet

Screen Interval: 15.00 - 25.00 feet

WELL OBSERVATIONS

General Condition of Well: Good | General Condition of surrounding area: Good

LNAPL observation: None | Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652 (4-inch well)
	0.163 (2-inch well)	1.02 (5-inch well)
	0.367 (3-inch well)	1.469 (6-inch well)

Volume of water in well (Ht. x K):	1.39 gallons	4.16 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 30 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	13:10	5.54	25.51	0.548	46.7	2.35	66.3	11.59	
1	13:15	5.12	24.62	0.527	42.9	1.53	98.2	16.61	0.4
2	13:20	4.96	24.48	0.480	22.5	0.88	116.4	16.61	0.8
3	13:25	5.11	24.62	0.450	11.6	0.75	108.4	16.61	1.2
4	13:30	5.11	24.62	0.420	8.0	0.63	101.0	16.61	1.6
5									
6									
7									

Purged Volume: Purged approximately 1.6 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-10	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. | Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No: **MW-11** | Location: Thomasville, Thomas County, Georgia

Well Diameter: 2-Inch | Well Construction: Schedule 40 PVC

Total Well Depth from TOC: 25.00 feet

Depth to Water from TOC: 17.86 feet

Length of Static Water Column: 7.14 feet

Screen Interval: 15.00 - 25.00 feet

WELL OBSERVATIONS

General Condition of Well: Good | General Condition of surrounding area: Good

LNAPL observation: None | Method of measure: Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K = 0.041 (1-inch well) 0.652 (4-inch well)

0.163 (2-inch well) 1.02 (5-inch well)

0.367 (3-inch well) 1.469 (6-inch well)

Volume of water in well (Ht. x K): 1.16 gallons (1 well volume) 3.49 gallons (3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 23 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	13:10	4.76	23.44	0.101	33.5	2.47	103.8	18.06	
1	13:15	4.03	22.76	0.097	21.2	1.56	167.6	18.15	0.50
2	13:20	3.71	22.60	0.097	11.79	1.24	195.6	18.19	1.00
3	13:25	reset	22.75	0.097	5.49	1.15	203.2	18.19	1.50
4	13:30	4.48	22.77	0.099	4.08	1.05	165.5	18.19	2.00
5									
6									
7									

Purged Volume: Purged approximately 2.0 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-11	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. | Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom A. Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/25/14

WELL INFORMATION

Well Identification No:	**MW-12**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	15.00 feet		
Depth to Water from TOC:	2.89 feet		
Length of Static Water Column:	12.11 feet		
Screen Interval:	5.00 - 15.00 feet		

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.97 gallons	5.92 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 13 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	15:20	5.88	24.00	0.339	66.6	1.93	111.7	3.04	
1	15:25	4.94	24.12	0.281	12.8	0.84	134.6	3.02	0.50
2	15:30	4.78	24.11	0.278	7.98	0.78	137.4	3.02	1.00
3	15:35	4.80	24.23	0.278	5.56	0.74	131.8	3.02	1.50
4	15:40	4.86	24.08	0.277	3.40	0.71	122.4	3.02	2.00
5									
6									
7									

Purged Volume: Purged approximately 2 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from tubing.

Decontamination procedures: N/A - Single-use tubing.

Sample ID	Container	Preservative	Analyses
MW-12	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

Monitoring Well Purging & Sampling Information

Peachtree Project: Thomasville National Bank | **Project No.:** 3151 | **Date:** 6/24/14

WELL INFORMATION

Well Identification No:	**MW-13**	Location:	Thomasville, Thomas County, Georgia
Well Diameter:	2-Inch	Well Construction:	Schedule 40 PVC
Total Well Depth from TOC:	30.00 feet		
Depth to Water from TOC:	19.55 feet		
Length of Static Water Column:	10.45 feet		
Screen Interval:	20.00 - 30.00 feet		

WELL OBSERVATIONS

General Condition of Well:	Good	General Condition of surrounding area:	Good
LNAPL observation:	None	Method of measure:	Electric Water Level Indicator

Volume of water in well = Height (Ht) of water in well x K

where: K =	0.041 (1-inch well)	0.652	(4-inch well)
	0.163 (2-inch well)	1.02	(5-inch well)
	0.367 (3-inch well)	1.469	(6-inch well)

Volume of water in well (Ht. x K):	1.70 gallons	5.11 gallons
	(1 well volume)	(3 well volumes)

WELL PURGING INFORMATION

Purging method: Peristaltic pump with disposable tubing.

Depth of Pump Placement: Approximately 28 feet.

Reading	Time	pH	Temp. (^oC)	Specific Conductivity (mS/cm)	Turbidity (NTUs)	DO	ORP	DTW	Purge Volume Gallons
Initial	16:30	4.74	21.28	0.072	1	4.54	27.1		
1	16:35	4.28	21.40	0.072	2	3.75	52.8		0.5
2	16:40	3.92	21.39	0.071	3	3.41	71.5		1.0
3	16:45	3.84	21.36	0.070	2	3.66	74.7		1.5
4	16:50	3.86	21.38	0.071	1.3	3.52	74.8		2.0
5									
6									
7									

Purged Volume: Purged approximately 2 gallons

WELL SAMPLING INFORMATION

Method of sampling: Peristaltic pump with sample collected directly from discharge tubing.

Decontamination procedures: N/A - Single use tubing.

Sample ID	Container	Preservative	Analyses
MW-13	2 - 40 mL	HCL	VOCs (Method 8260)

Sample Transport and Preservation: Ice Filled Cooler

Sample Destination: Analytical Environmental Services, Inc. Via: Hand Delivery by Peachtree Personnel

Chain of Custody completed: Yes

Peachtree Environmental Personnel: Thom Lawrence

APPENDIX D

SUMMARY- PROFESSIONAL CERTIFICATION HOURS

THOMASVILLE NATIONAL BANK
THOMASVILLE, THOMAS COUNTY, GEORGIA
HSI #10902

APPENDIX D

MONTHLY SUMMARY AND DESCRIPTION OF PROFESSIONAL ENGINEER HOURS

Quantity	Units	Time Period + Description of Activities	Hours		
					Subtotal
		February 1 to February 28, 2014			
		PE Oversight / Project Management -			
1.50	Hours	Project Director (John P. Martiniere, P.E.)			1.50
		March 1 to March 31, 2014			
		PE Oversight / Project Management -			
0.00	Hours	Project Director (John P. Martiniere, P.E.)			0.00
		April 1 to April 30, 2014			
		PE Oversight / Project Management -			
0.00	Hours	Project Director (John P. Martiniere, P.E.)			0.00
		May 1 to May 31, 2014			
		PE Oversight / Project Management -			
0.00	Hours	Project Director (John P. Martiniere, P.E.)			0.00
		June 1 to June 31, 2014			
		PE Oversight / Project Management -			
2.50	Hours	Project Director (John P. Martiniere, P.E.)			2.50
		July 1 to July 31, 2014			
		PE Oversight / Project Management -			
5.50	Hours	Project Director (John P. Martiniere, P.E.)			5.50

PE MONTHLY HOURS TOTAL => **9.50**