






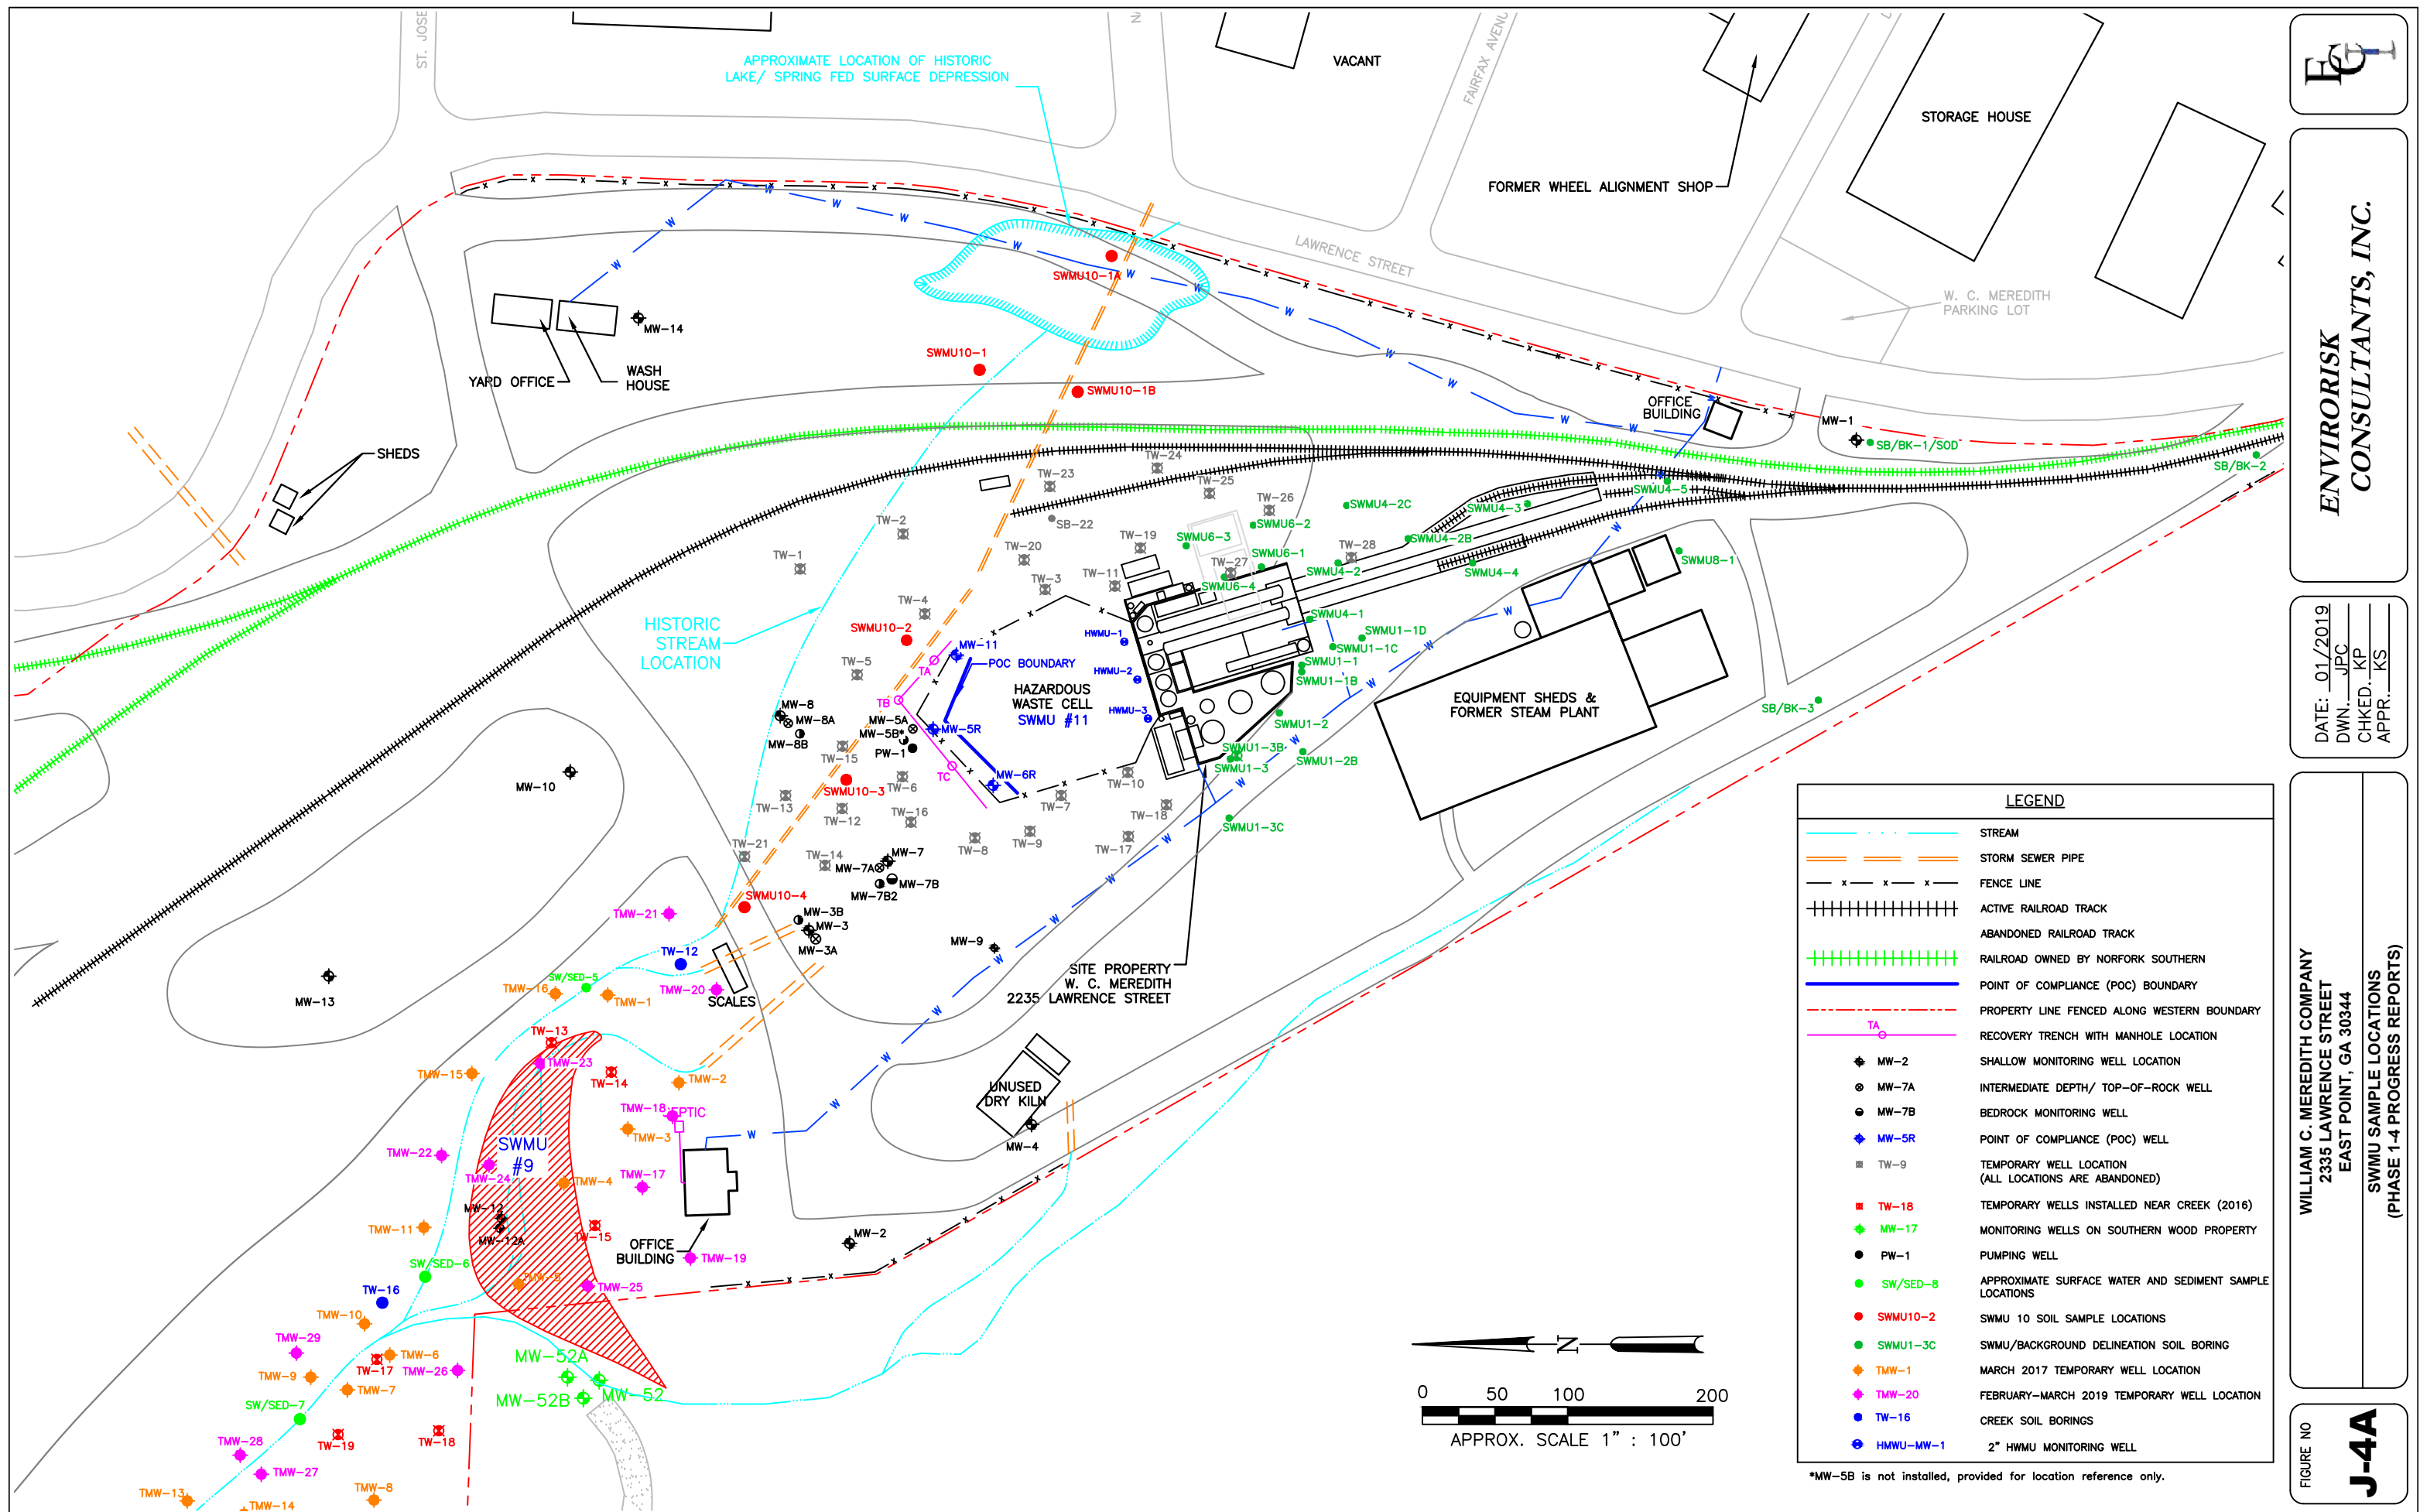


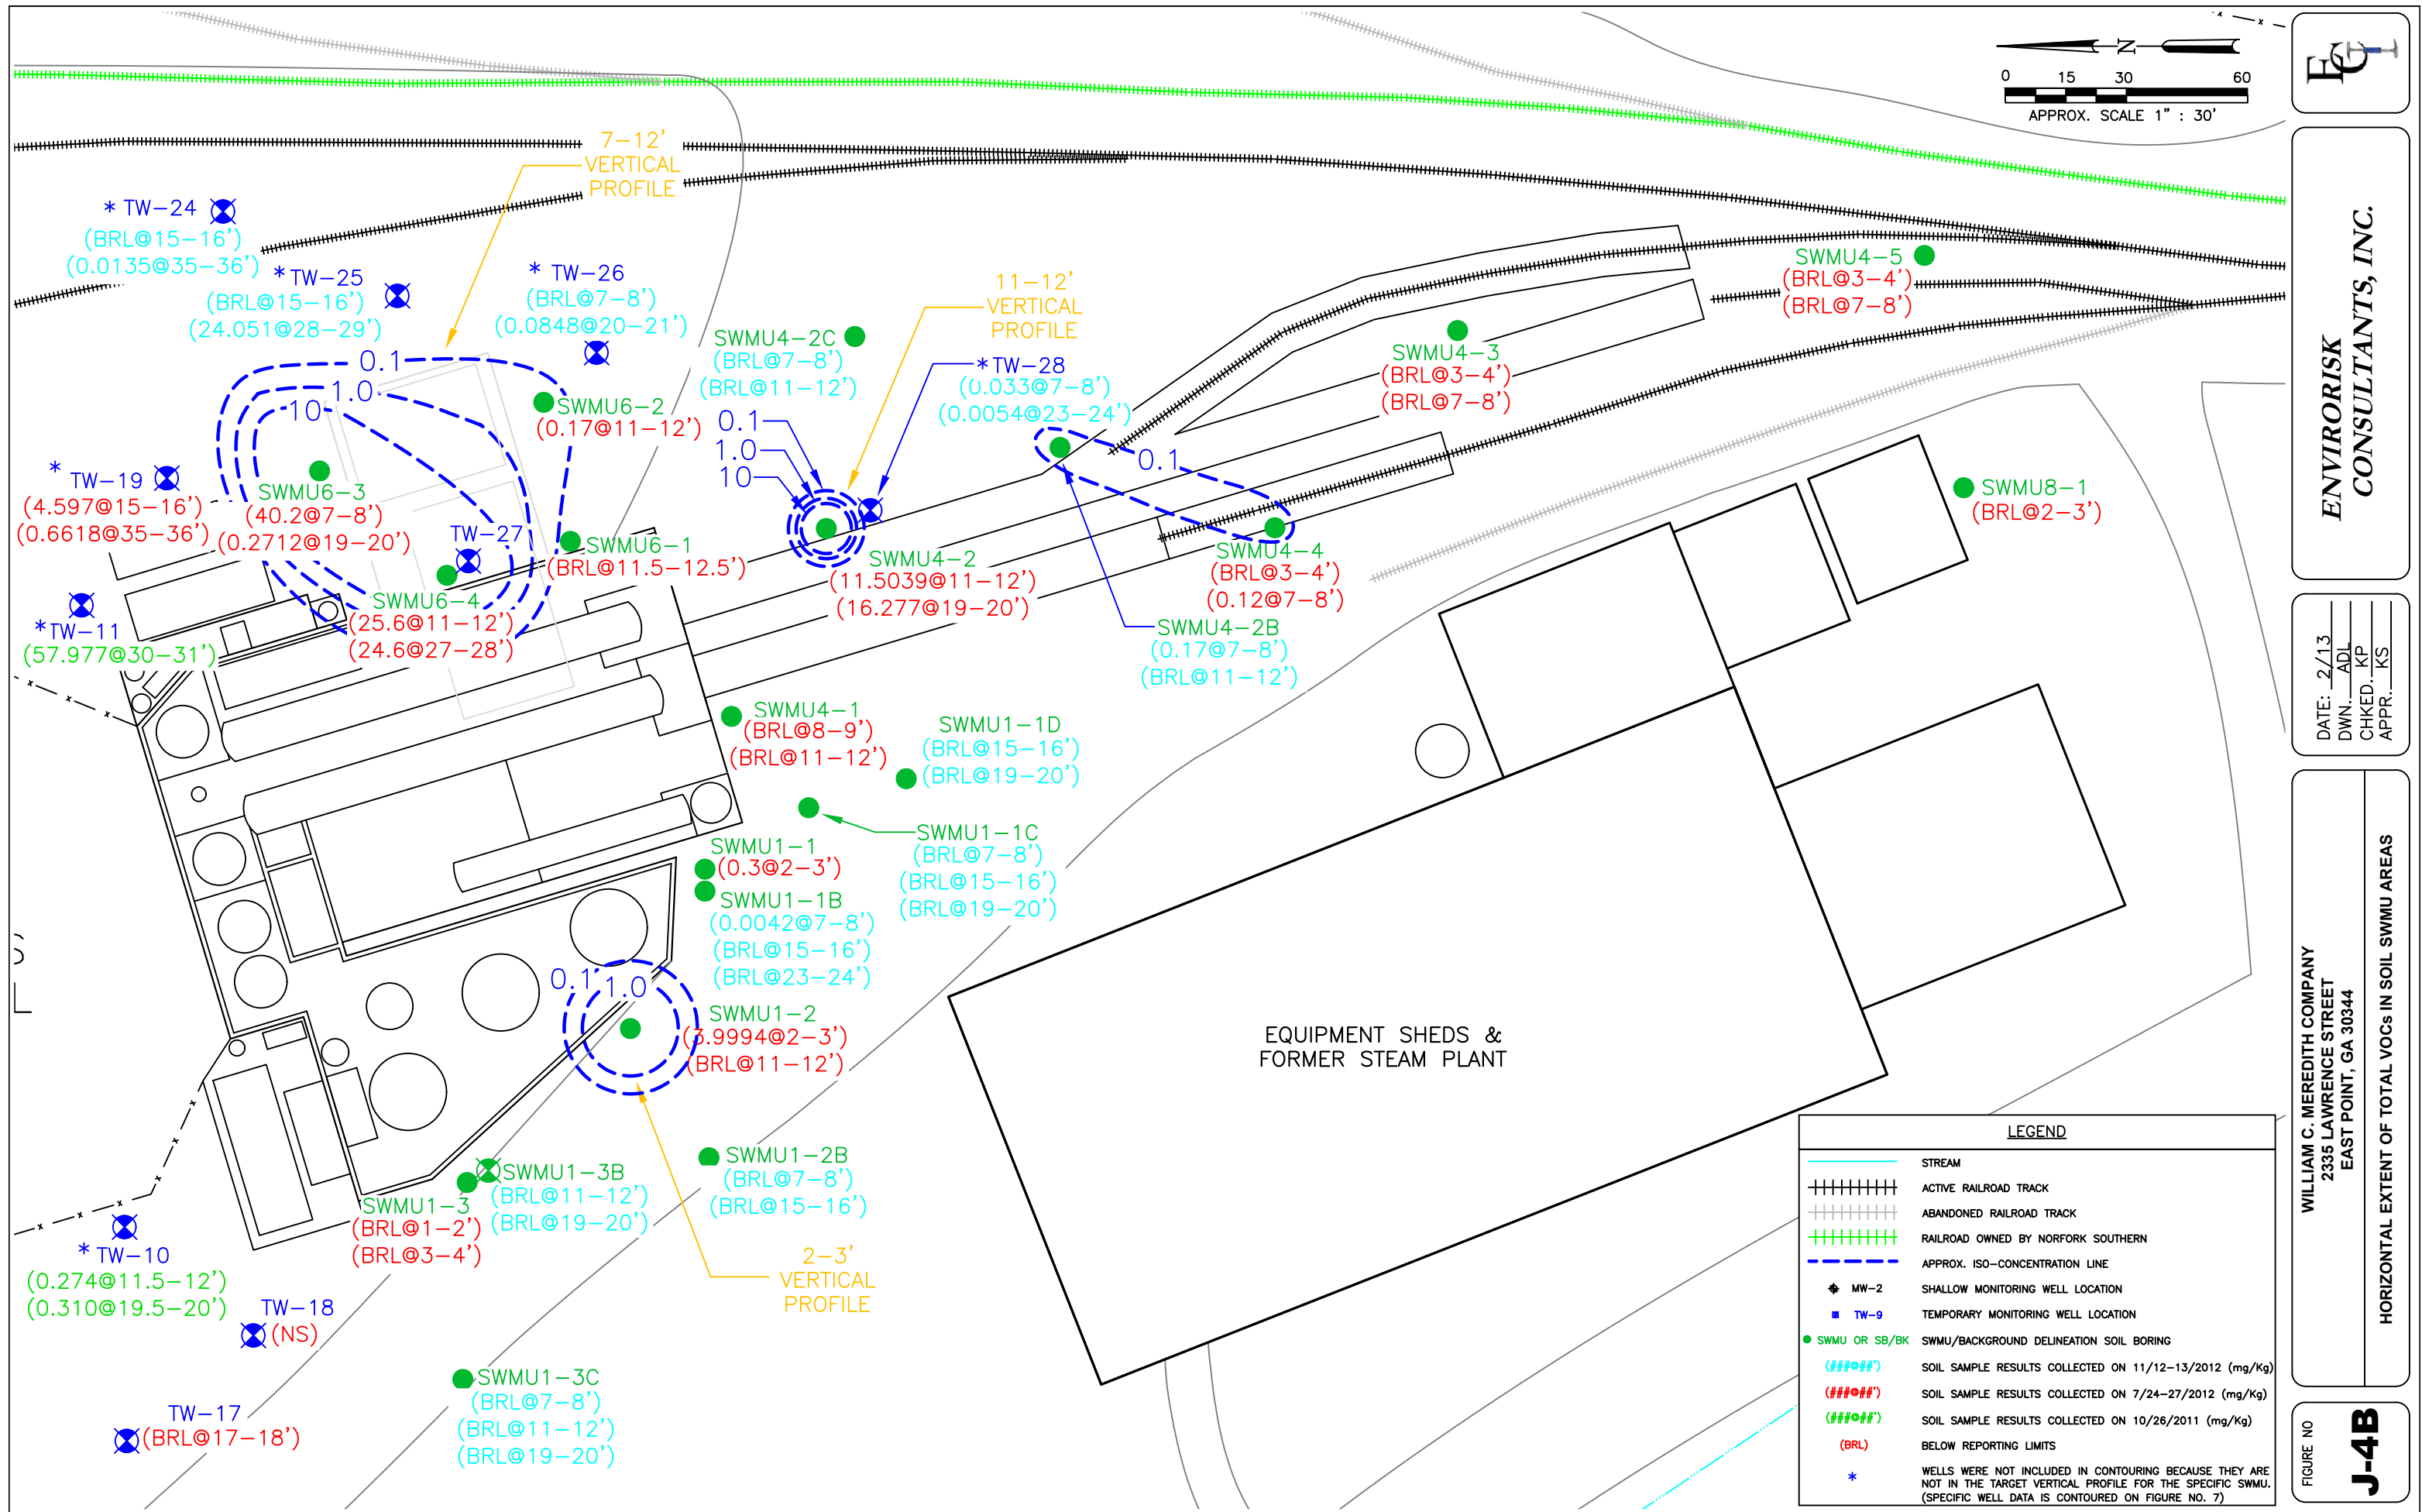



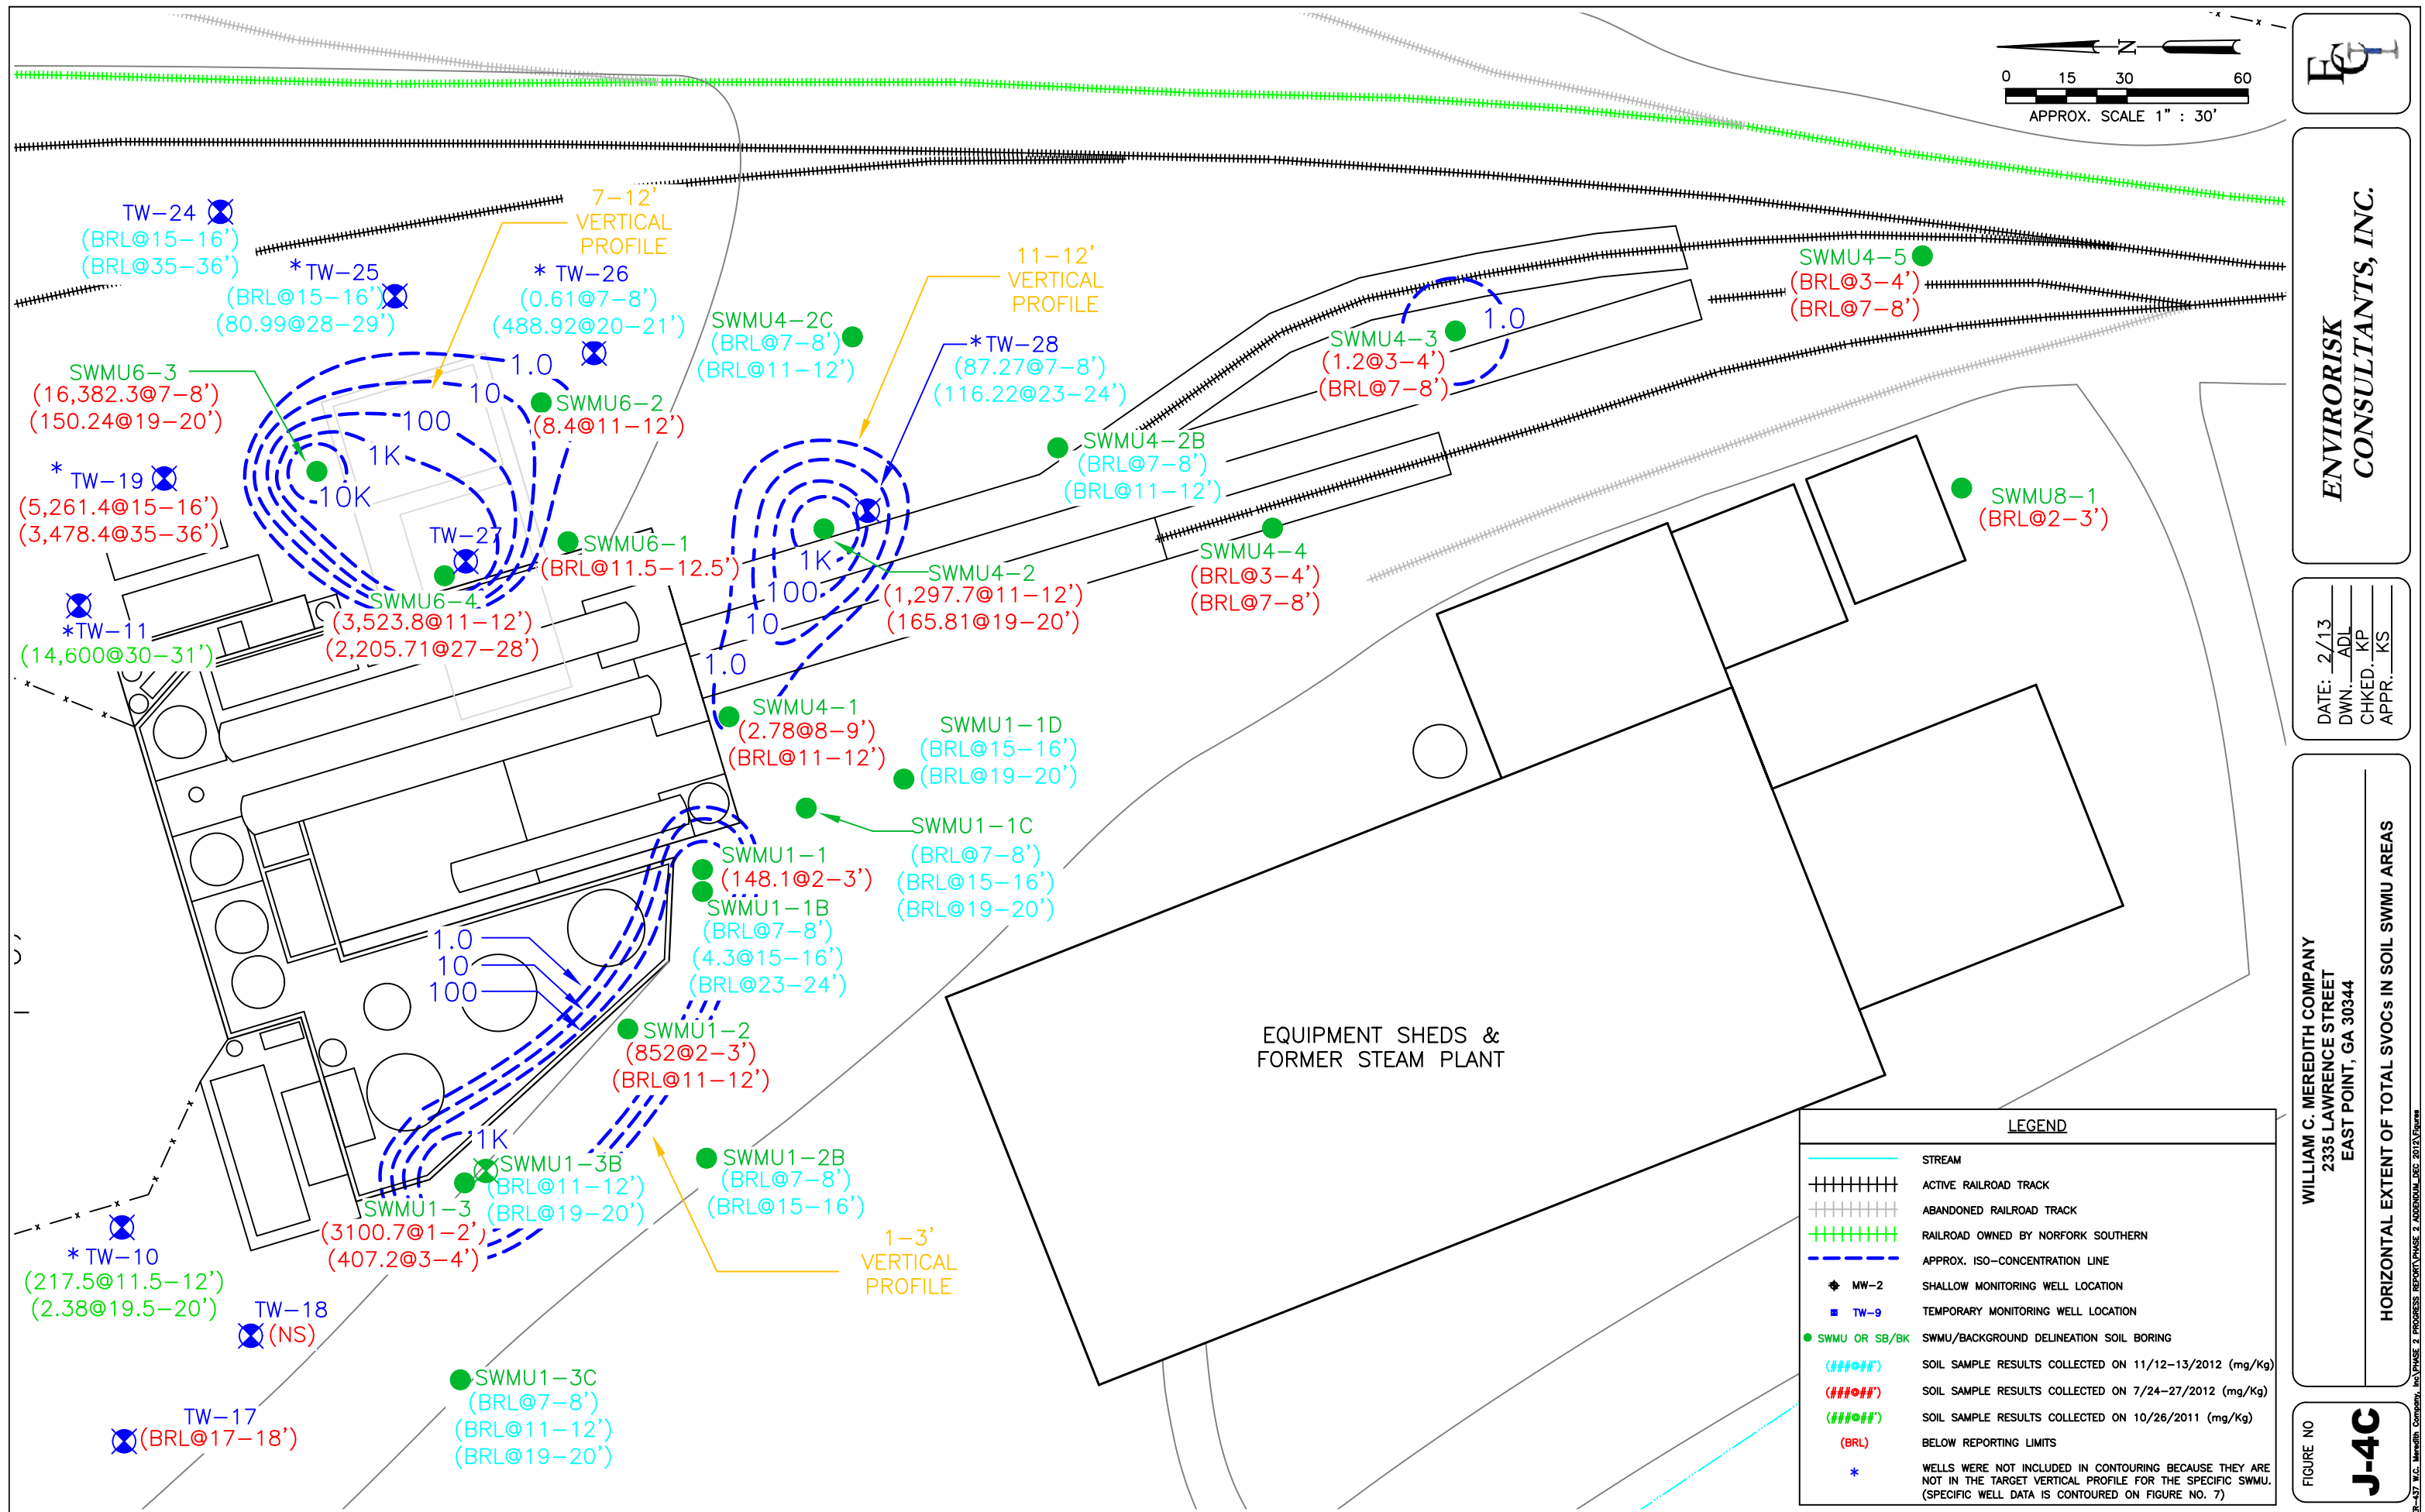


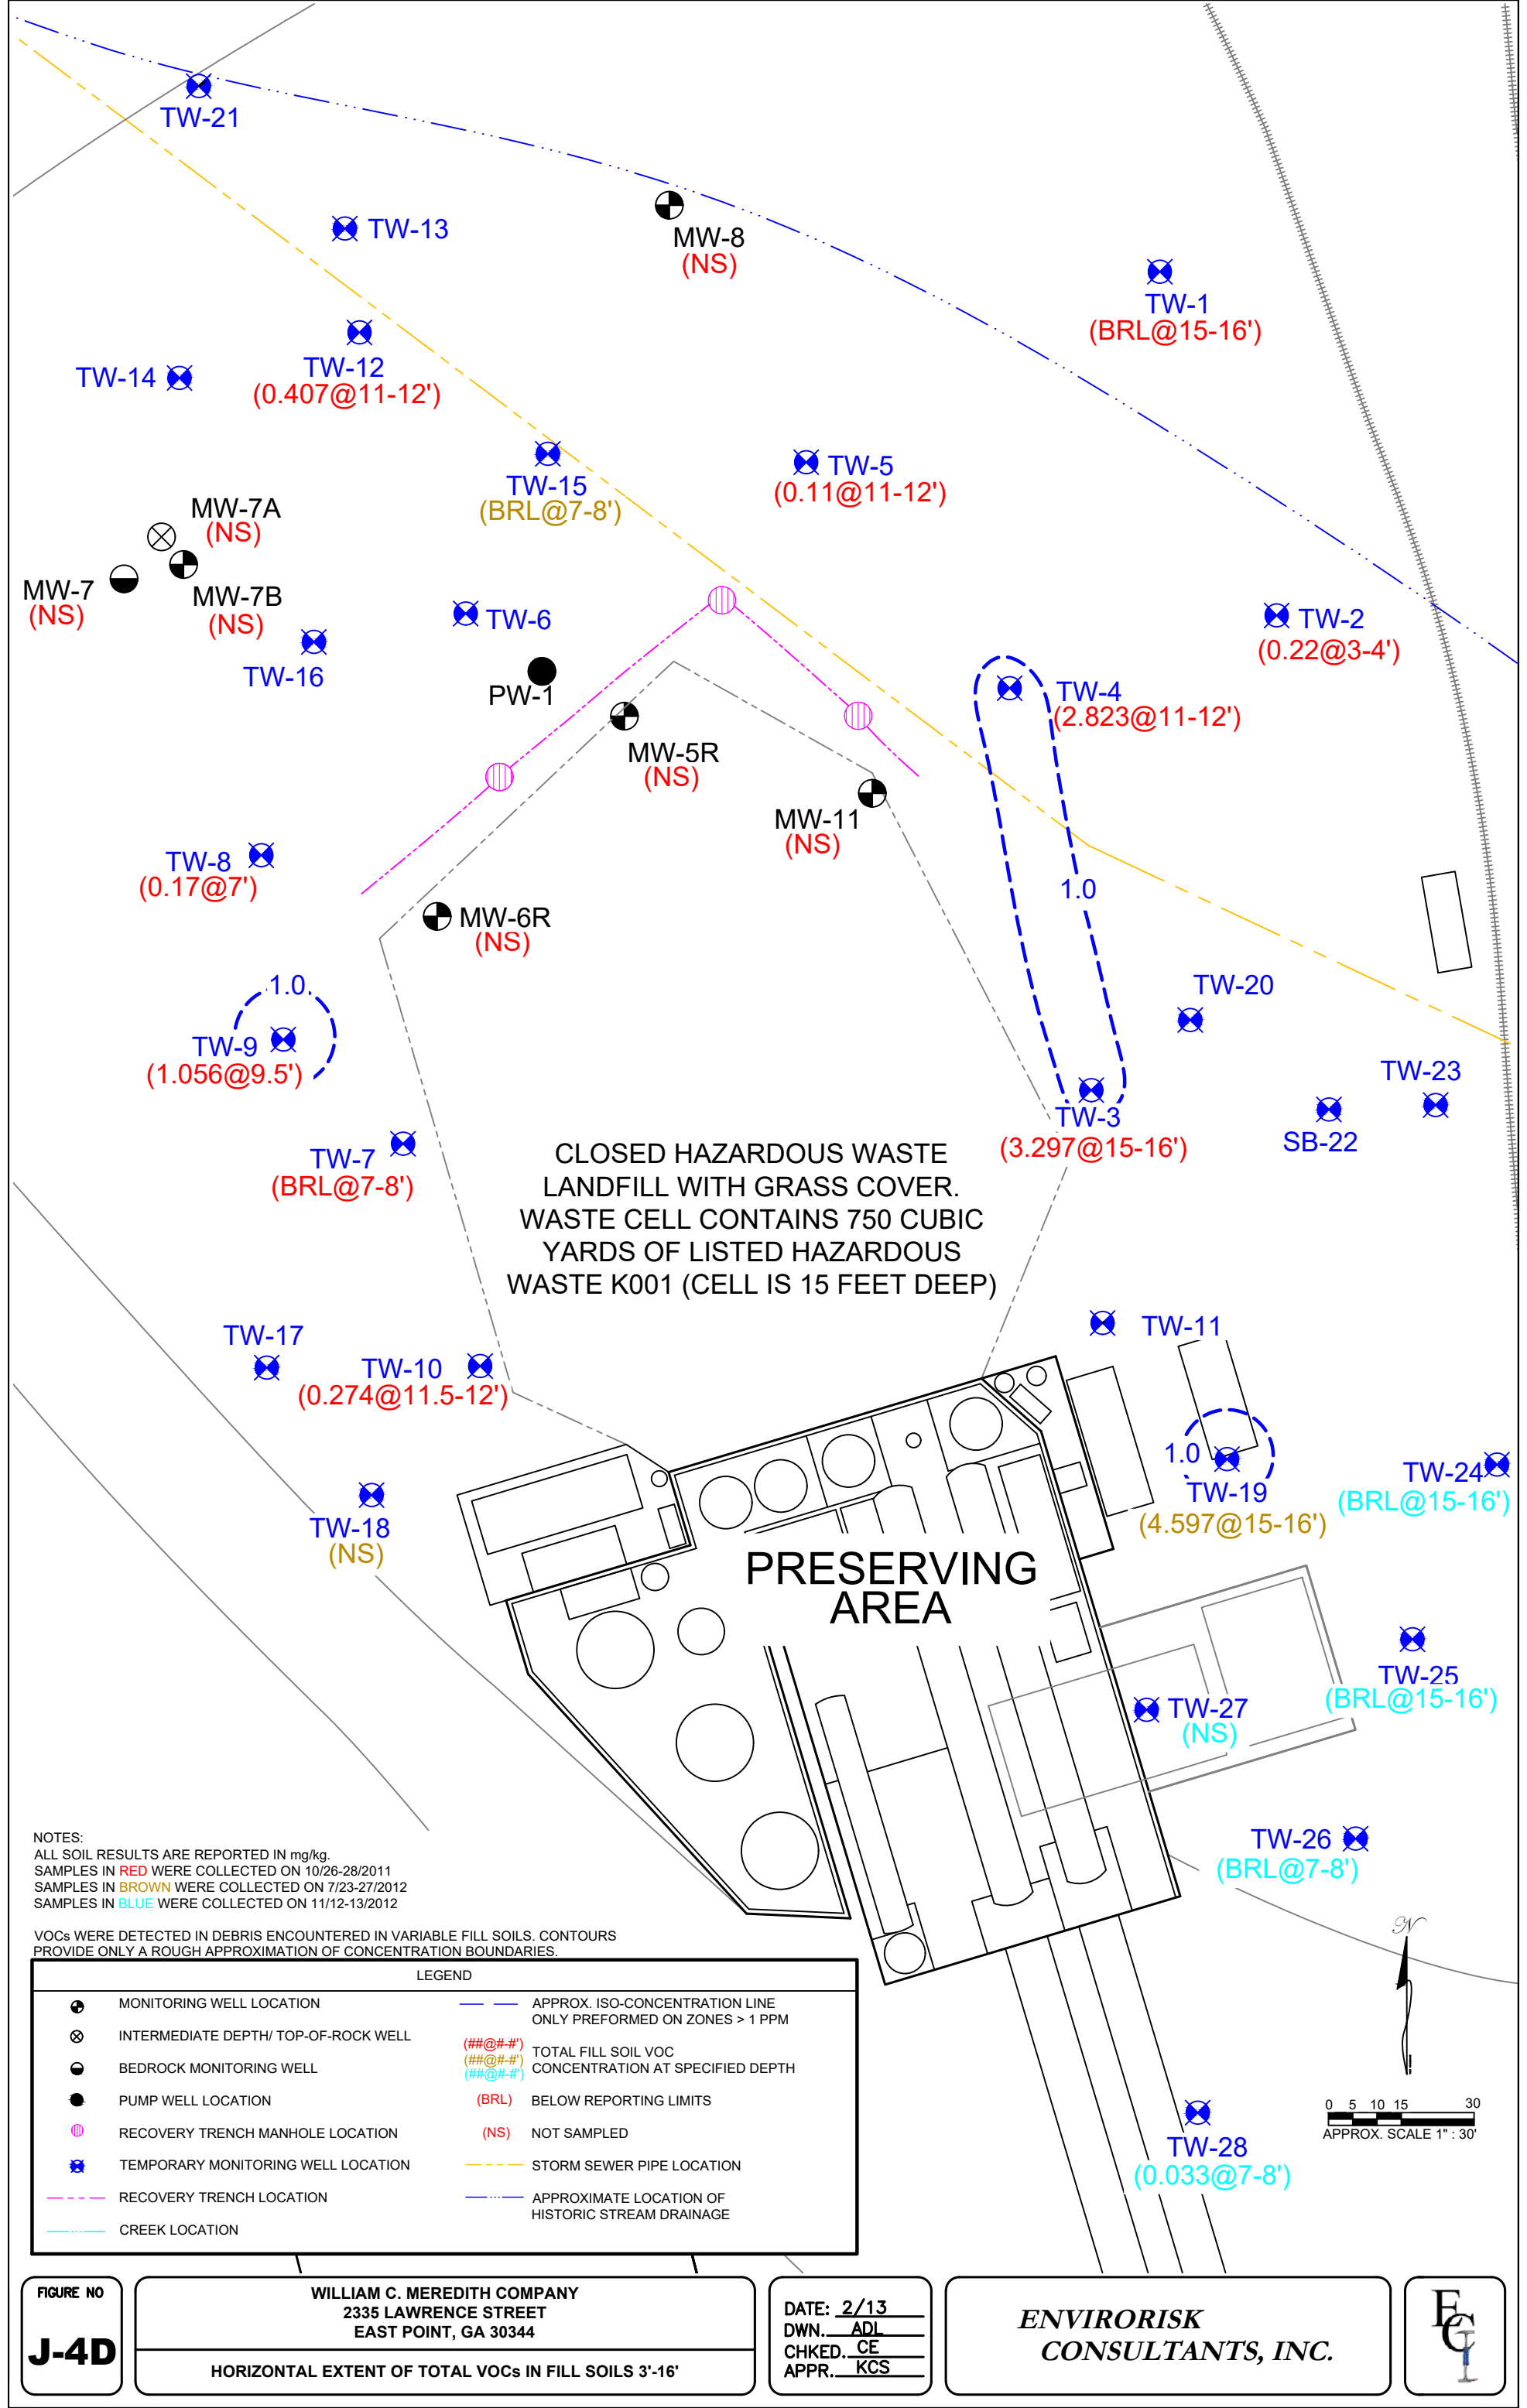

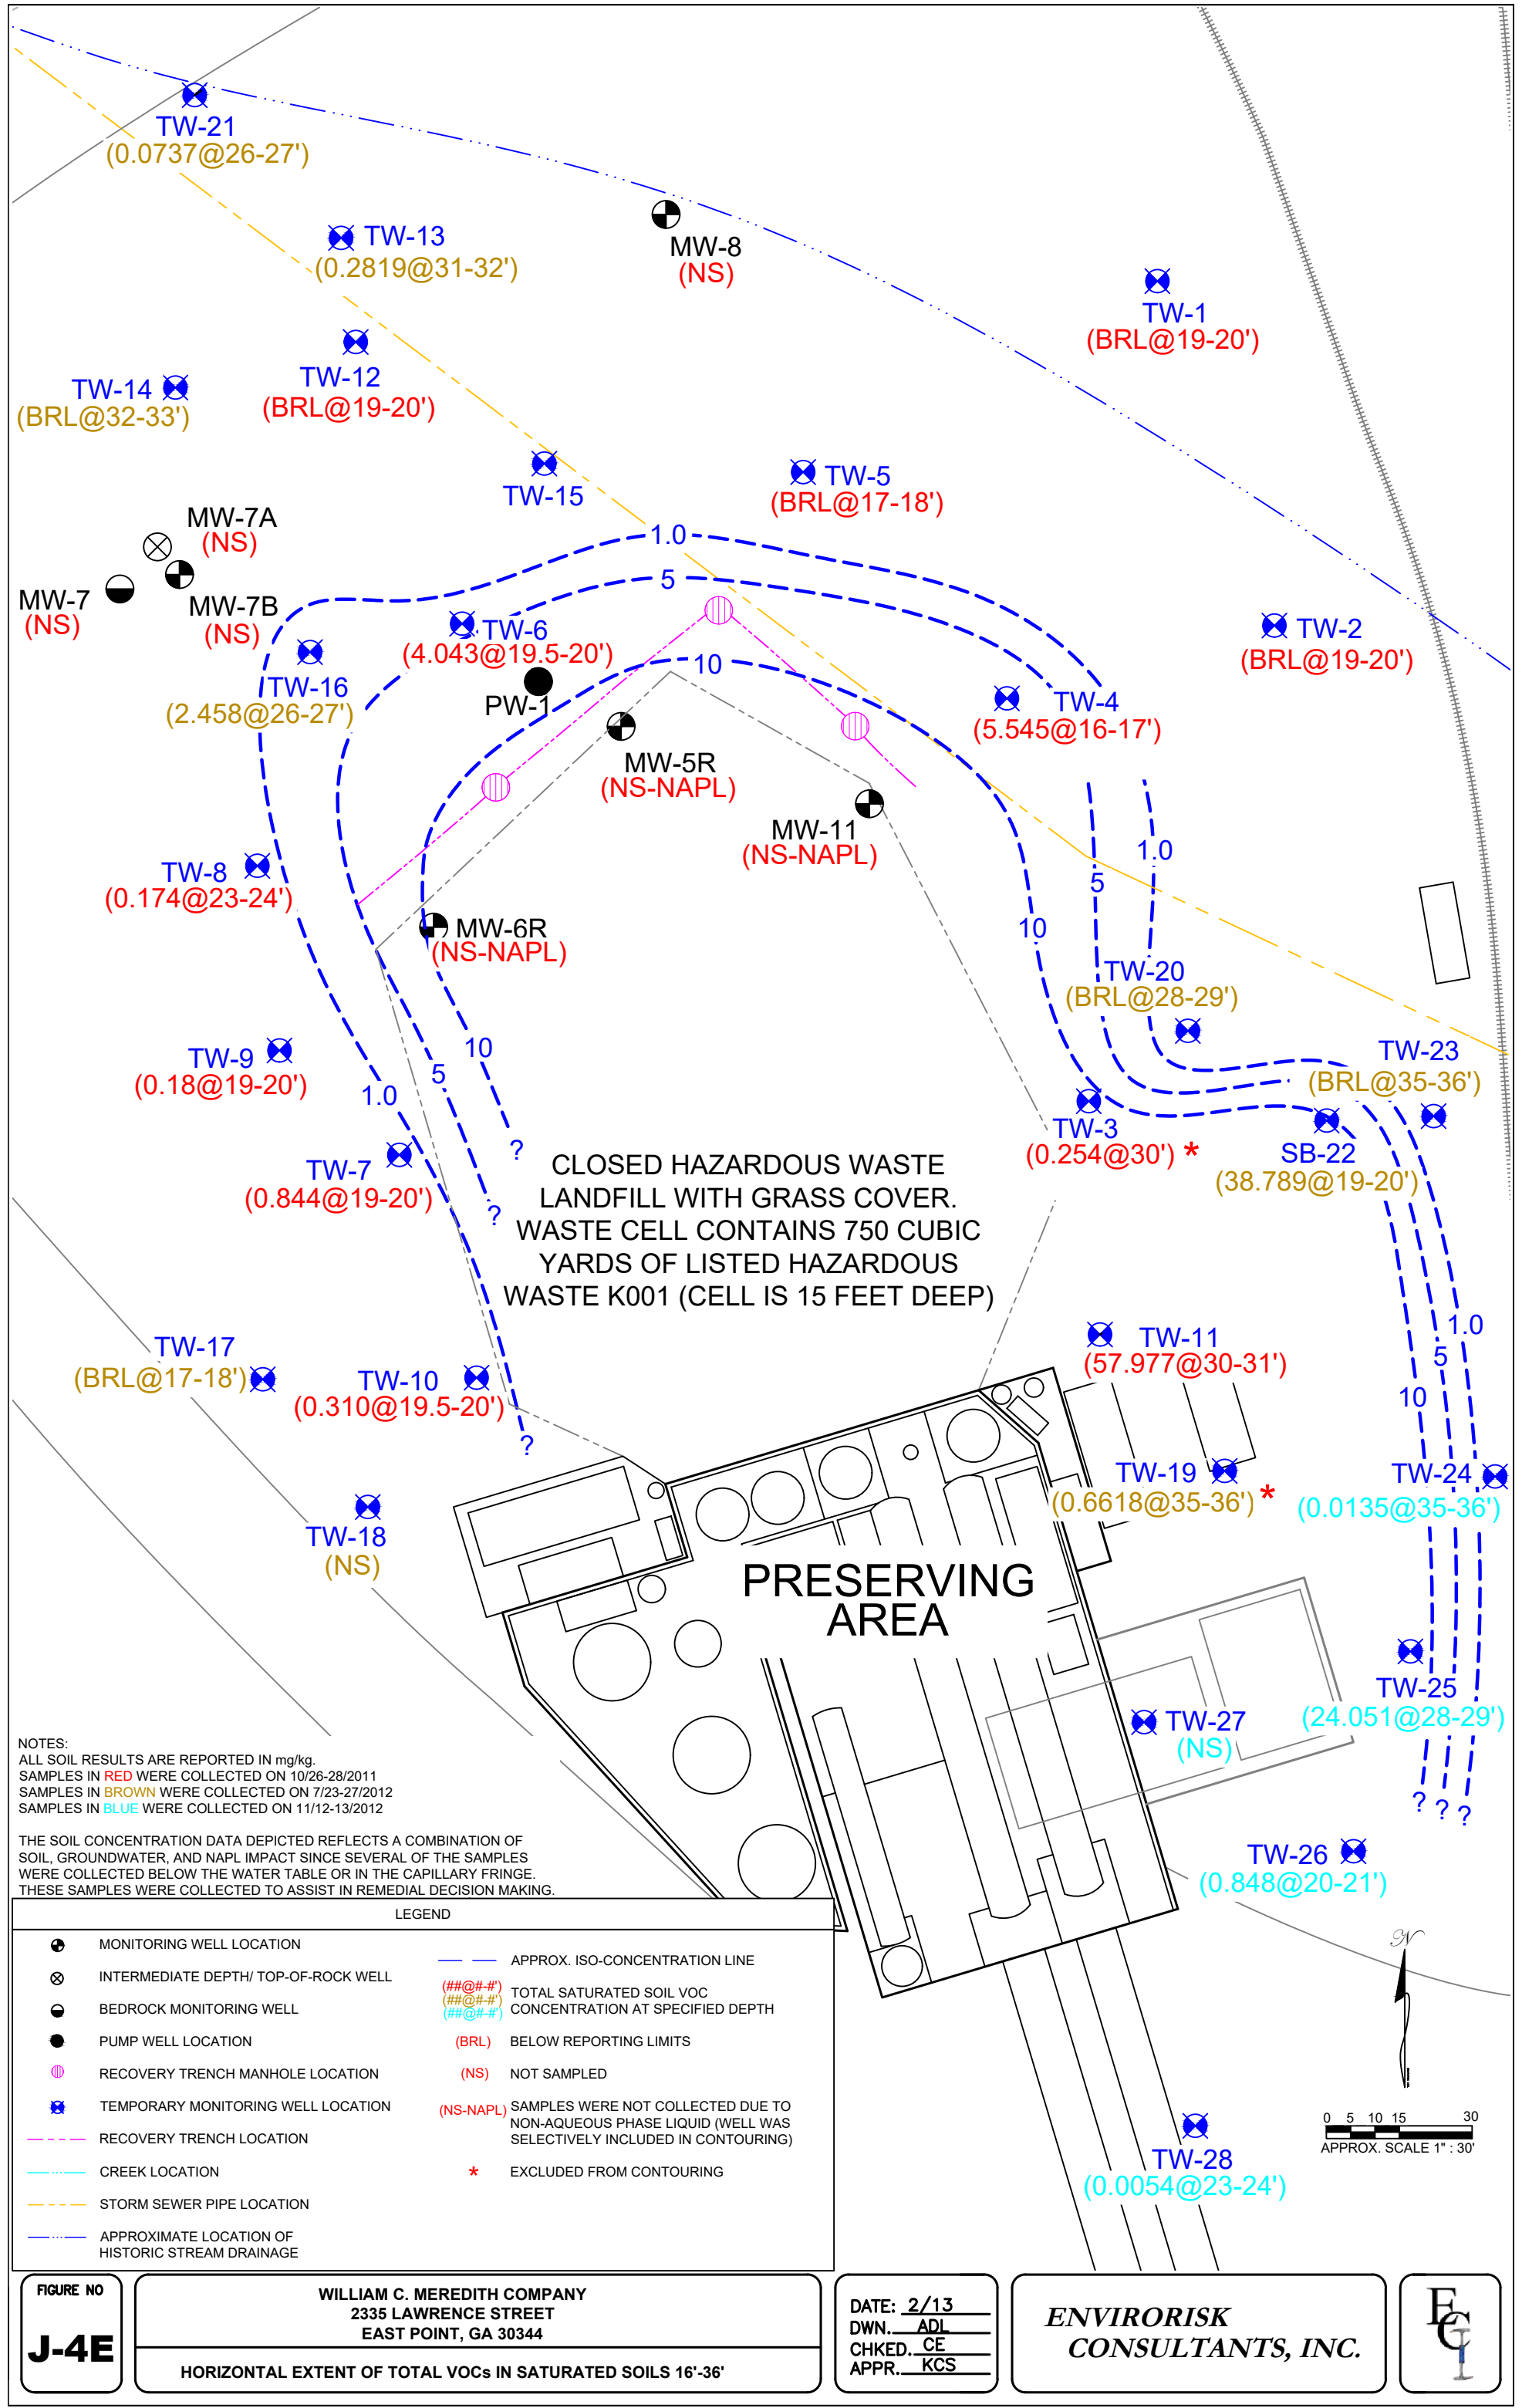

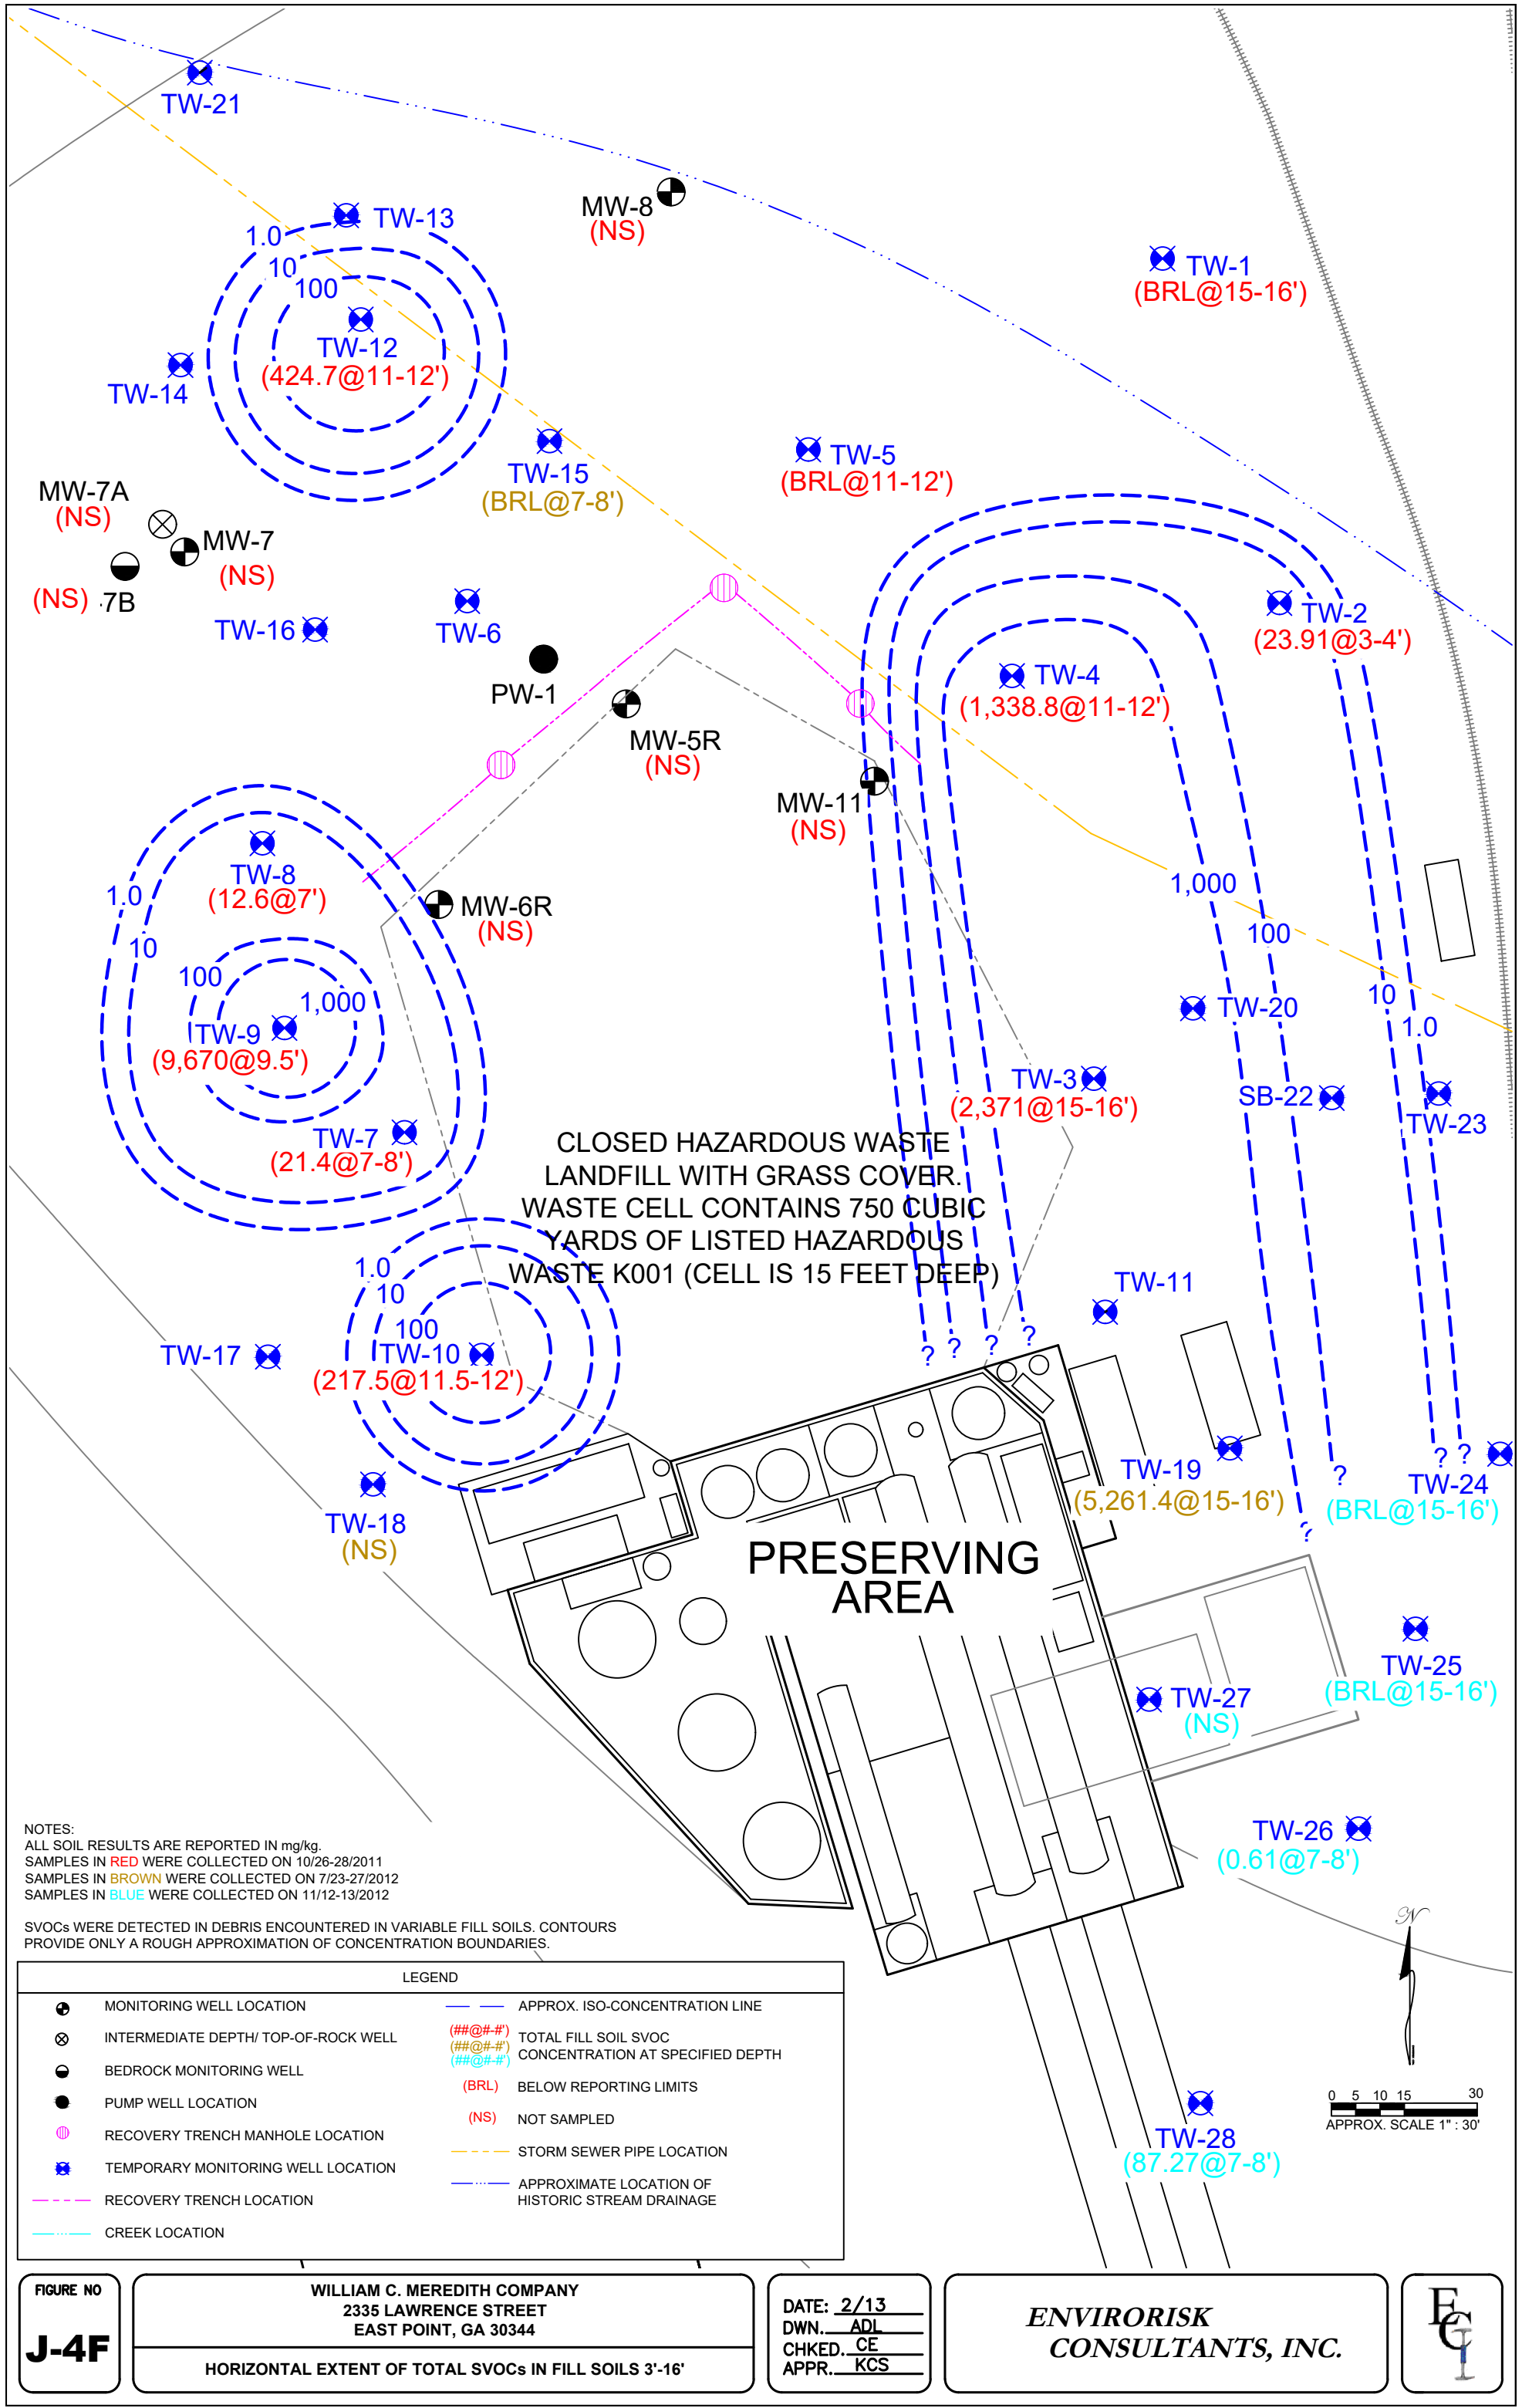

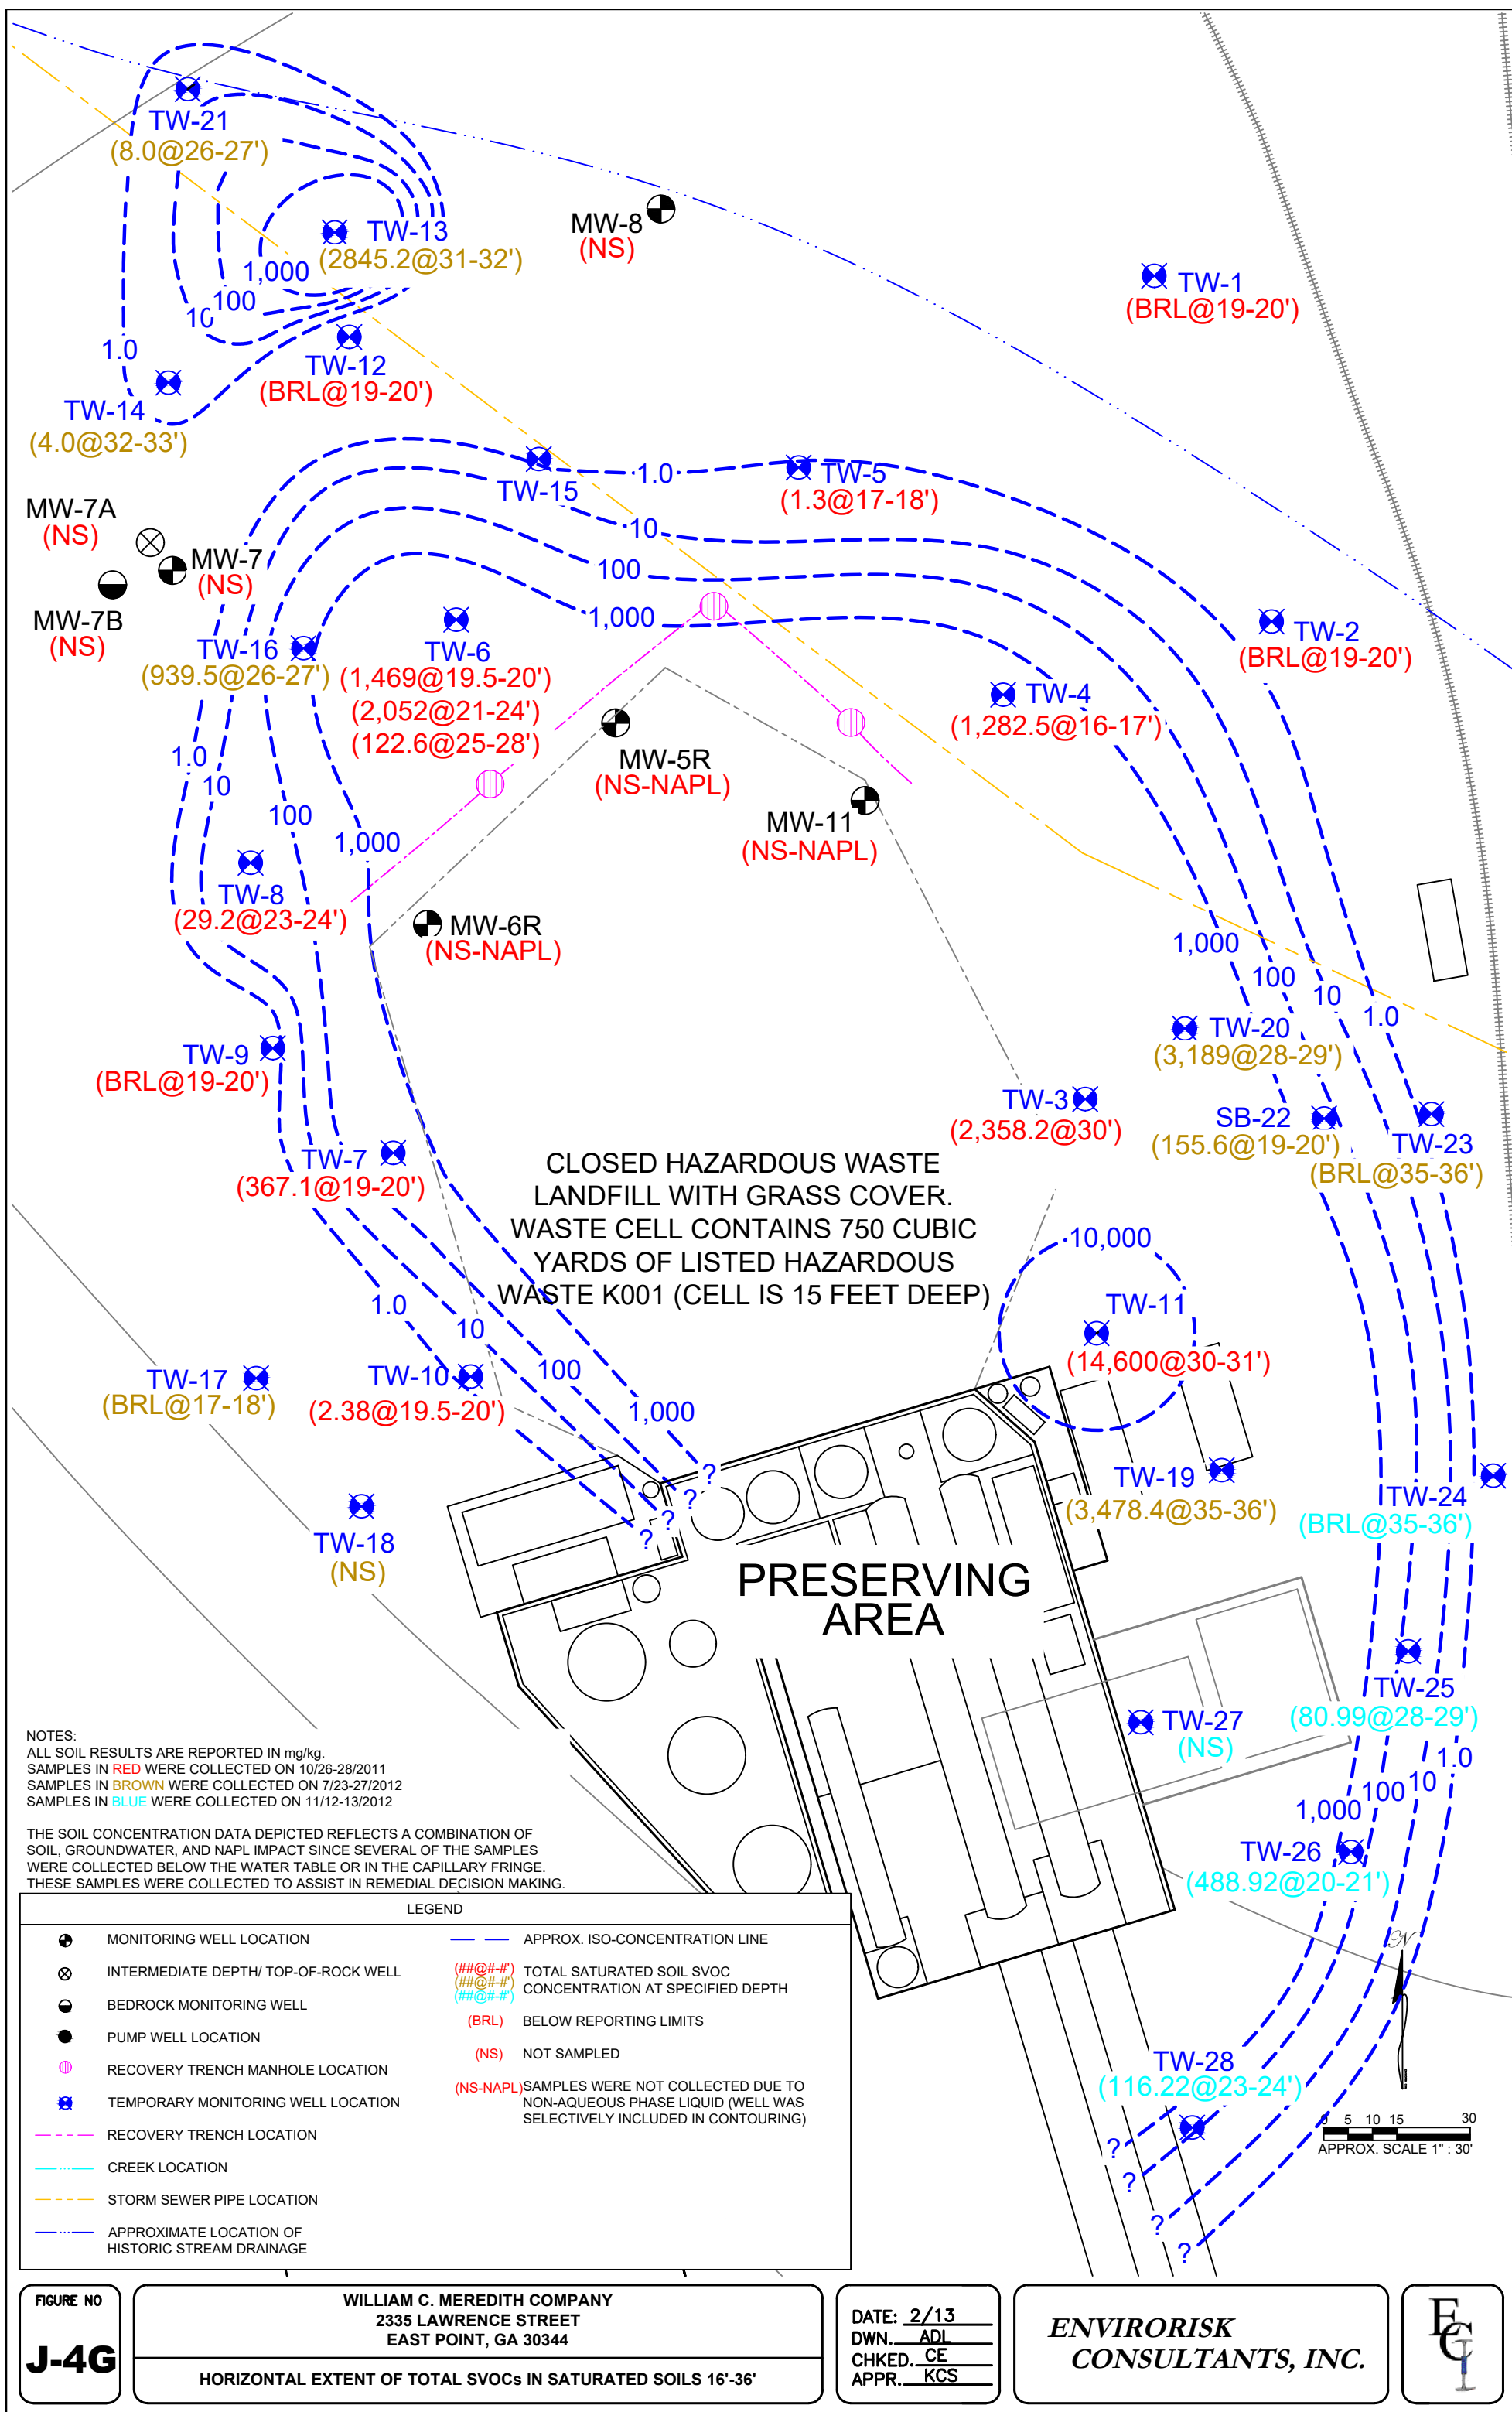

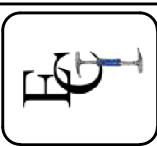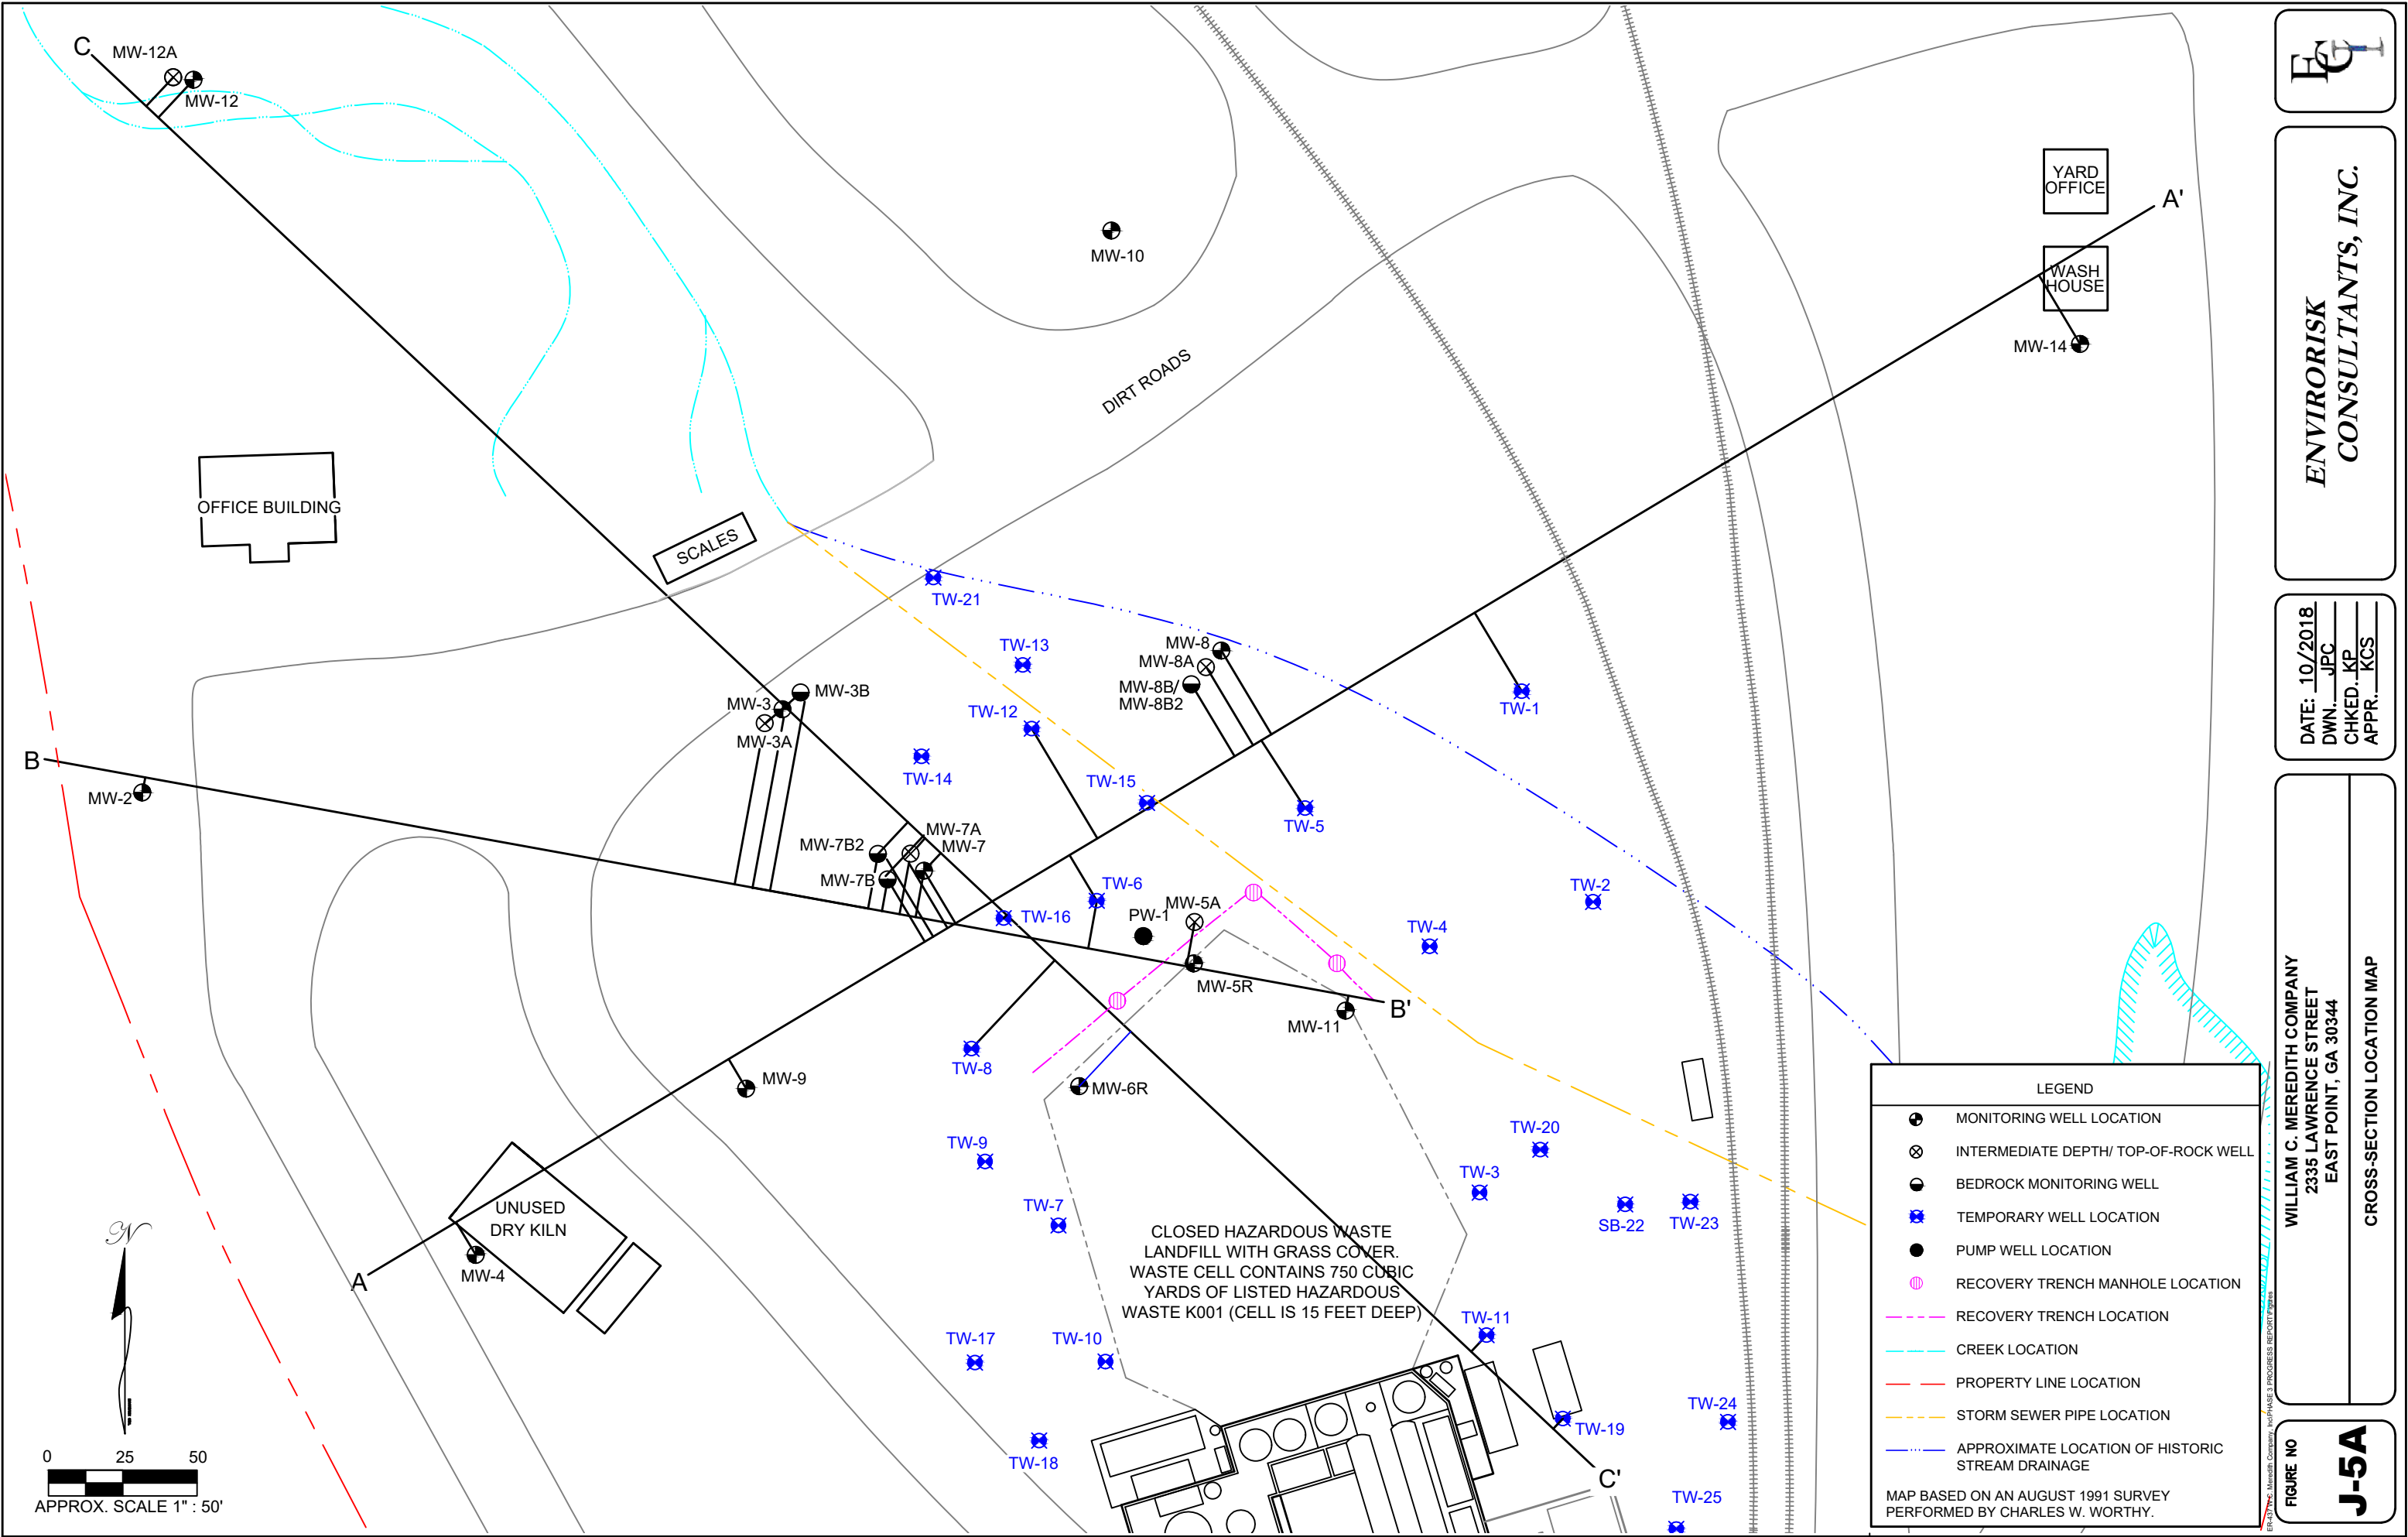

**ENVIORISK
CONSULTANTS, INC.**

DATE: 10/2018
DWN: JPC
CHKD: KP
APPR: KCS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

CROSS-SECTION LOCATION MAP

FIGURE NO
J-5A

FILL:
CONSISTS OF A MIXTURE OF GRAVEL, SAND, SILTY-SAND, CLAY,
AND VARIOUS DEBRIS.

RESIDUUM SOILS:
CONSISTS OF MICACEOUS SANDY-CLAYS, SILTY-SANDS,
CLAYEY-SANDS, WITH EVIDENCE OF RELICT FOLIATION
INDICATIVE OF GNEISS OR SCHIST BEDROCK WITH DEPTH.

PARTIALLY WEATHERED ROCK (PWR):
CHARACTERIZED AS DENSER SOIL/ SAPROLITE (HIGH BLOW
COUNT MATERIAL) CLASSIFIED AS WEATHERED MICACEOUS
GRANITIC GNEISS, MICA SCHISTS, BIOTITE SCHISTS/ GNEISS,
HORNBLende GNEISS/ SCHISTS.

FRACTURED BEDROCK:
COMPETENT BEDROCK - HARD BIOTITE GNEISS, GRANITIC GNEISS,
AND AMPHIBOLITE GNEISS WITH POTASSIUM FELDSPAR, AND
QUARTZ AUGENS AND LENSES OF MICA, PYRITE AND MUSCOVITE.

APPROXIMATE ELEVATION OF SHALLOW GROUNDWATER
BASED ON 4/5/2023 MEASUREMENTS

FORMATION CONTACT
(DASHED WHERE GRADATIONAL)

TOTAL VOC CONCENTRATION REPORTED IN ug/L
• TW NAPL MEASUREMENTS WERE TAKEN ON 7/2012
• ALL OTHER SAMPLES WERE COLLECTED 4/5-6/2023

NOT SAMPLED

NON-AQUEOUS PHASE LIQUID (ASSUME >1,000 FOR
CONTOURING)


BELOW REPORTING LIMIT

TOTAL SVOC ISO-CONCENTRATION LINES

APPROX. LOCATION OF WOOD DEBRIS FOUND IN SOIL BORING
(SEE BORING LOGS FOR SPECIFIC LOCATIONS AND THICKNESS)

APPROX. LOCATION OF NAPL FOUND IN SOIL BORING
(SEE BORING LOGS FOR SPECIFIC LOCATIONS AND THICKNESS)

NOTE:
THE EXTENT OF NAPL SURROUNDING WELLS IS UNKNOWN, BUT HAS BEEN ESTIMATED BASED
ON BORING LOG DESCRIPTIONS. IN ADDITION, VOC CONCENTRATIONS IN THE NAPL FRACTION
ARE UNKNOWN. CONTOURING WAS DONE FOR THE DISSOLVED PHASE ONLY BASED ON PRIOR
POC SAMPLING DATA.

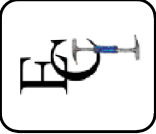


ENVIORISK
CONSULTANTS, INC.


DATE: 5/2023
DWN: JPC
CHKD: KP
APPR: KCS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

VERTICAL EXTENT OF SVOCs (B-B')


FIGURE NO
J-5C

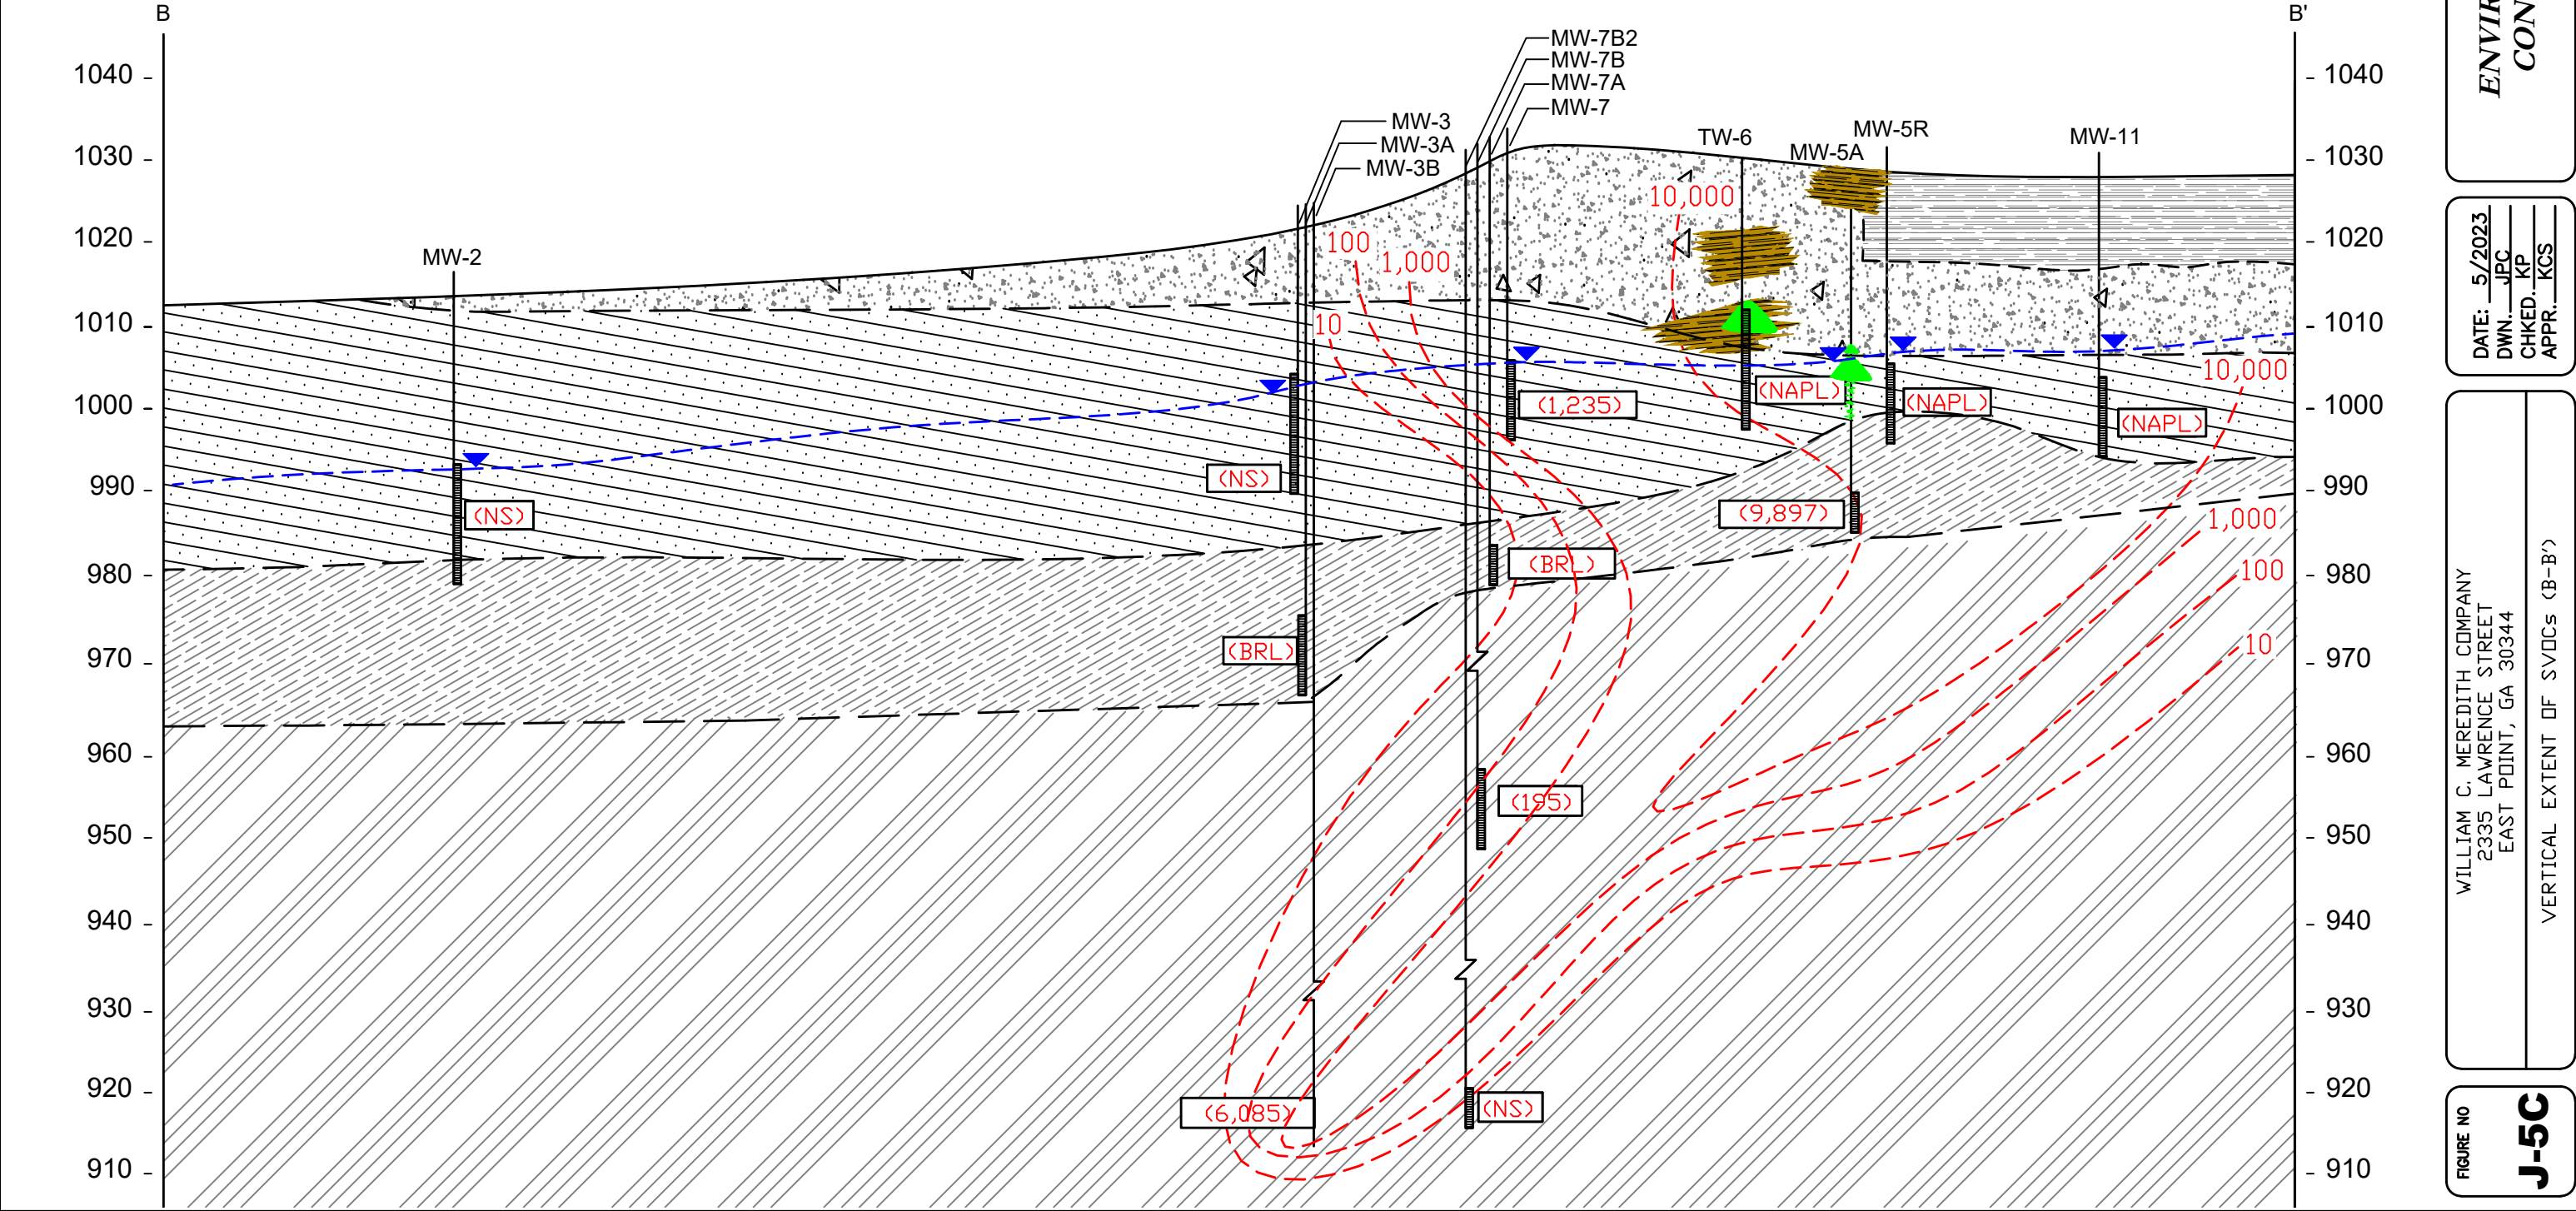

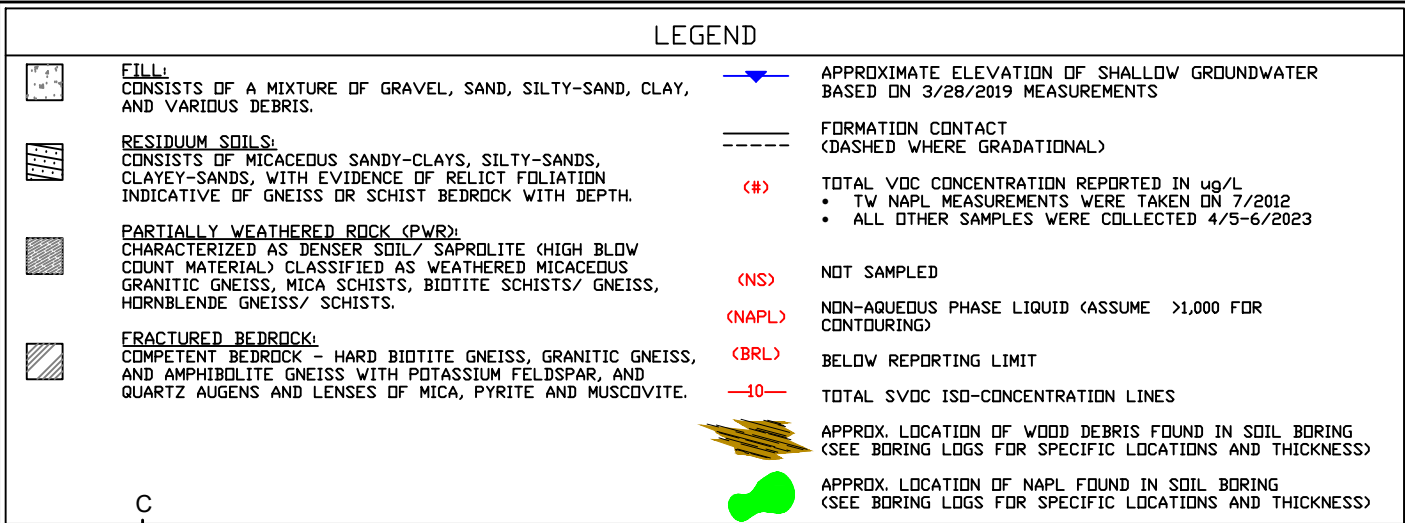

NOTE:
THE EXTENT OF NAPL SURROUNDING WELLS IS UNKNOWN, BUT HAS BEEN ESTIMATED BASED
ON BORING LOG DESCRIPTIONS. IN ADDITION, VOC CONCENTRATIONS IN THE NAPL FRACTION
ARE UNKNOWN. CONTOURING WAS DONE FOR THE DISSOLVED PHASE ONLY BASED ON PRIOR
POC SAMPLING DATA.

APPROX. HORIZONTAL SCALE
40 20 0

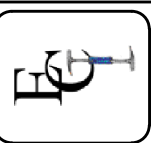

ENVIORISK
CONSULTANTS, INC.


DATE: 5/2023
DWN: JPC
CHKD: KP
APPR: KCS


WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344


VERTICAL EXTENT OF SVDCs (C-C')


FIGURE NO

J-5D

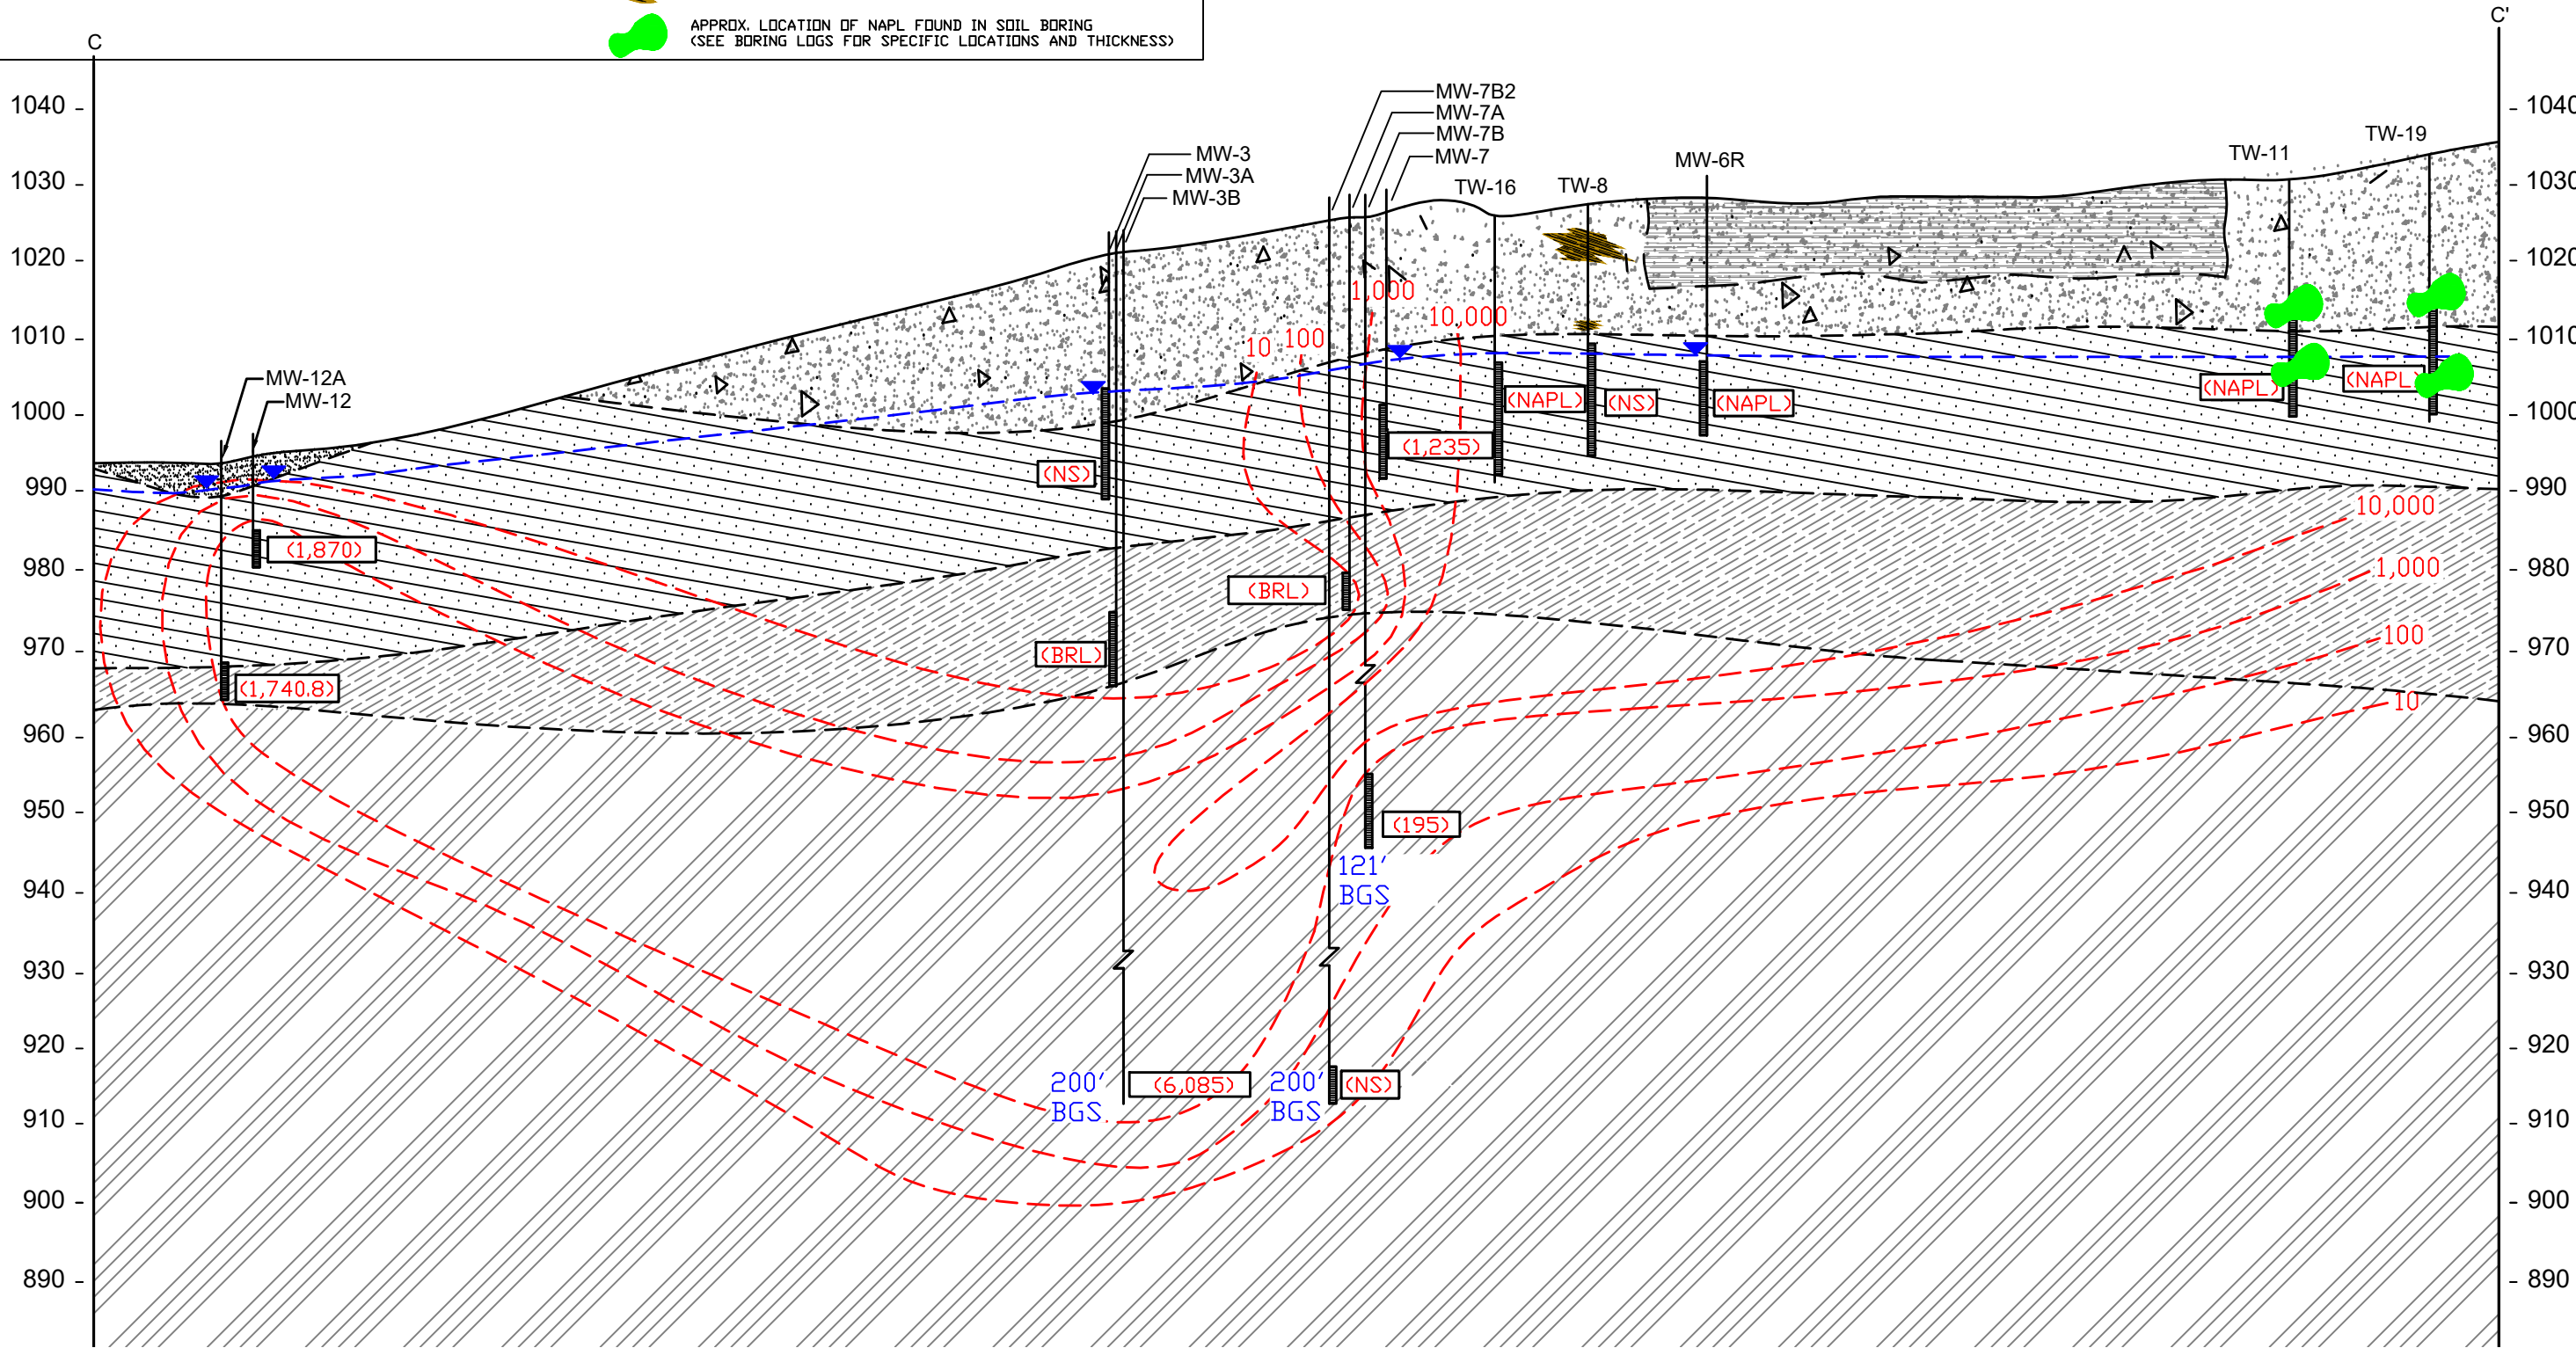

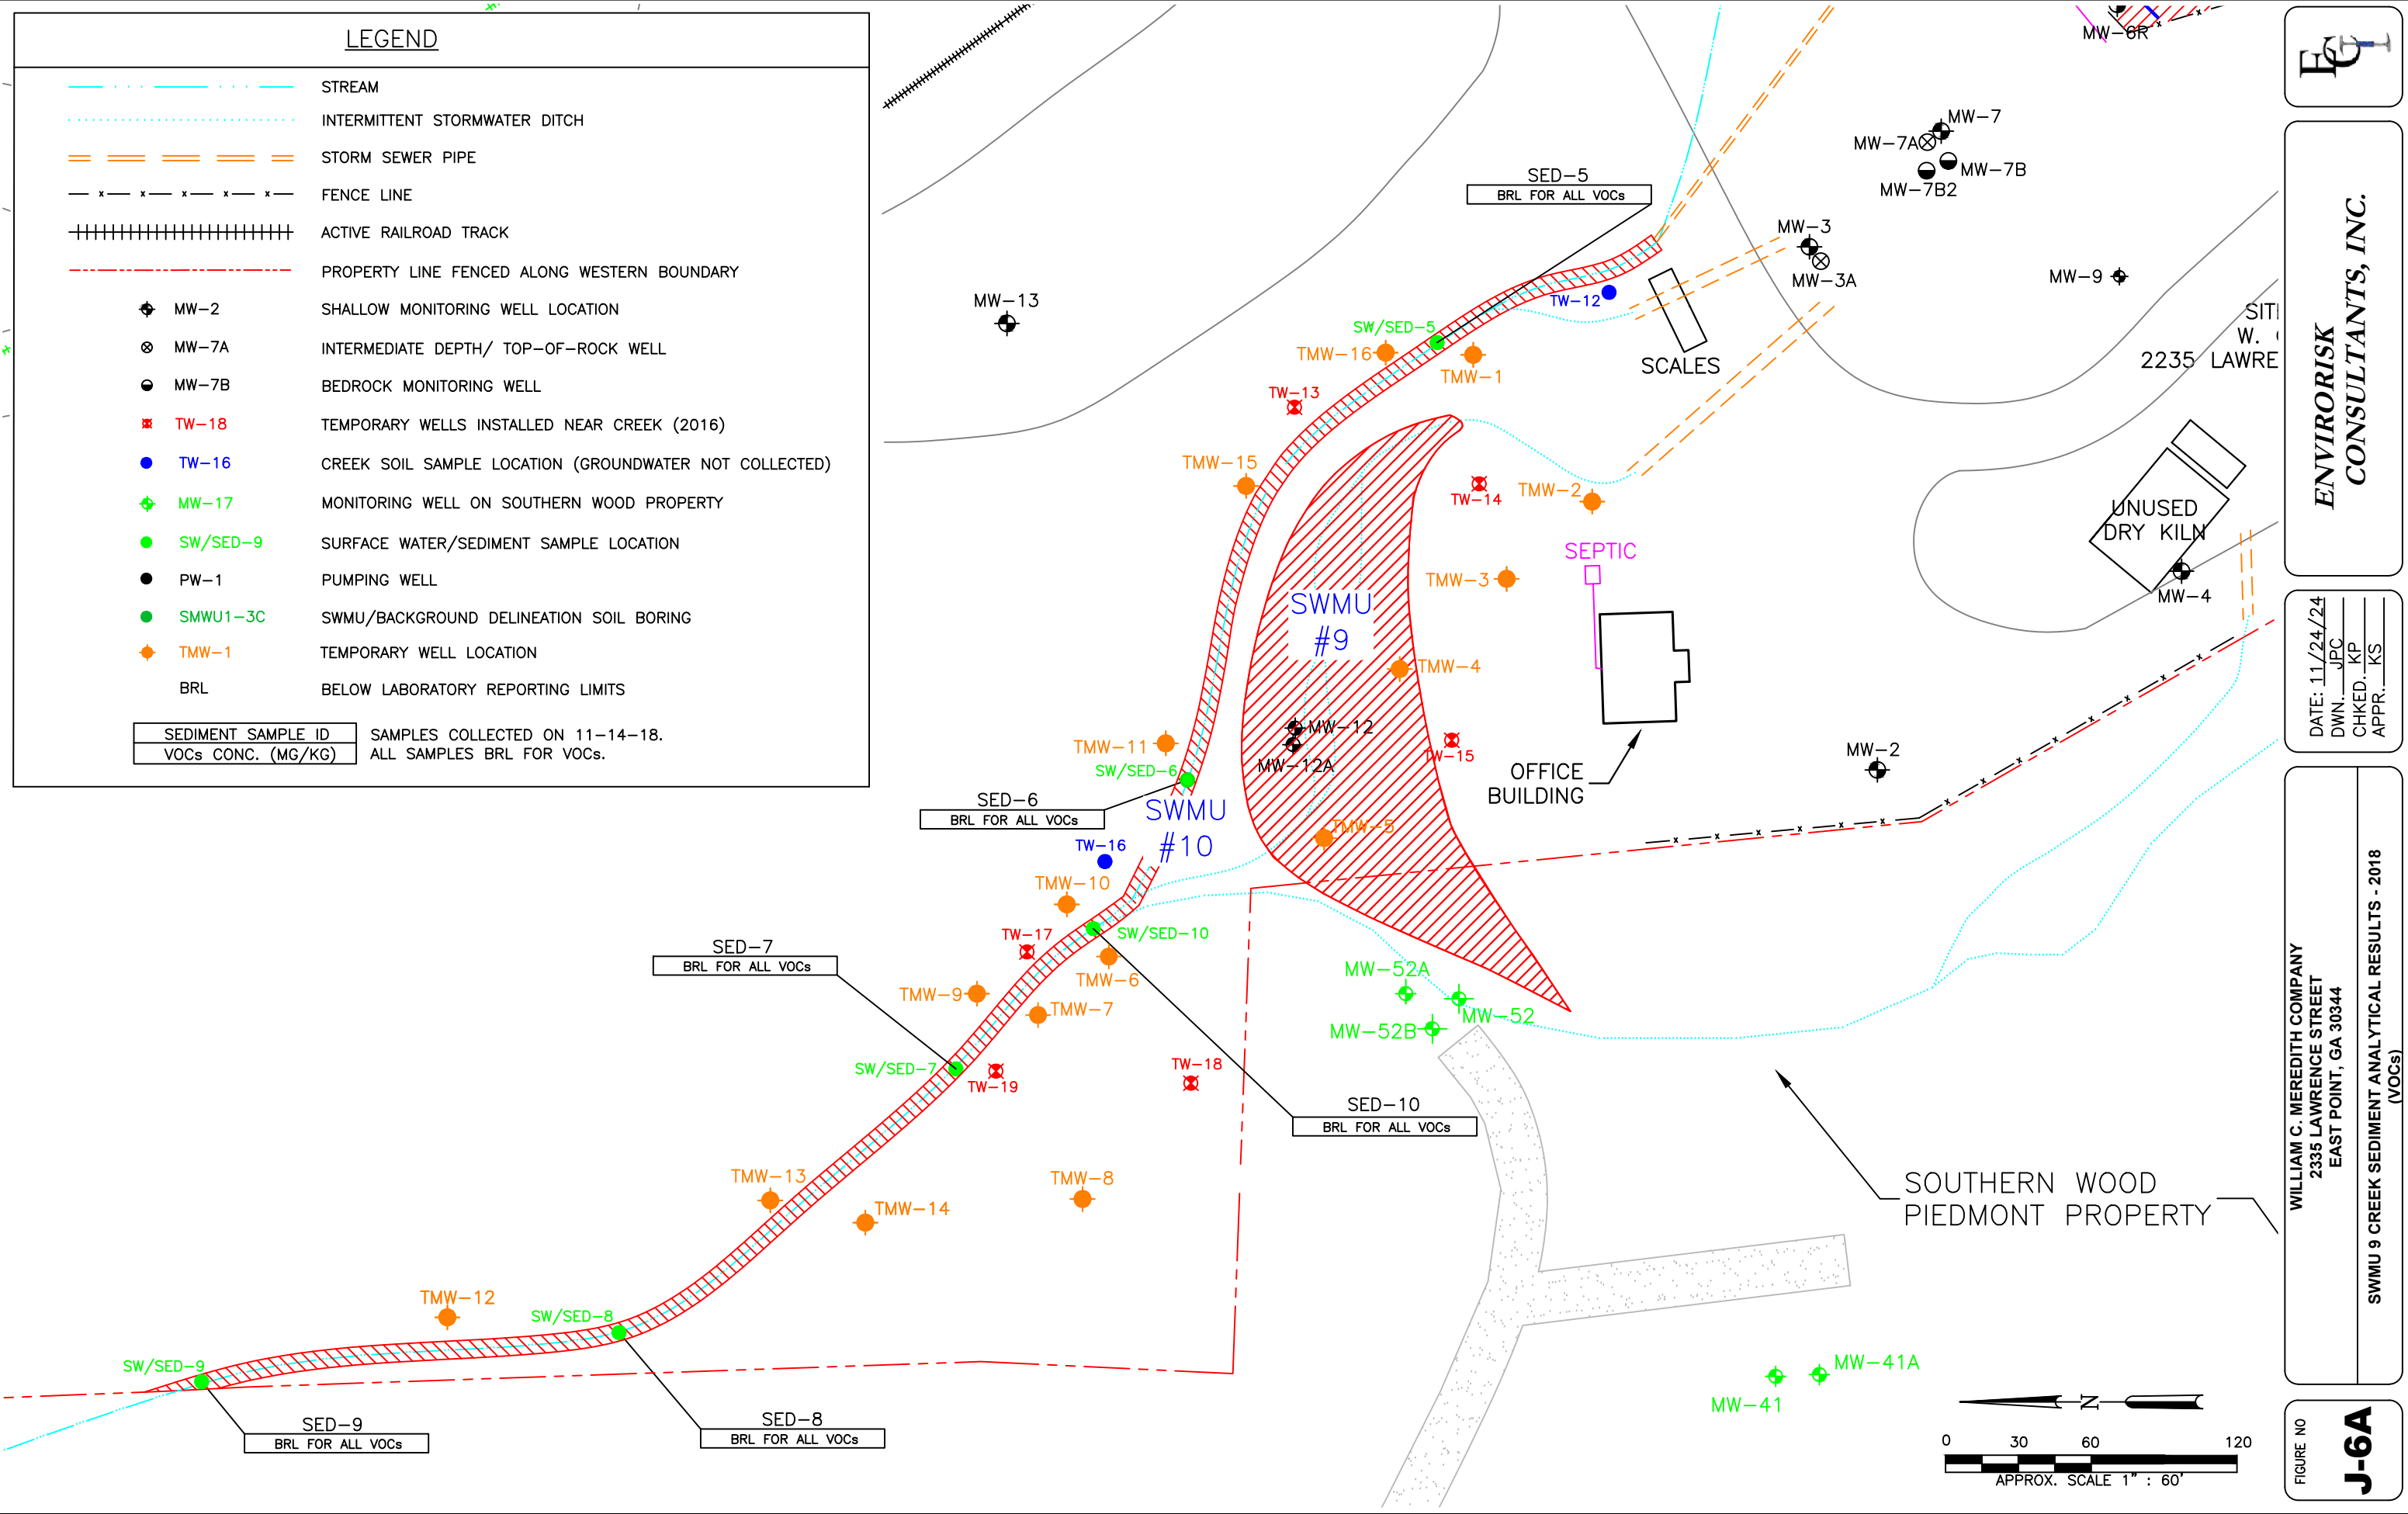

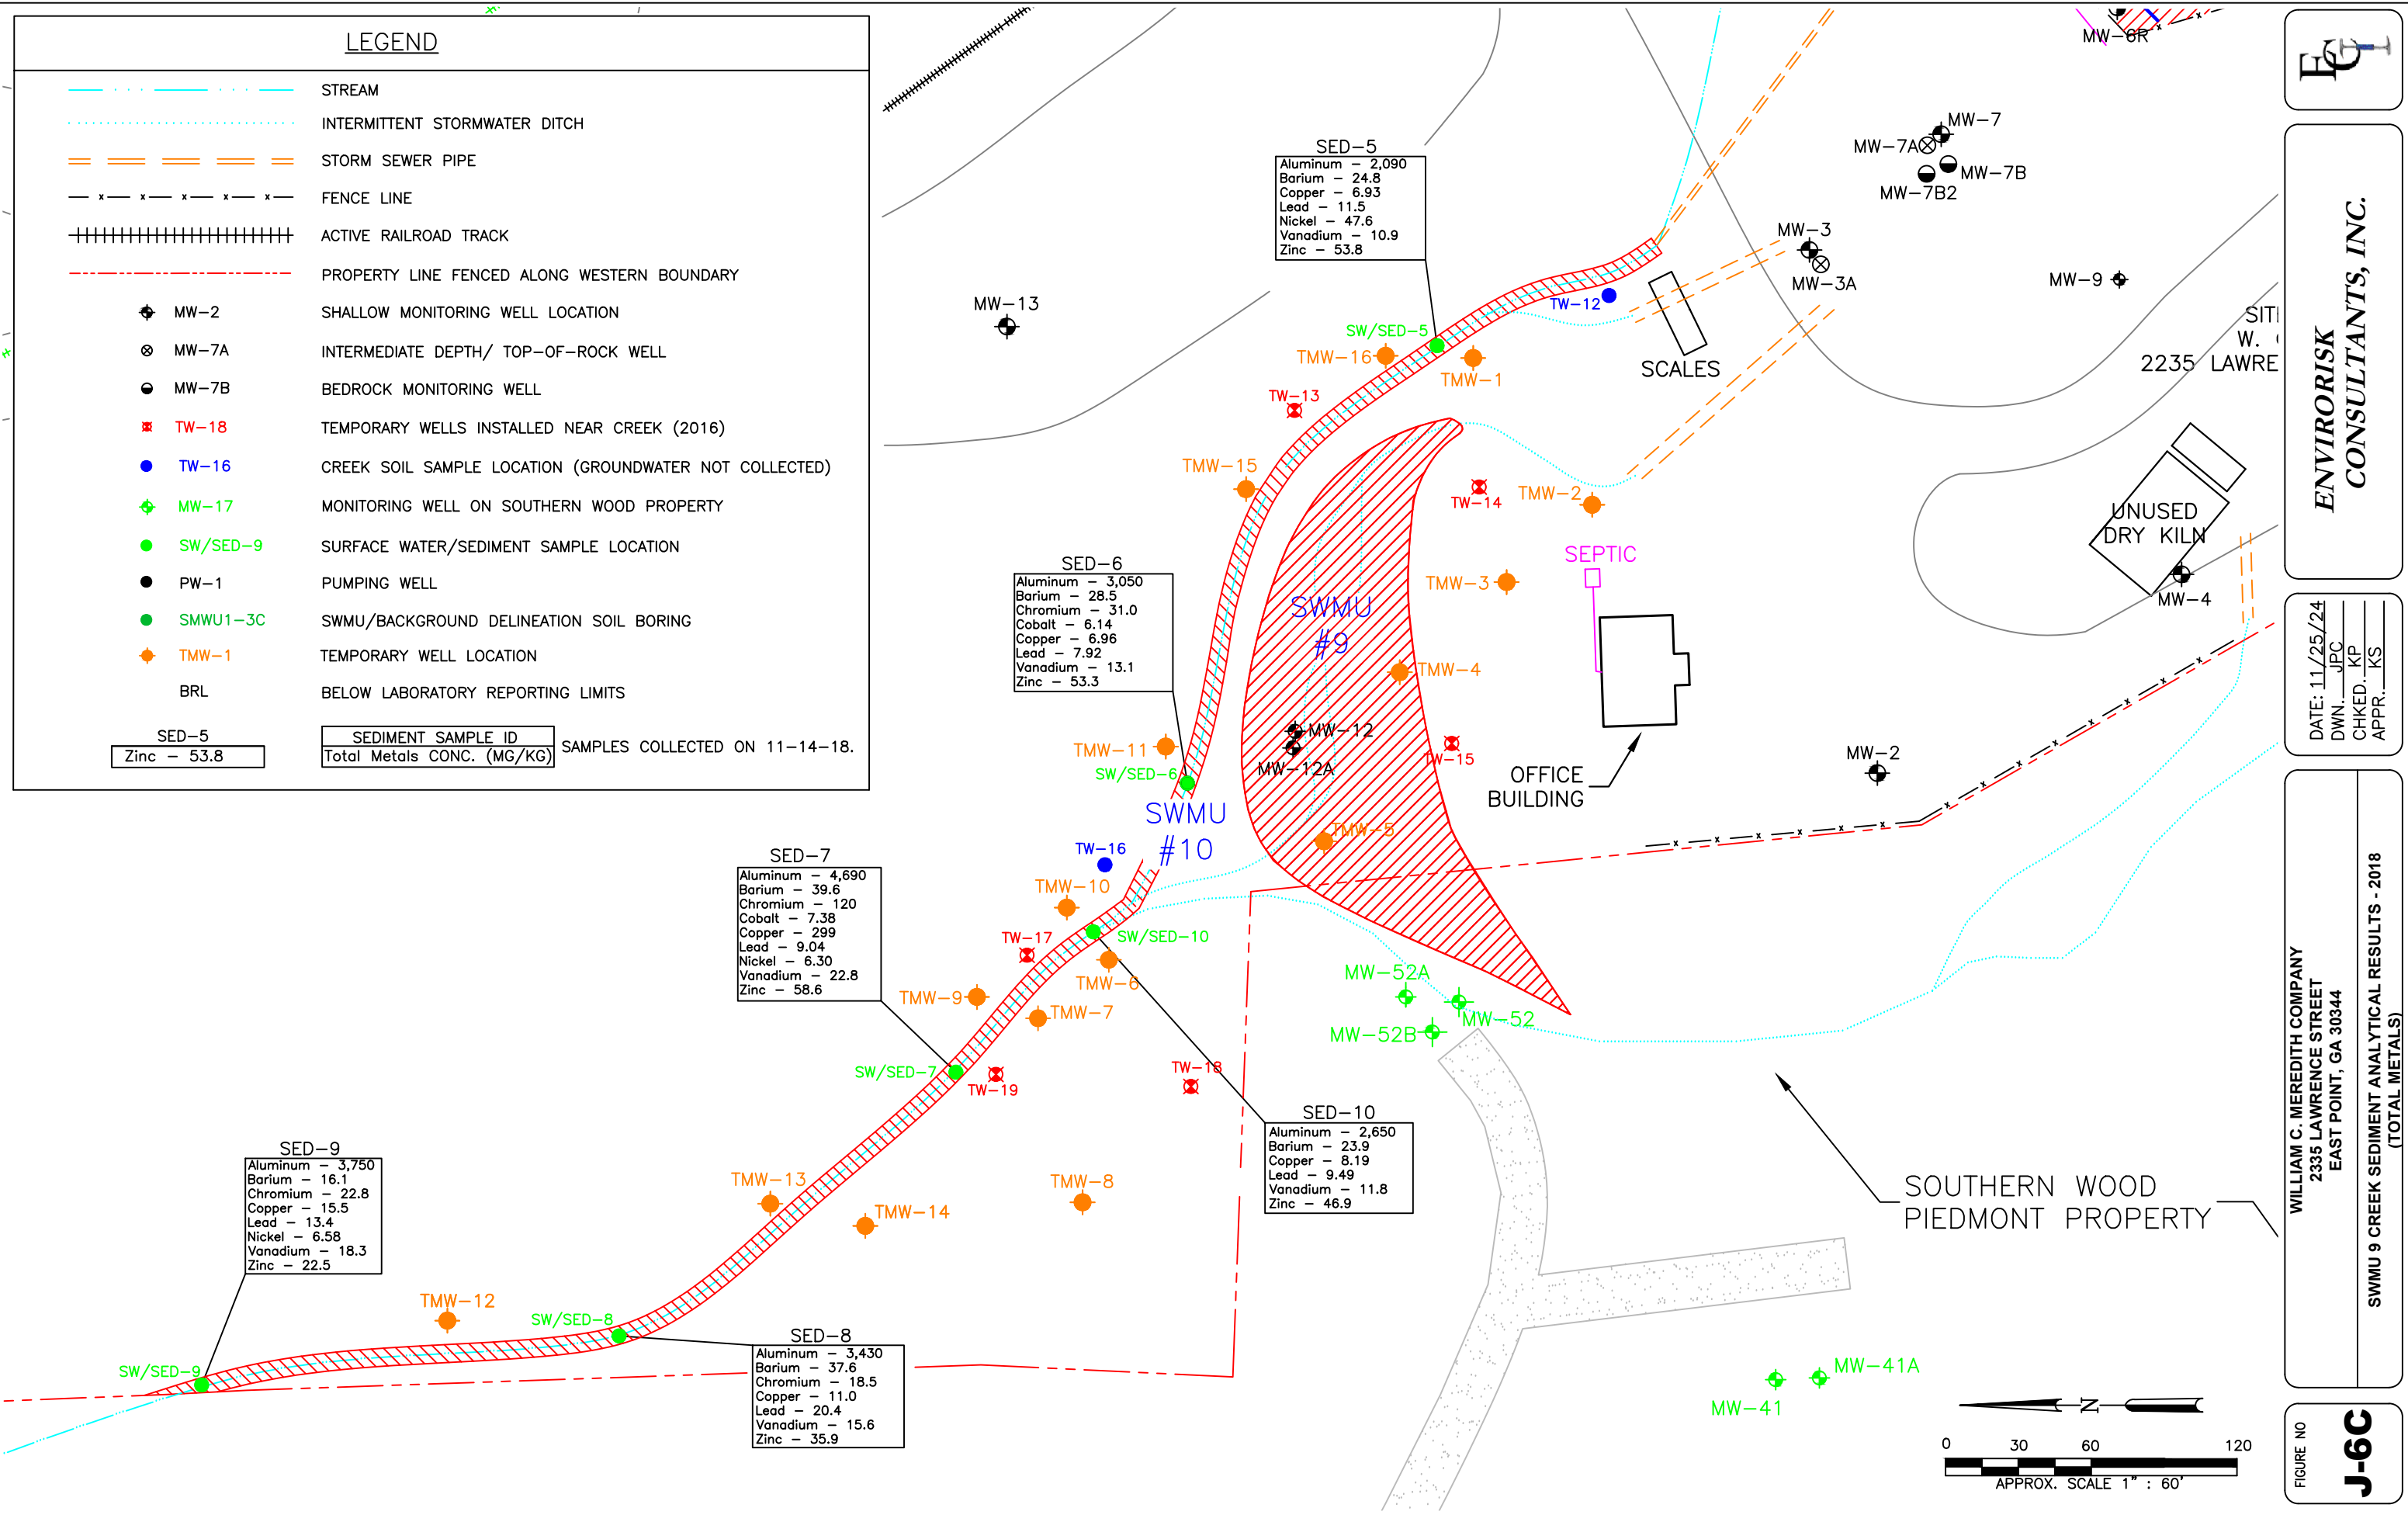

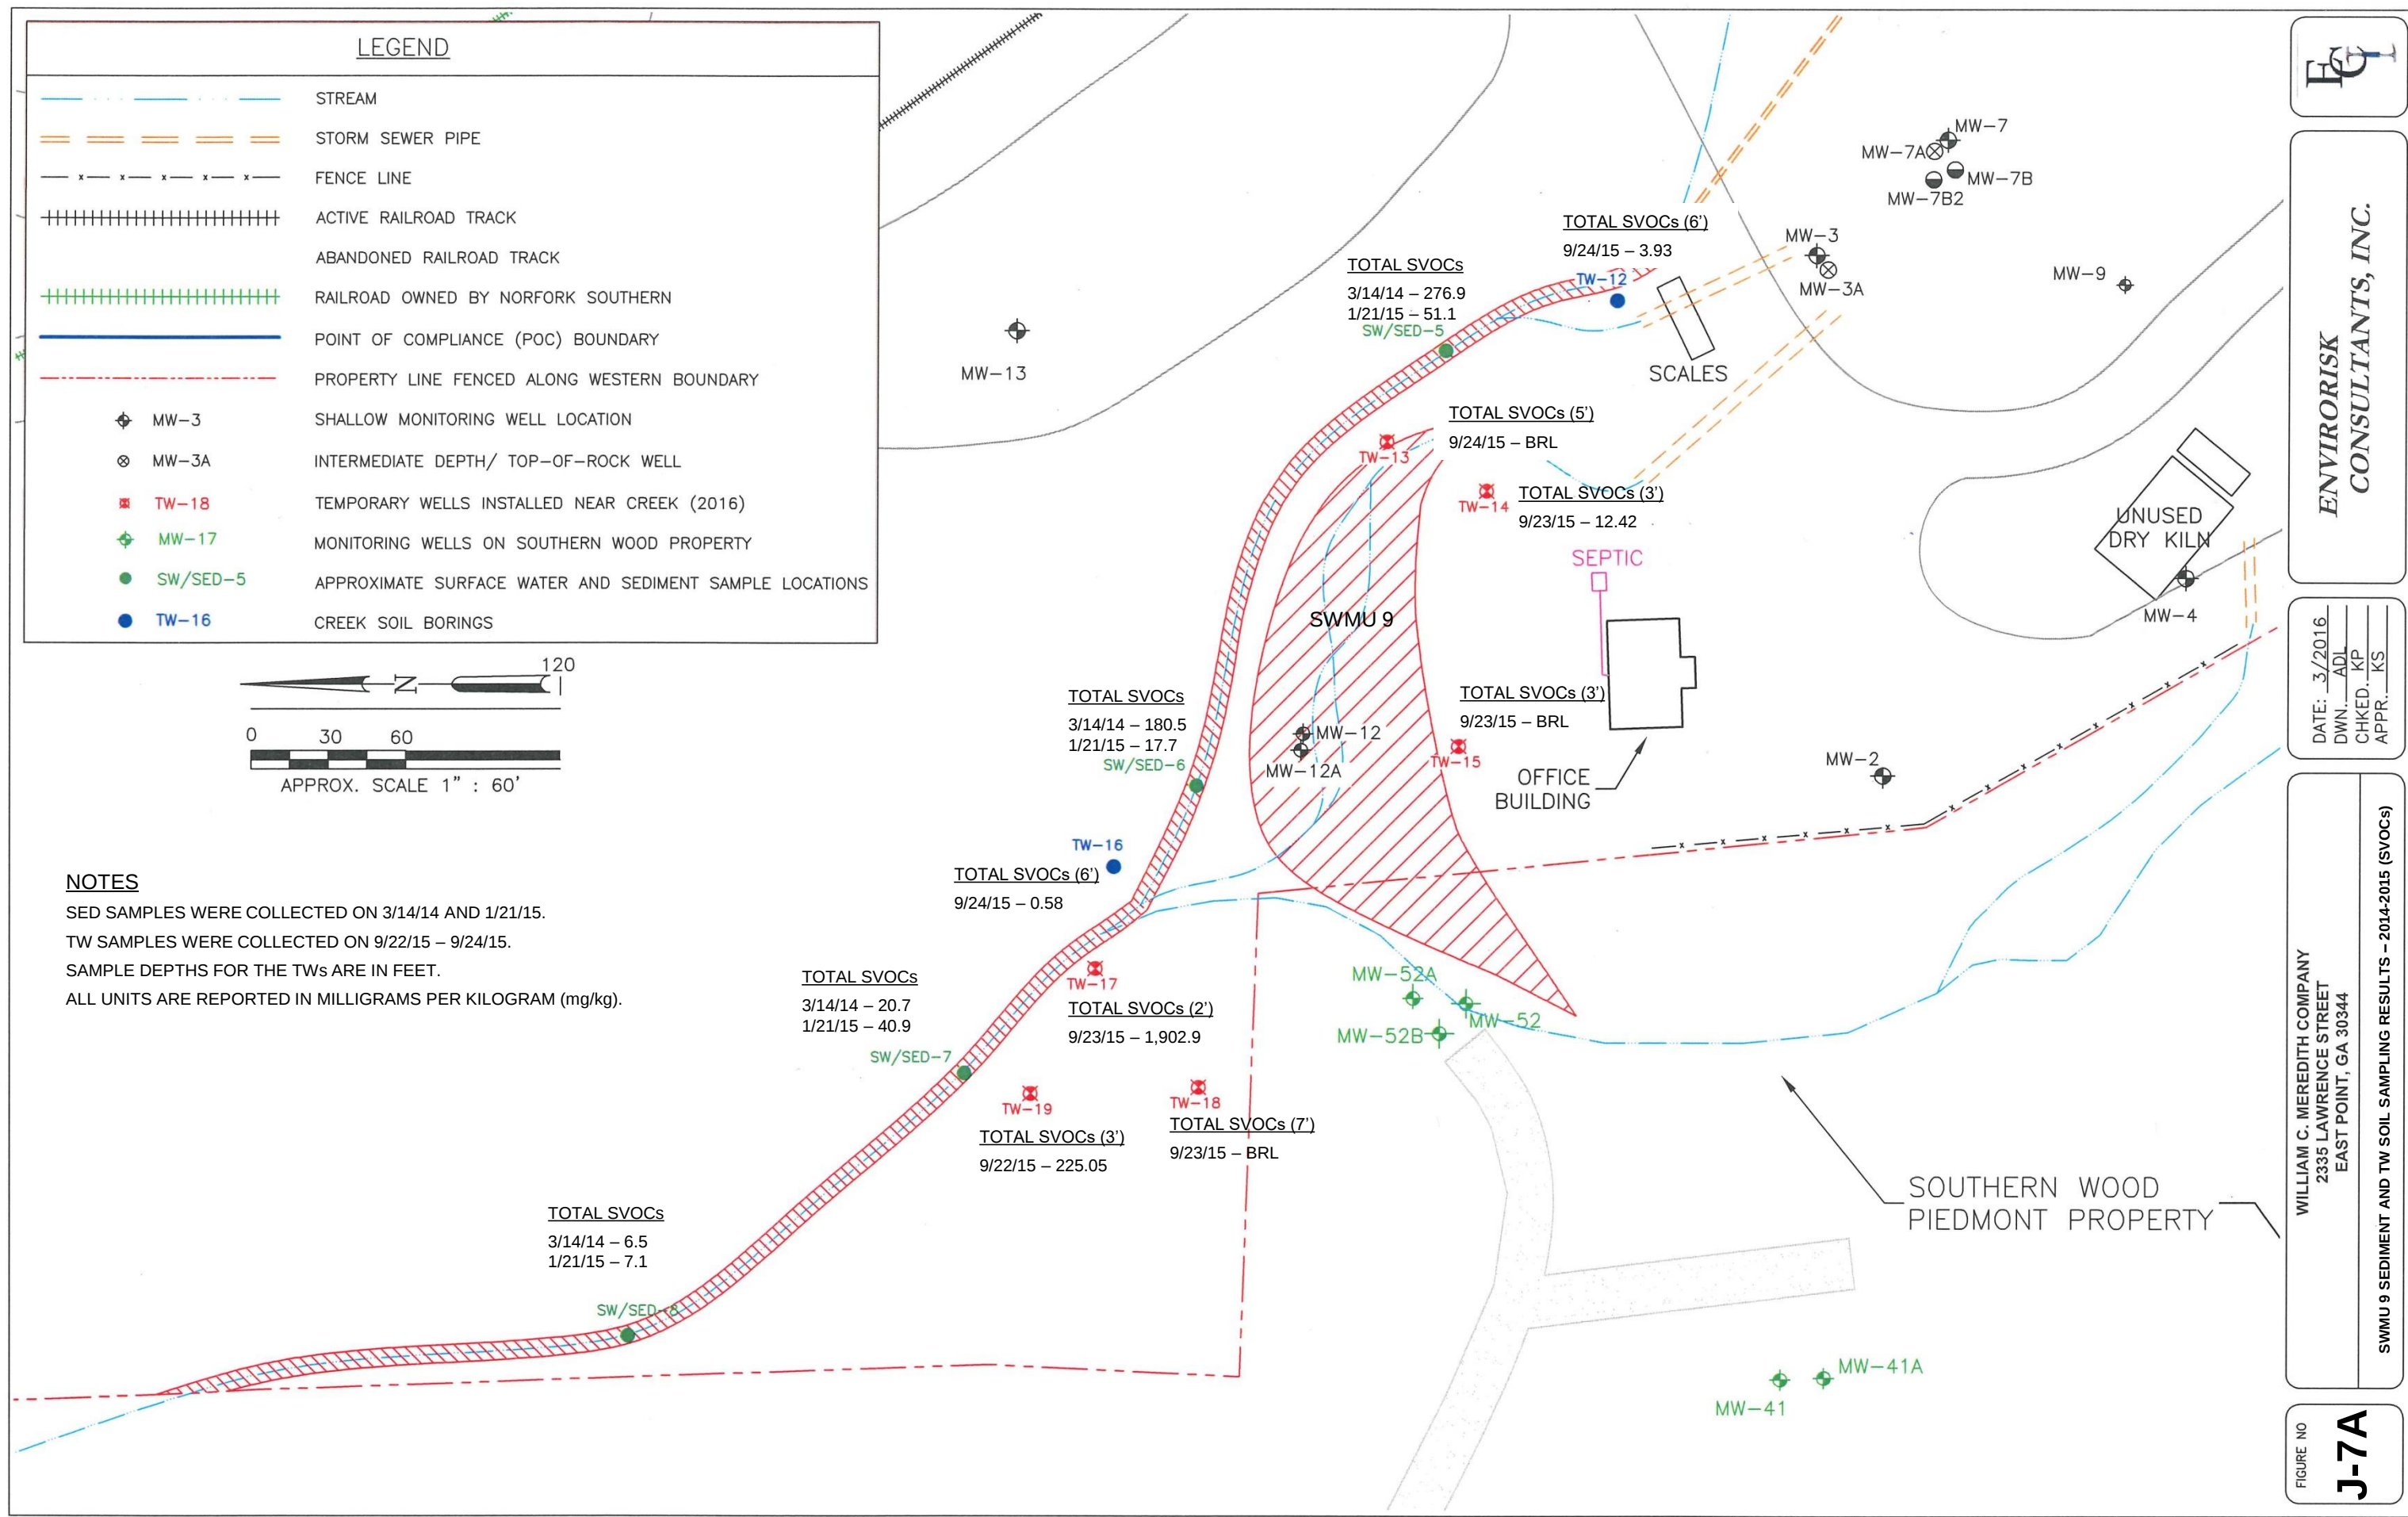


**ENVIORISK
CONSULTANTS, INC.**

DATE: 3/2016
DWN: ADL
CHKD: KP
APPR: KS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

SWMU 9 SEDIMENT AND TW SOIL SAMPLING RESULTS – 2014-2015 (SVOCs)

FIGURE NO
J-7A

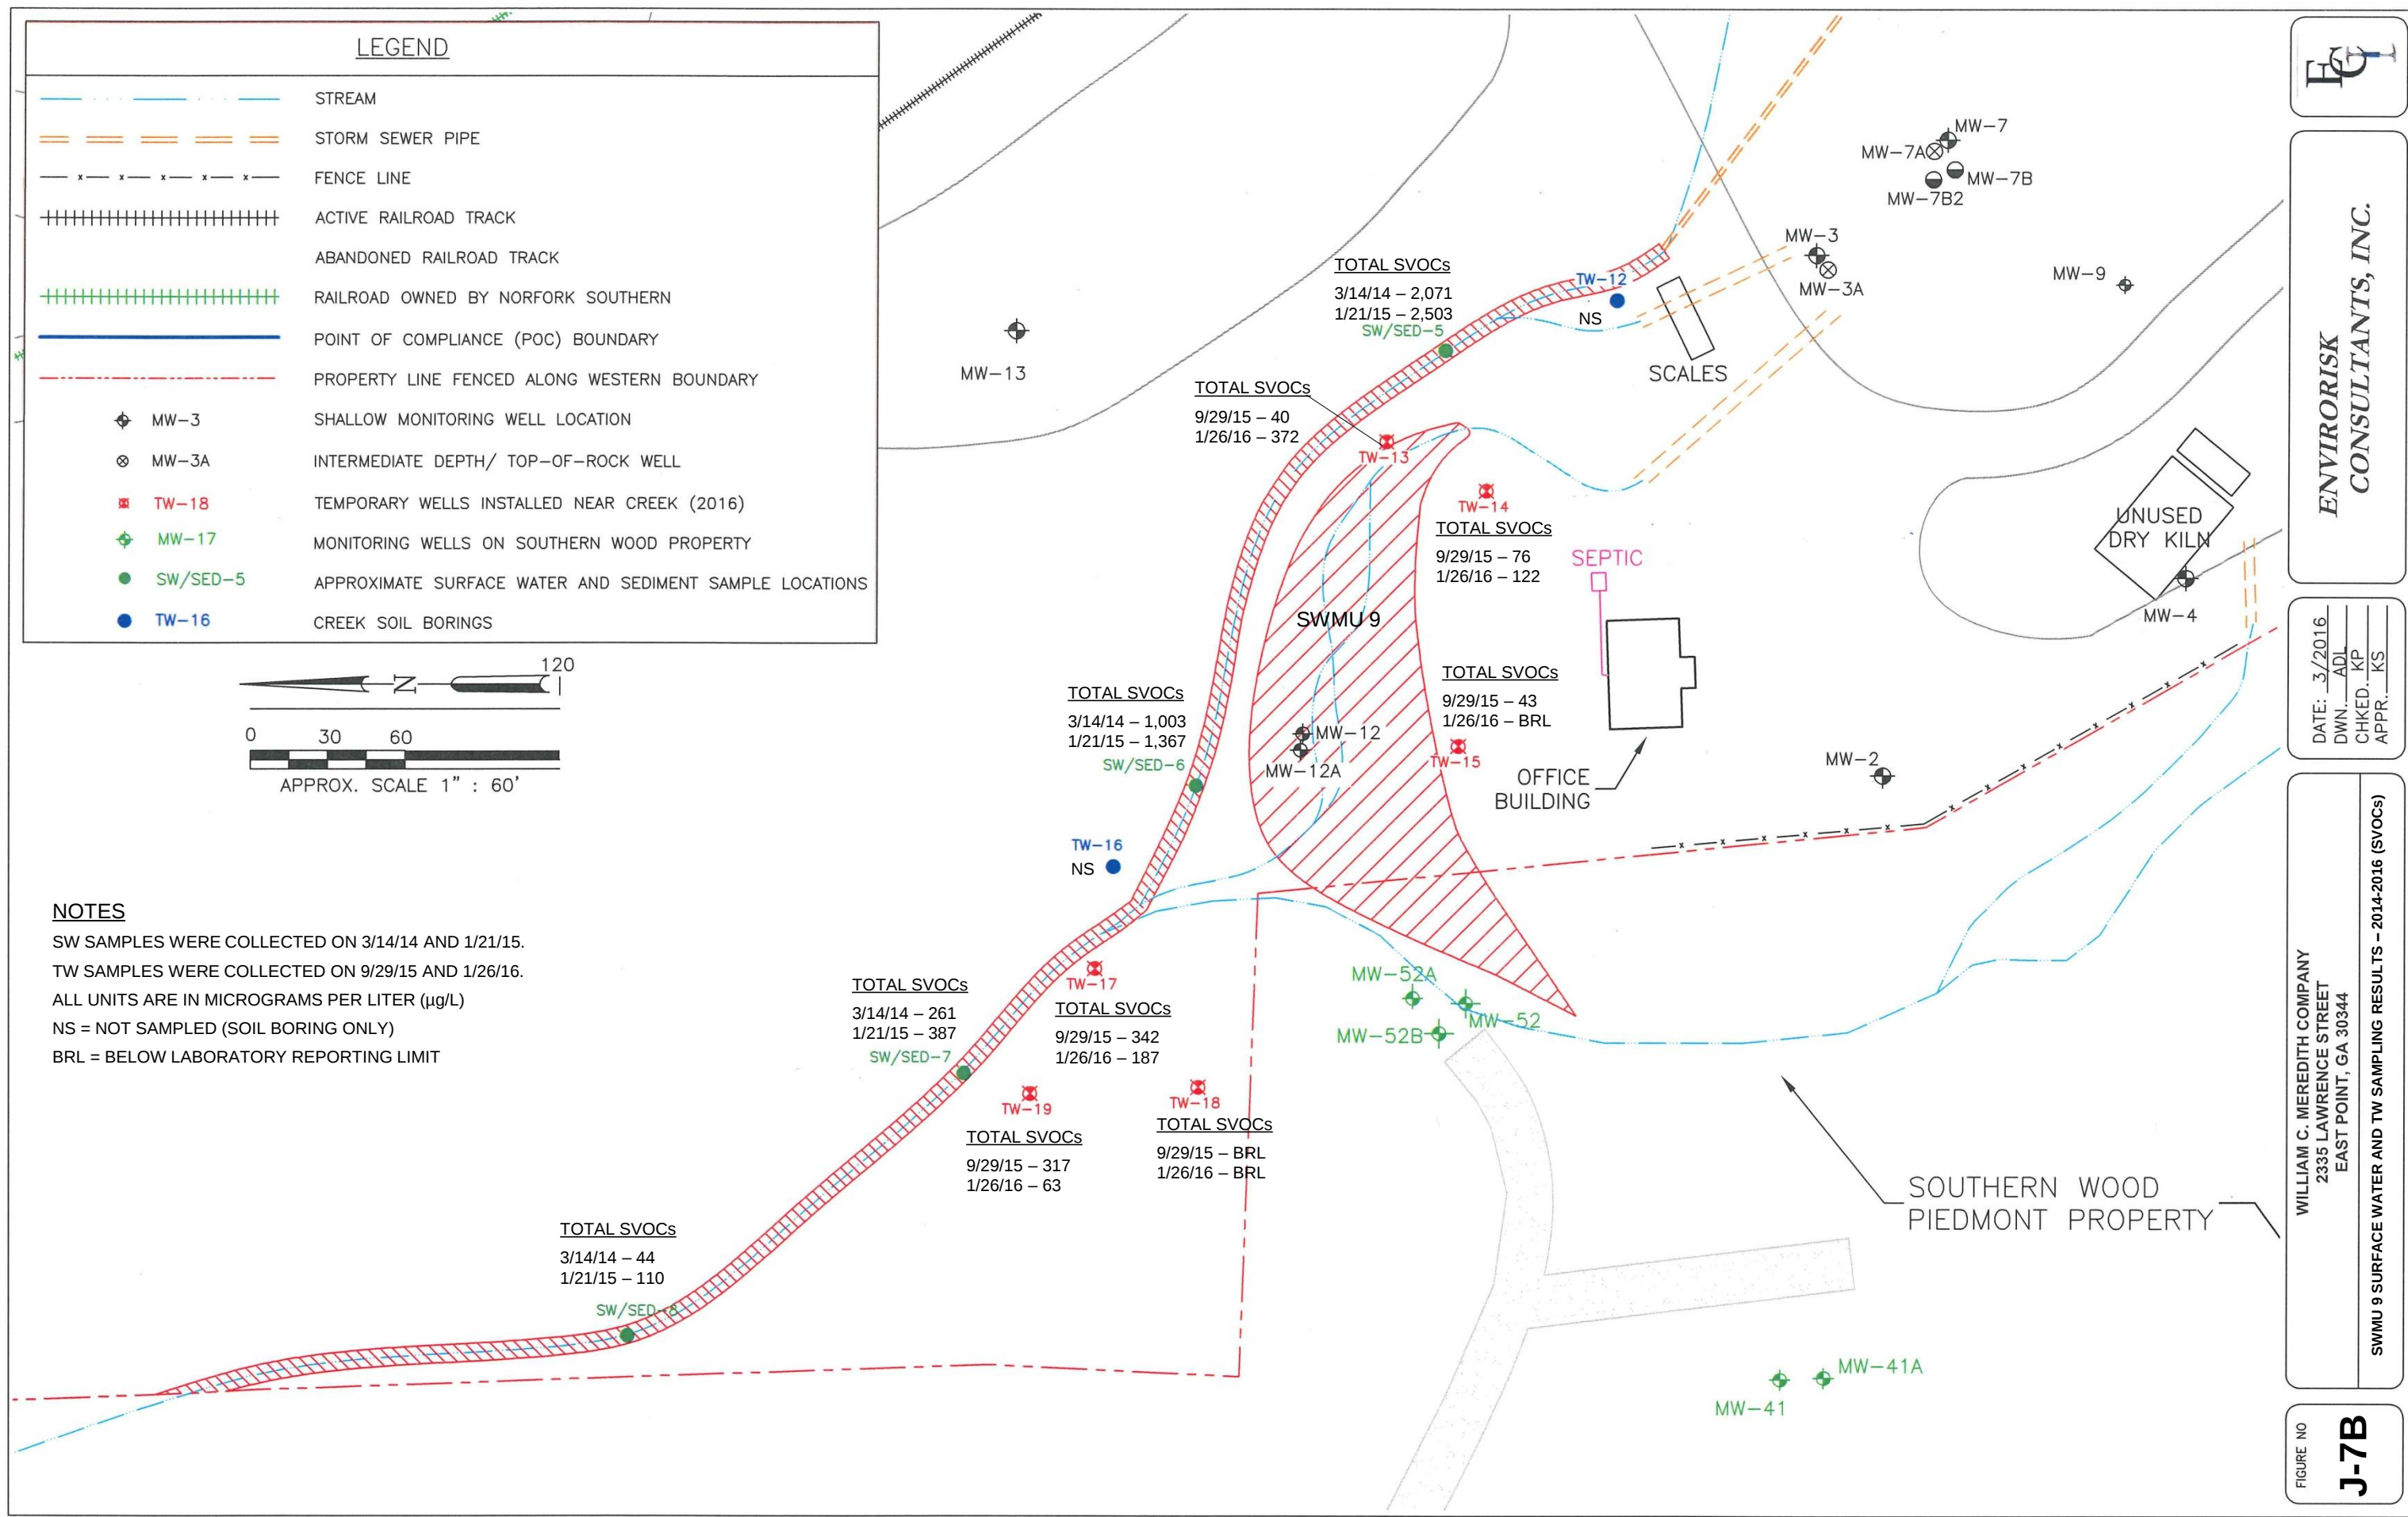


**ENVIORISK
CONSULTANTS, INC.**


DATE: 3/2016
DWN.: ADL
CHKD.: KP
APPR.: KS


WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

SWMU 9 SURFACE WATER AND TW SAMPLING RESULTS - 2014-2016 (SVOCs)

FIGURE NO
J-7B

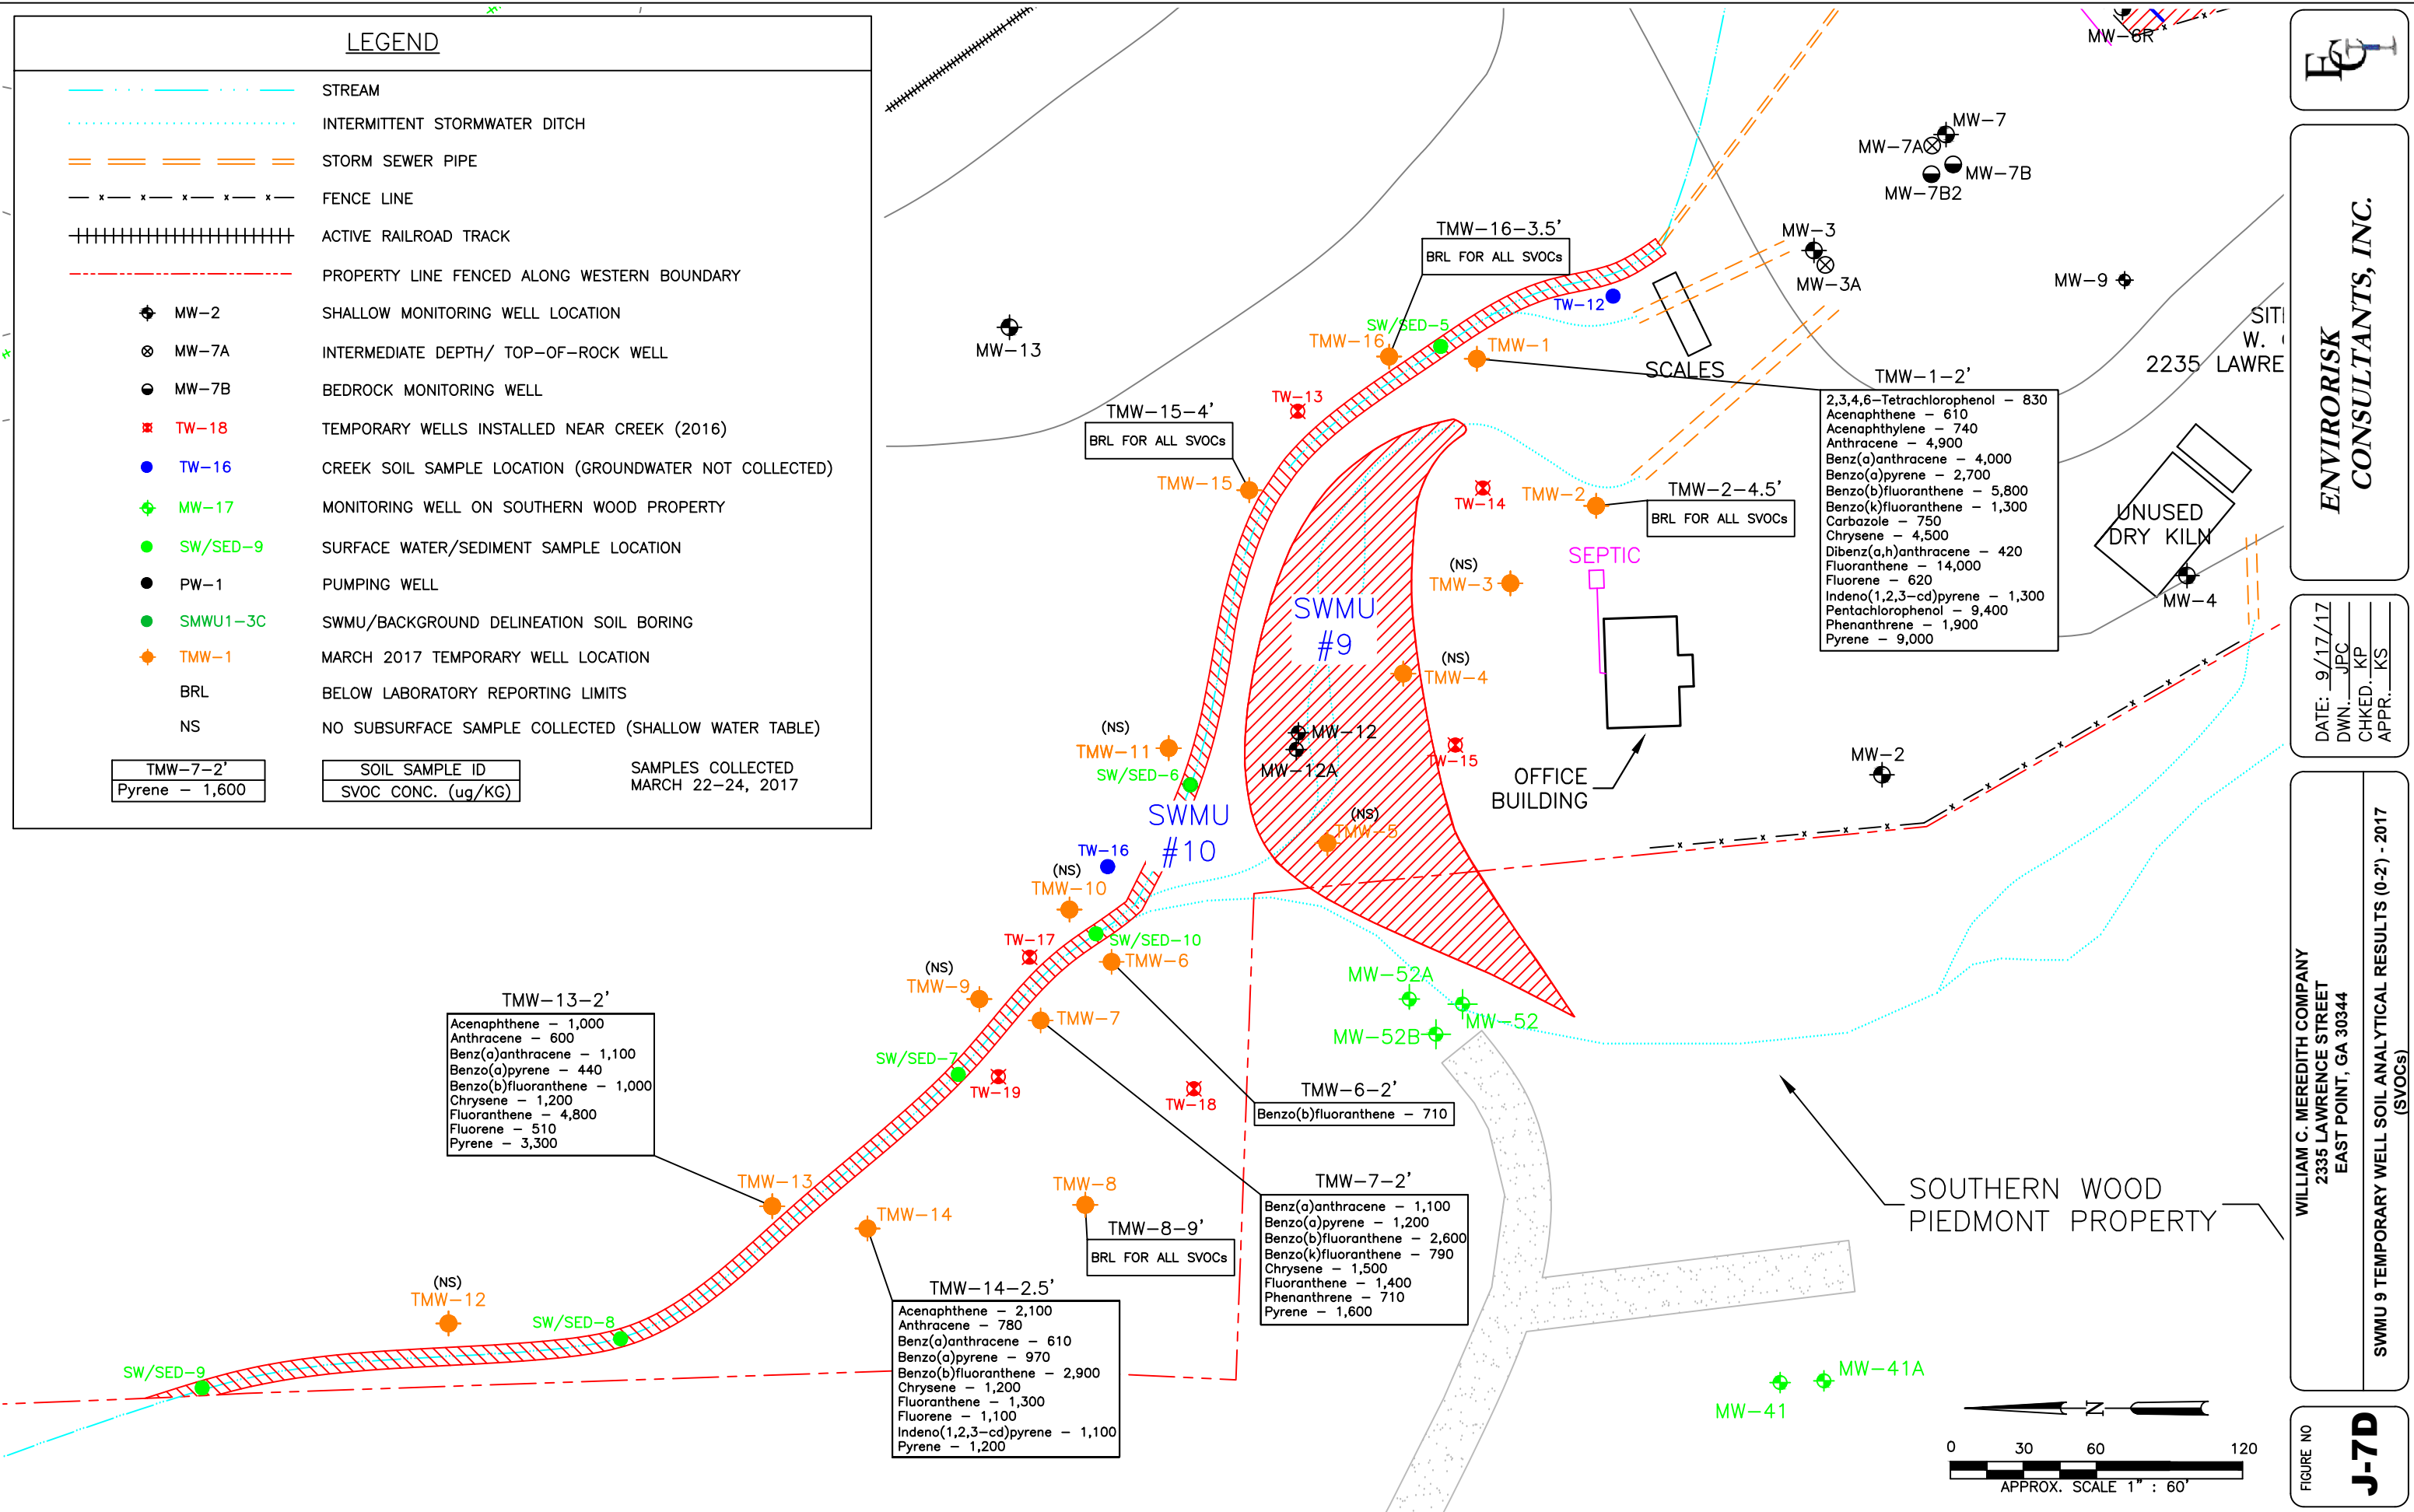

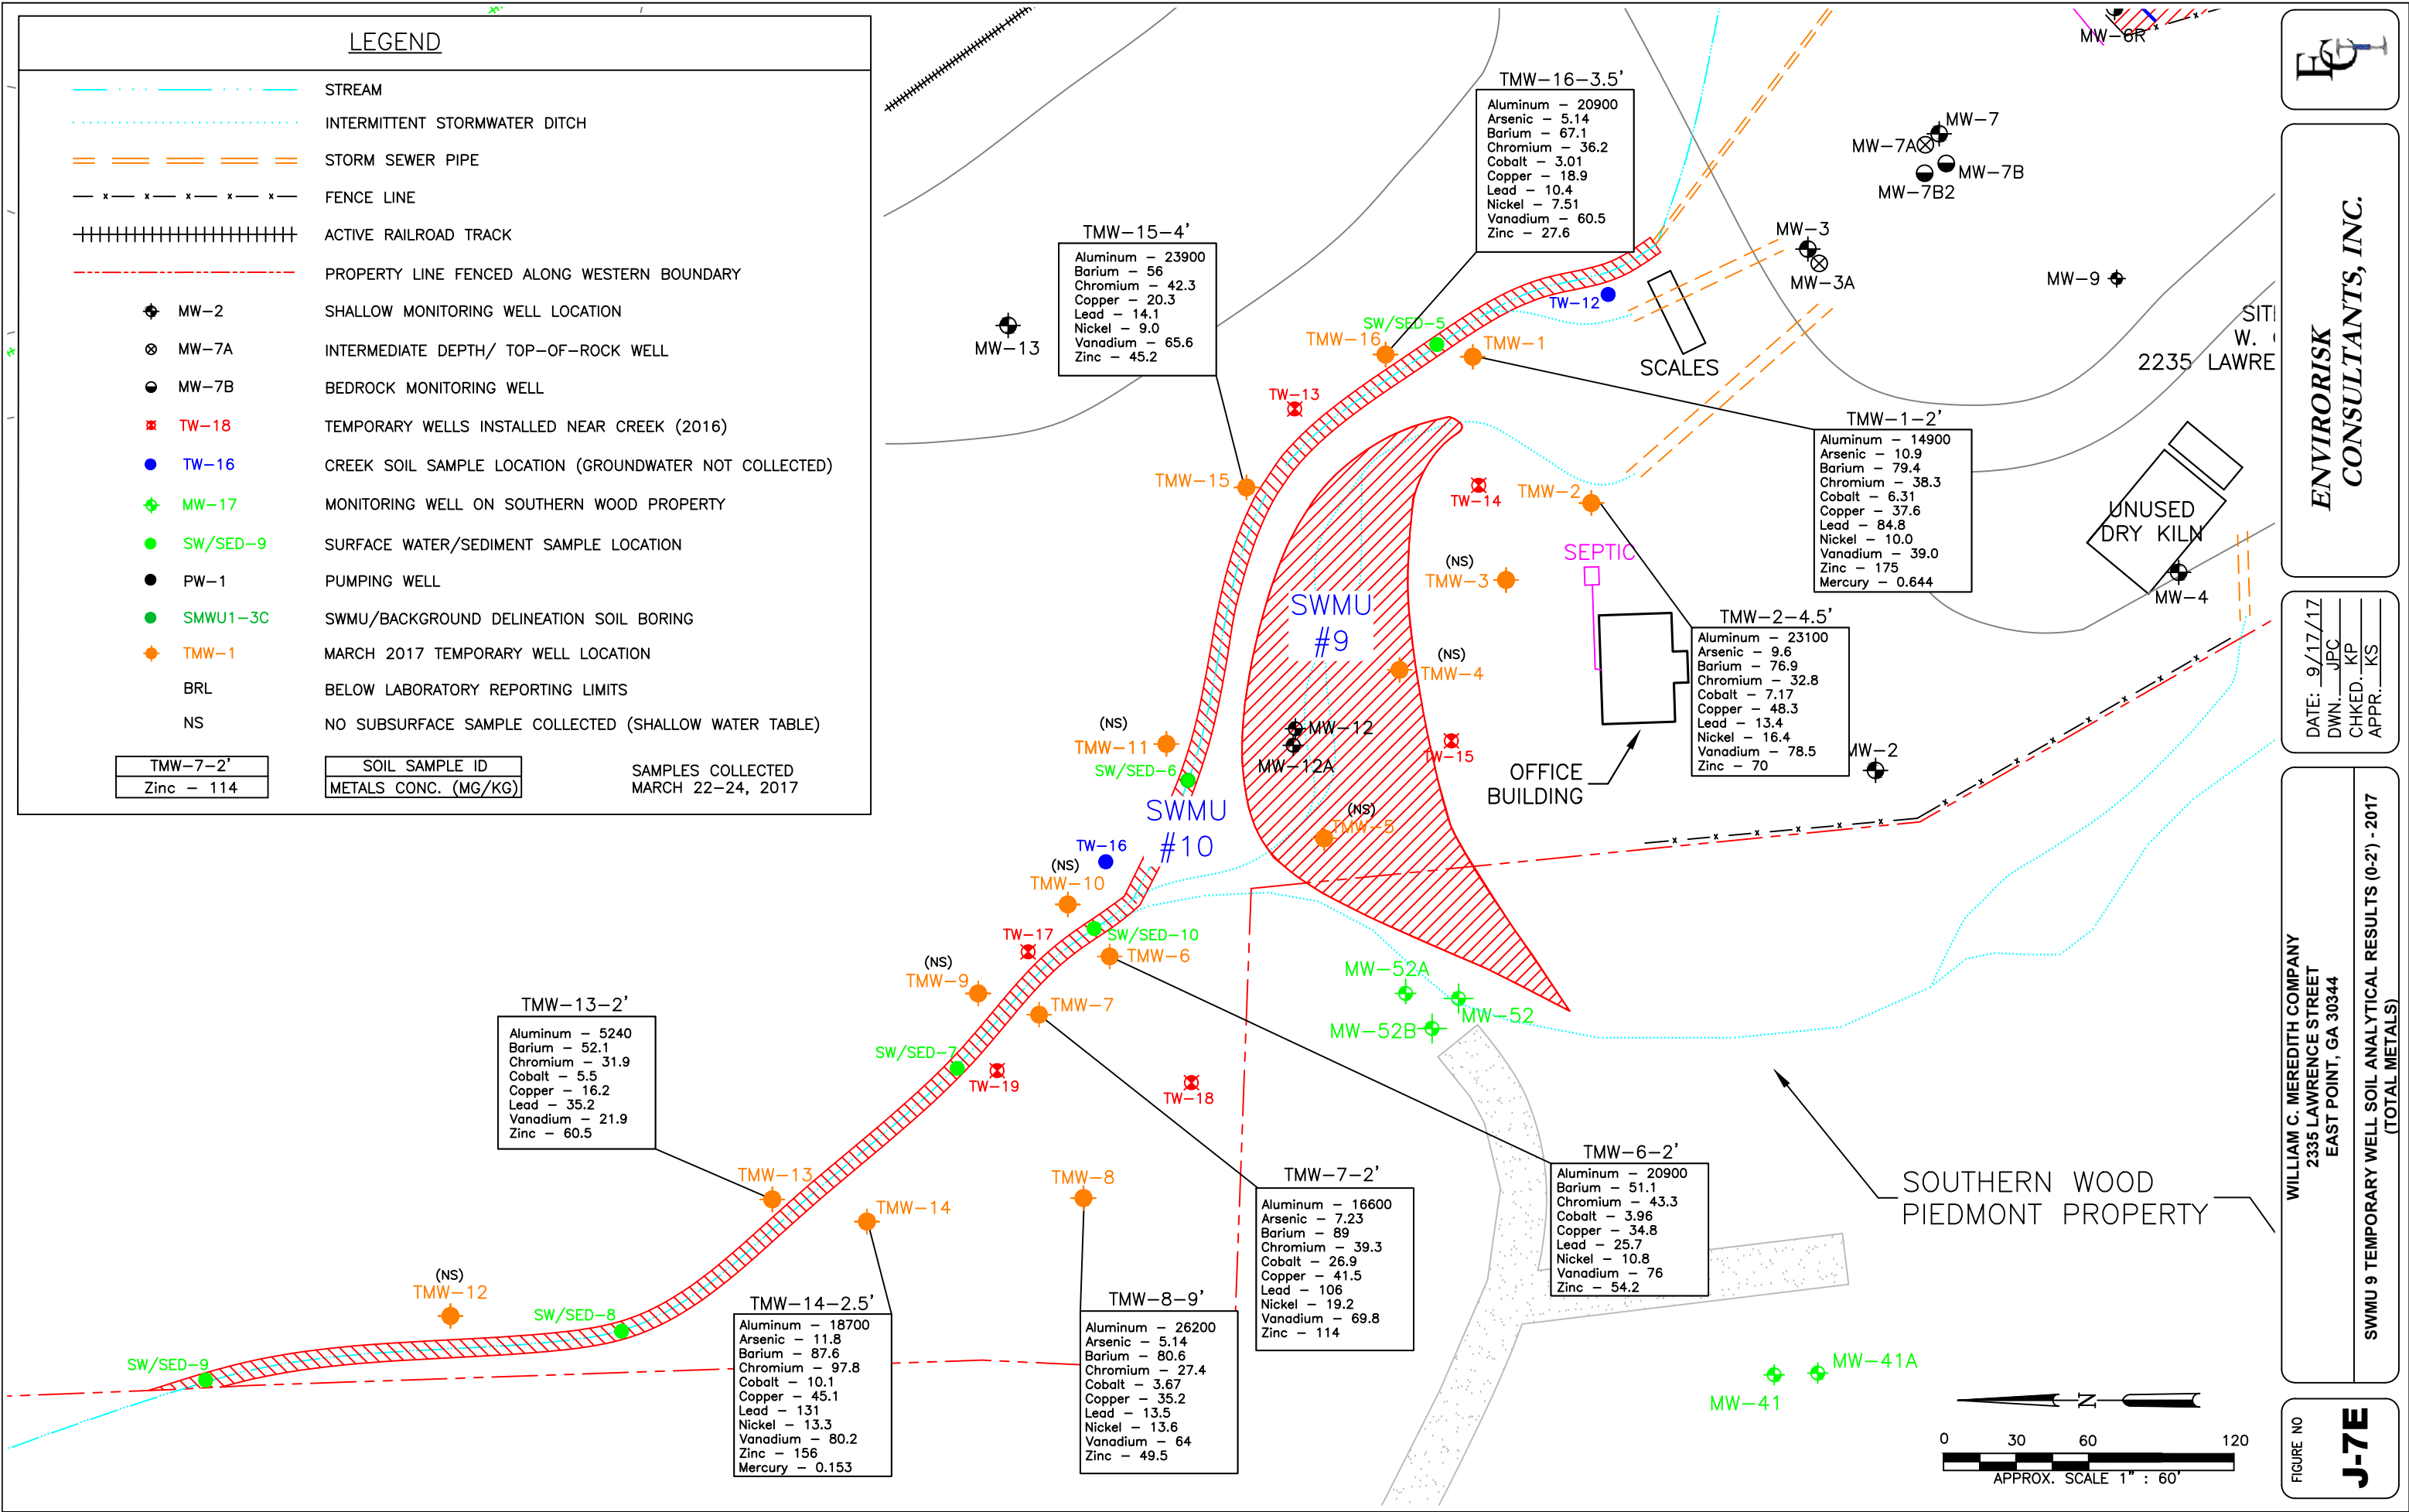

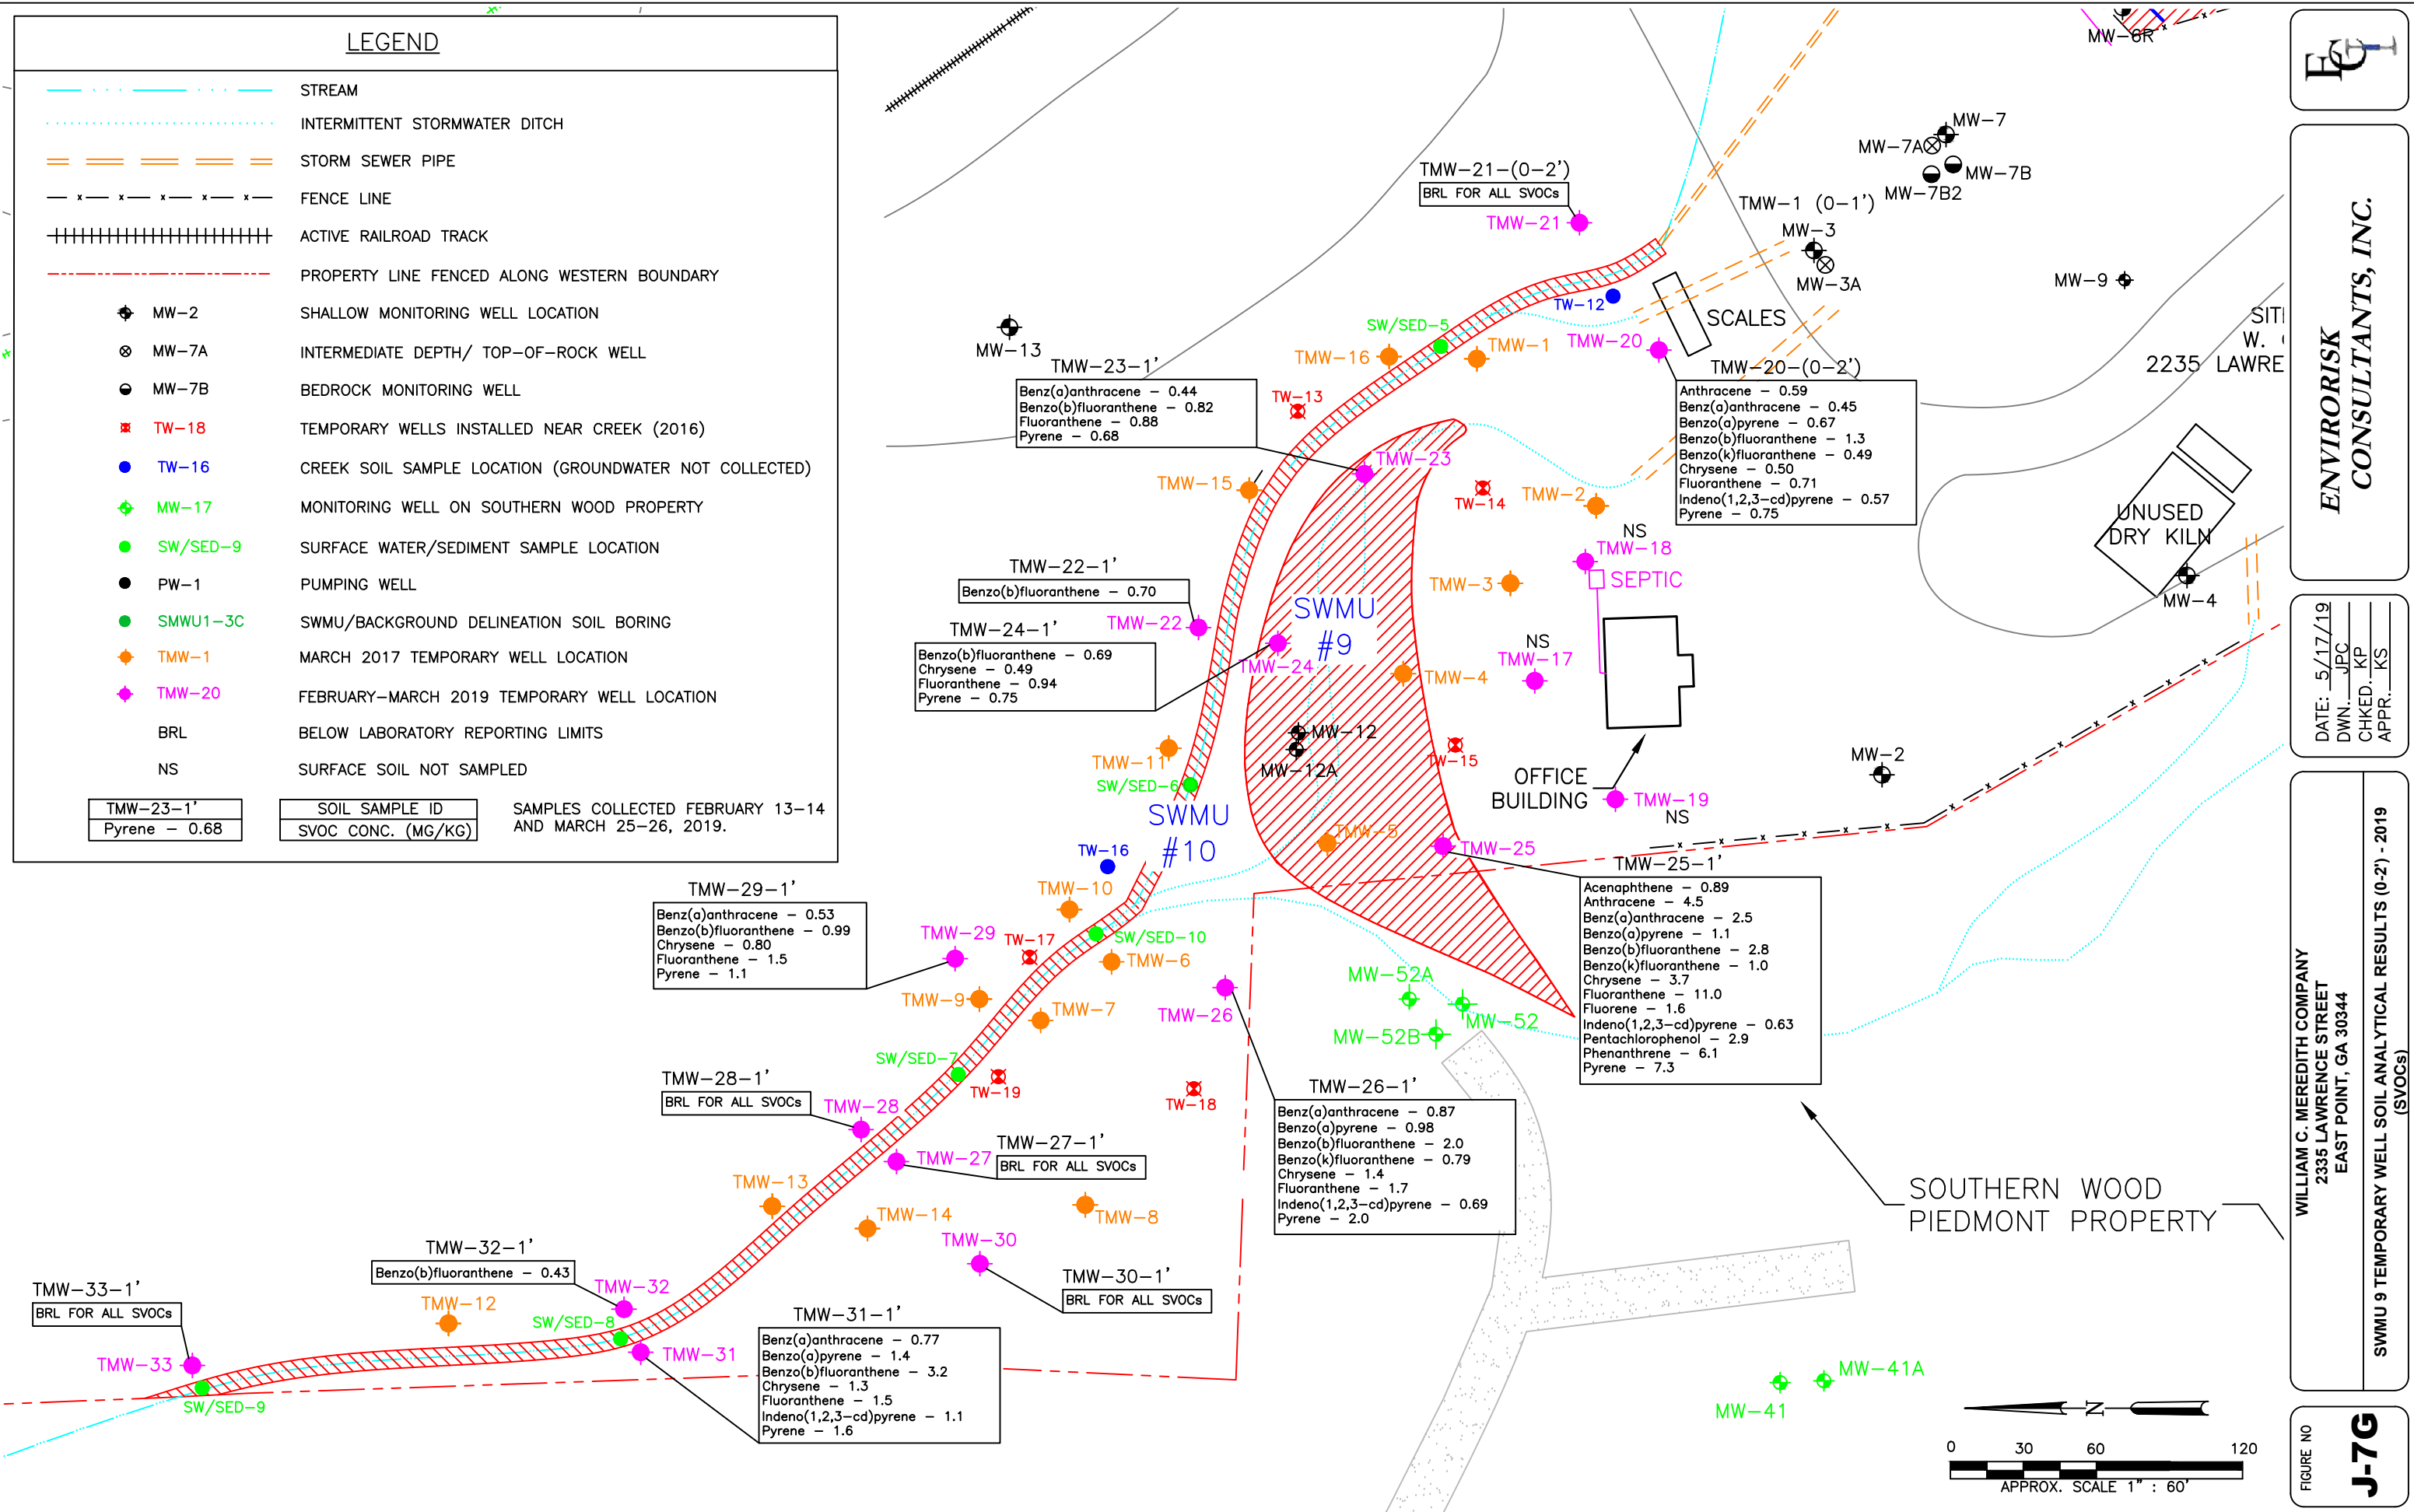


ENVIRORISK CONSULTANTS, INC.

DATE: 5/17/19
DWN: JPC
CHKD: KP
APPR: KS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

SWMU 9 TEMPORARY WELL SOIL ANALYTICAL RESULTS (0-2') - 2019 (SVOCs)

FIGURE NO **J-7G**

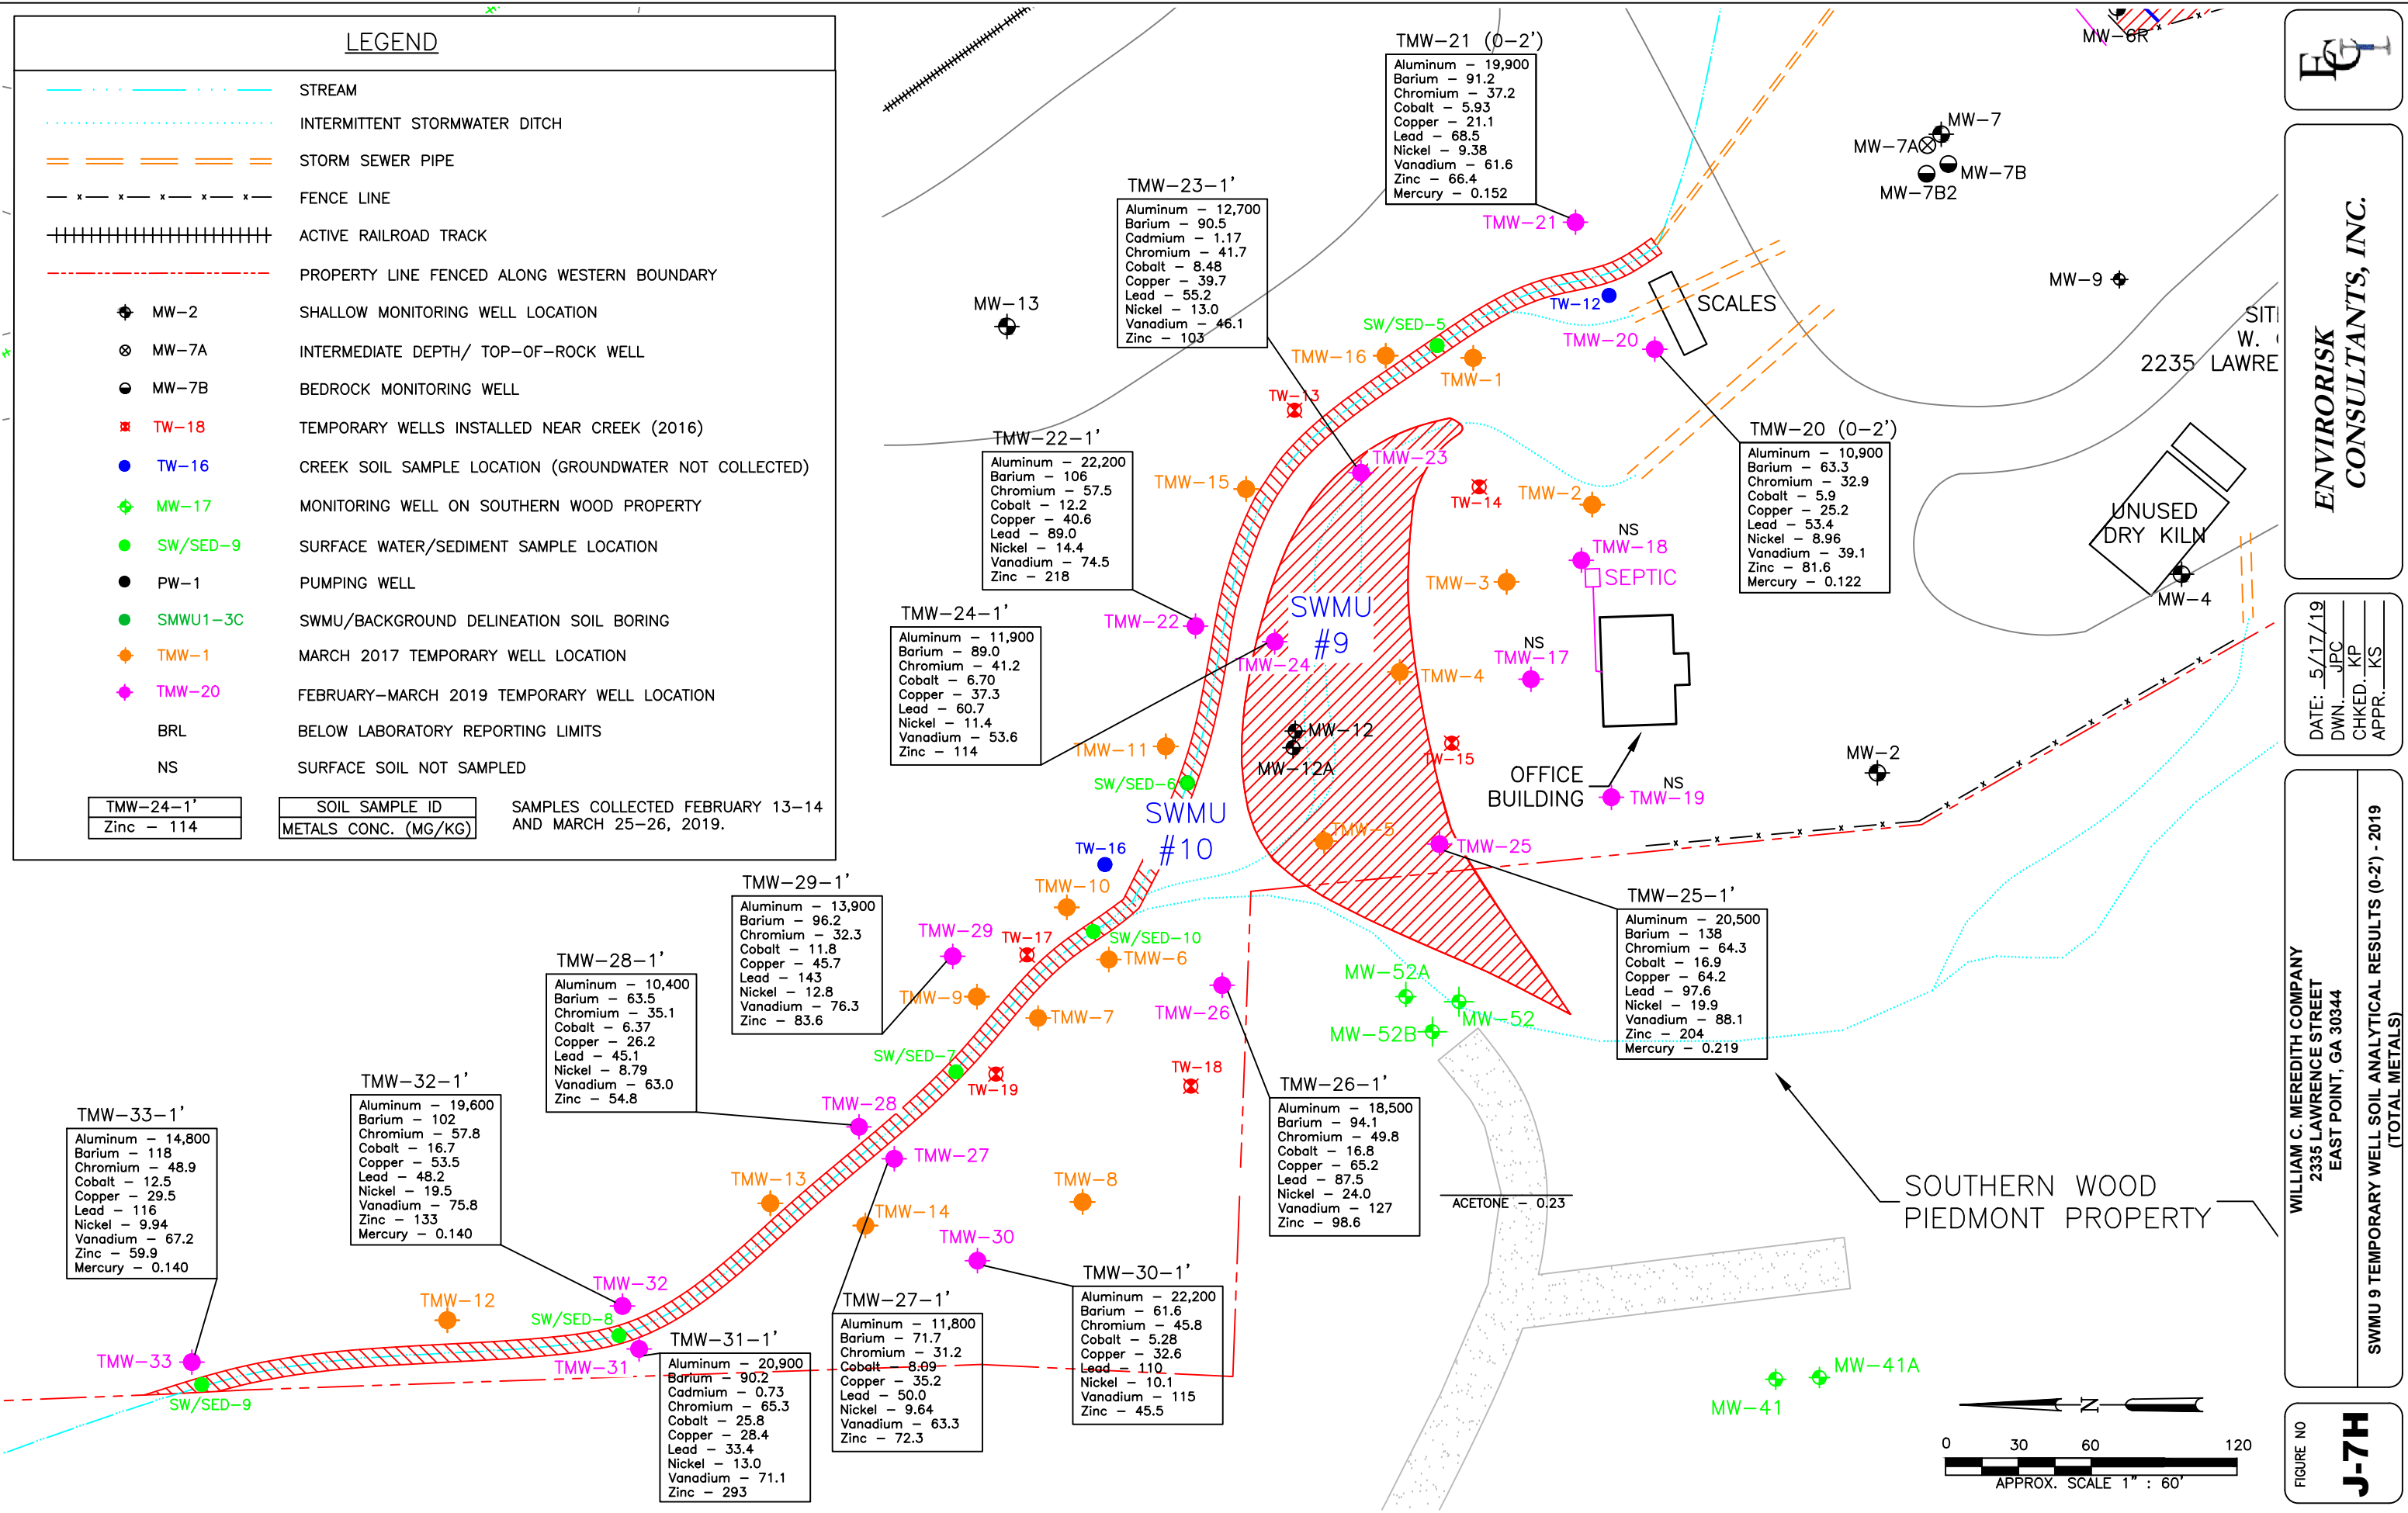

**ENVIRORISK
CONSULTANTS, INC.**

DATE: 5/17/19
DWN: JPC
CHKD: KP
APPR: KS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

FIGURE NO
J-7H

SWMU 9 TEMPORARY WELL SOIL ANALYTICAL RESULTS (0-2') - 2019
(TOTAL METALS)

LEGEND

STREAM

INTERMITTENT STORMWATER DITCH

STORM SEWER PIPE

FENCE LINE

ACTIVE RAILROAD TRACK

PROPERTY LINE FENCED ALONG WESTERN BOUNDARY

MW-2
SHALLOW MONITORING WELL LOCATION

MW-7A
INTERMEDIATE DEPTH/ TOP-OF-ROCK WELL

MW-7B
BEDROCK MONITORING WELL

TW-18
TEMPORARY WELLS INSTALLED NEAR CREEK (2016)

TW-16
CREEK SOIL SAMPLE LOCATION (GROUNDWATER NOT COLLECTED)

MW-17
MONITORING WELL ON SOUTHERN WOOD PROPERTY

SW/SED-9
SURFACE WATER/SEDIMENT SAMPLE LOCATION

PW-1
PUMPING WELL

SMWU1-3C
SWMU/BACKGROUND DELINEATION SOIL BORING

TMW-1
MARCH 2017 TEMPORARY WELL LOCATION

TMW-20
FEBRUARY-MARCH 2019 TEMPORARY WELL LOCATION

BRL
BELOW LABORATORY REPORTING LIMITS

NS
NO SUBSURFACE SOIL SAMPLE COLLECTED

TMW-25-5'

SOIL SAMPLE ID

SAMPLES COLLECTED FEBRUARY 13-14 AND MARCH 25-26, 2019.

1,2,4-Trimethylbenzene - 0.20

VOC. CONC. (MG/KG)

The map displays the layout of monitoring wells and soil borings at the Southern Wood Piedmont Property. Key features include:

- Monitoring Wells:** MW-2, MW-7A, MW-7B, MW-9, MW-12, MW-12A, MW-13, MW-17, MW-41, MW-41A, MW-52, MW-52A, MW-52B.
- Temporary Wells:** TW-12, TW-13, TW-14, TW-15, TW-16, TW-17, TW-18, TW-19.
- Soil Borings:** SW/SED-5, SW/SED-6, SW/SED-7, SW/SED-8, SW/SED-9, SW/SED-10.
- Soil Sample Locations:** TW-16, TW-17, TW-18, TW-19.
- Background Delineation:** SWMU #9 and SWMU #10.
- Structures:** OFFICE BUILDING, SEPTIC, UNUSED DRY KILN, SCALES.
- Boundaries:** PROPERTY LINE FENCED ALONG WESTERN BOUNDARY, SOUTHERN WOOD PIEDMONT PROPERTY.
- Analytical Results:** 1,2,4-Trimethylbenzene - 0.20, ACETONE - 0.23, Tetrachloroethene - 0.023.
- Legend:** STREAM, INTERMITTENT STORMWATER DITCH, STORM SEWER PIPE, FENCE LINE, ACTIVE RAILROAD TRACK, PROPERTY LINE FENCED ALONG WESTERN BOUNDARY, MW-2, MW-7A, MW-7B, TW-18, TW-16, MW-17, SW/SED-9, PW-1, SMWU1-3C, TMW-1, TMW-20, BRL, NS.
- Scale:** 0, 30, 60, 120 feet. APPROX. SCALE 1" : 60'.
- North Arrow:** Indicated by a line with an arrow pointing North.


ENVIRORISK
CONSULTANTS, INC.


DATE: 5/17/19
DWN: JPC
CHKD: KP
APPR: KS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

FIGURE NO
J-71

SWMU 9 TEMPORARY WELL SOIL ANALYTICAL RESULTS (3 - 15') - 2019
(VOCs)

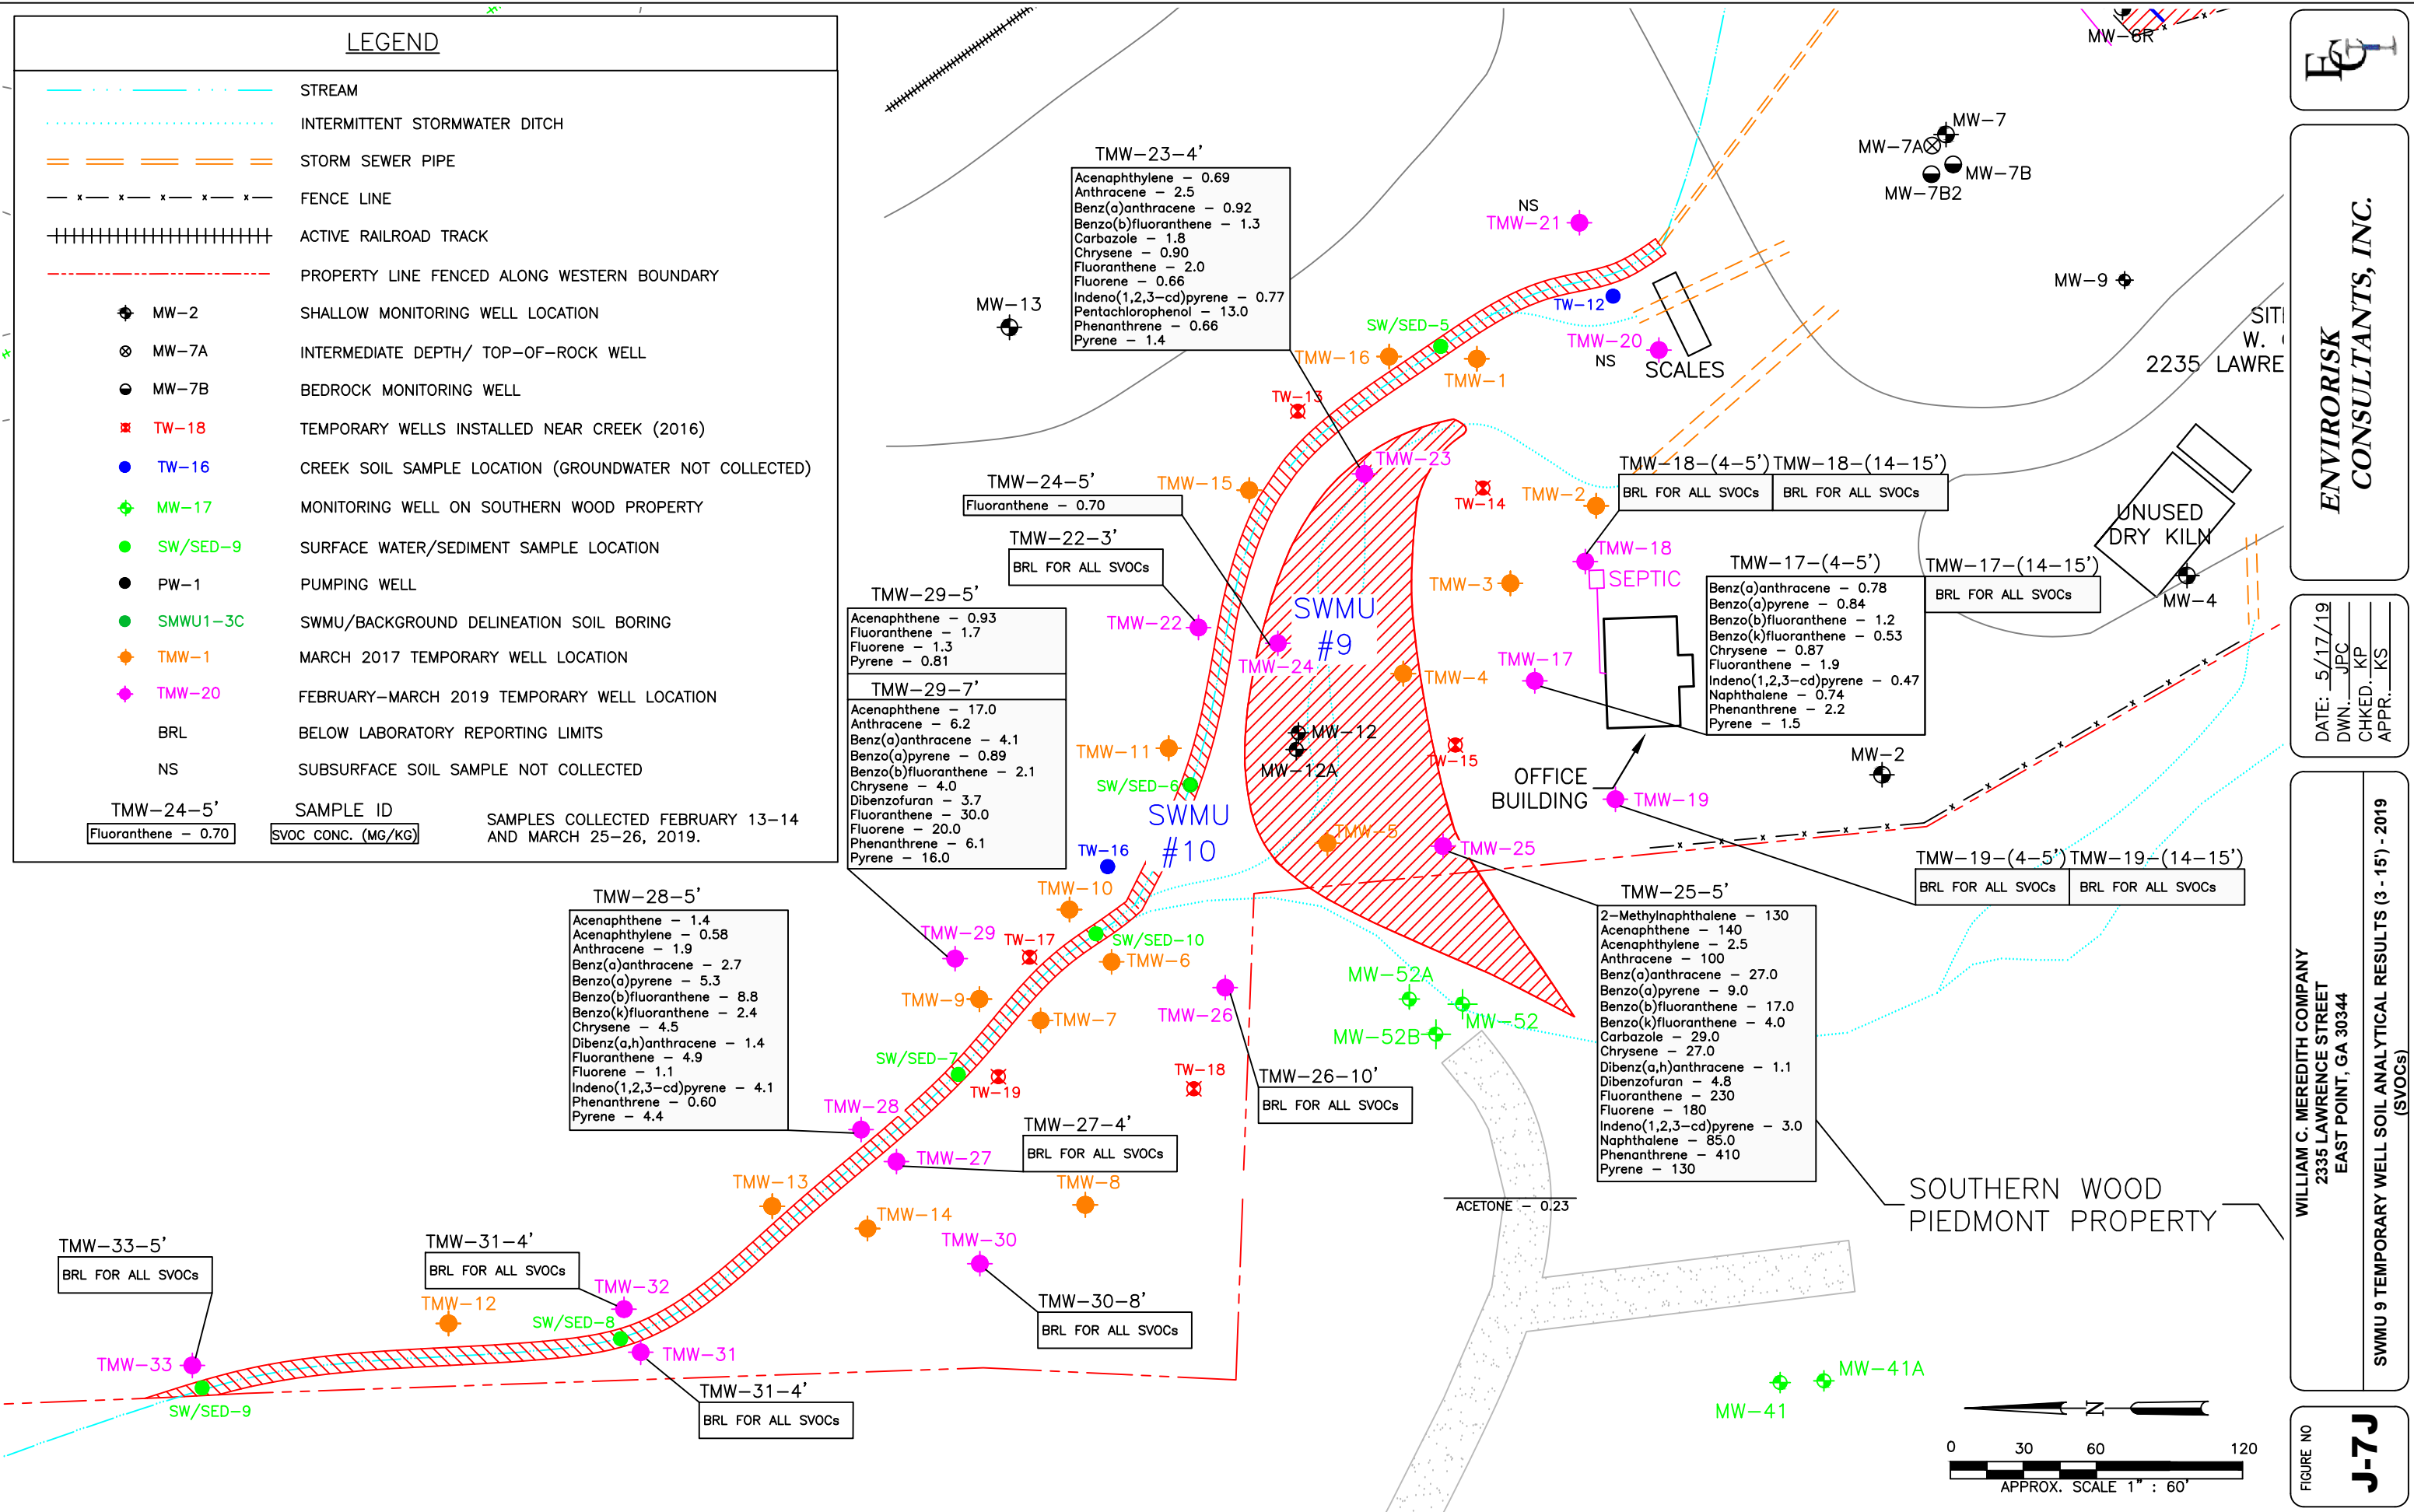

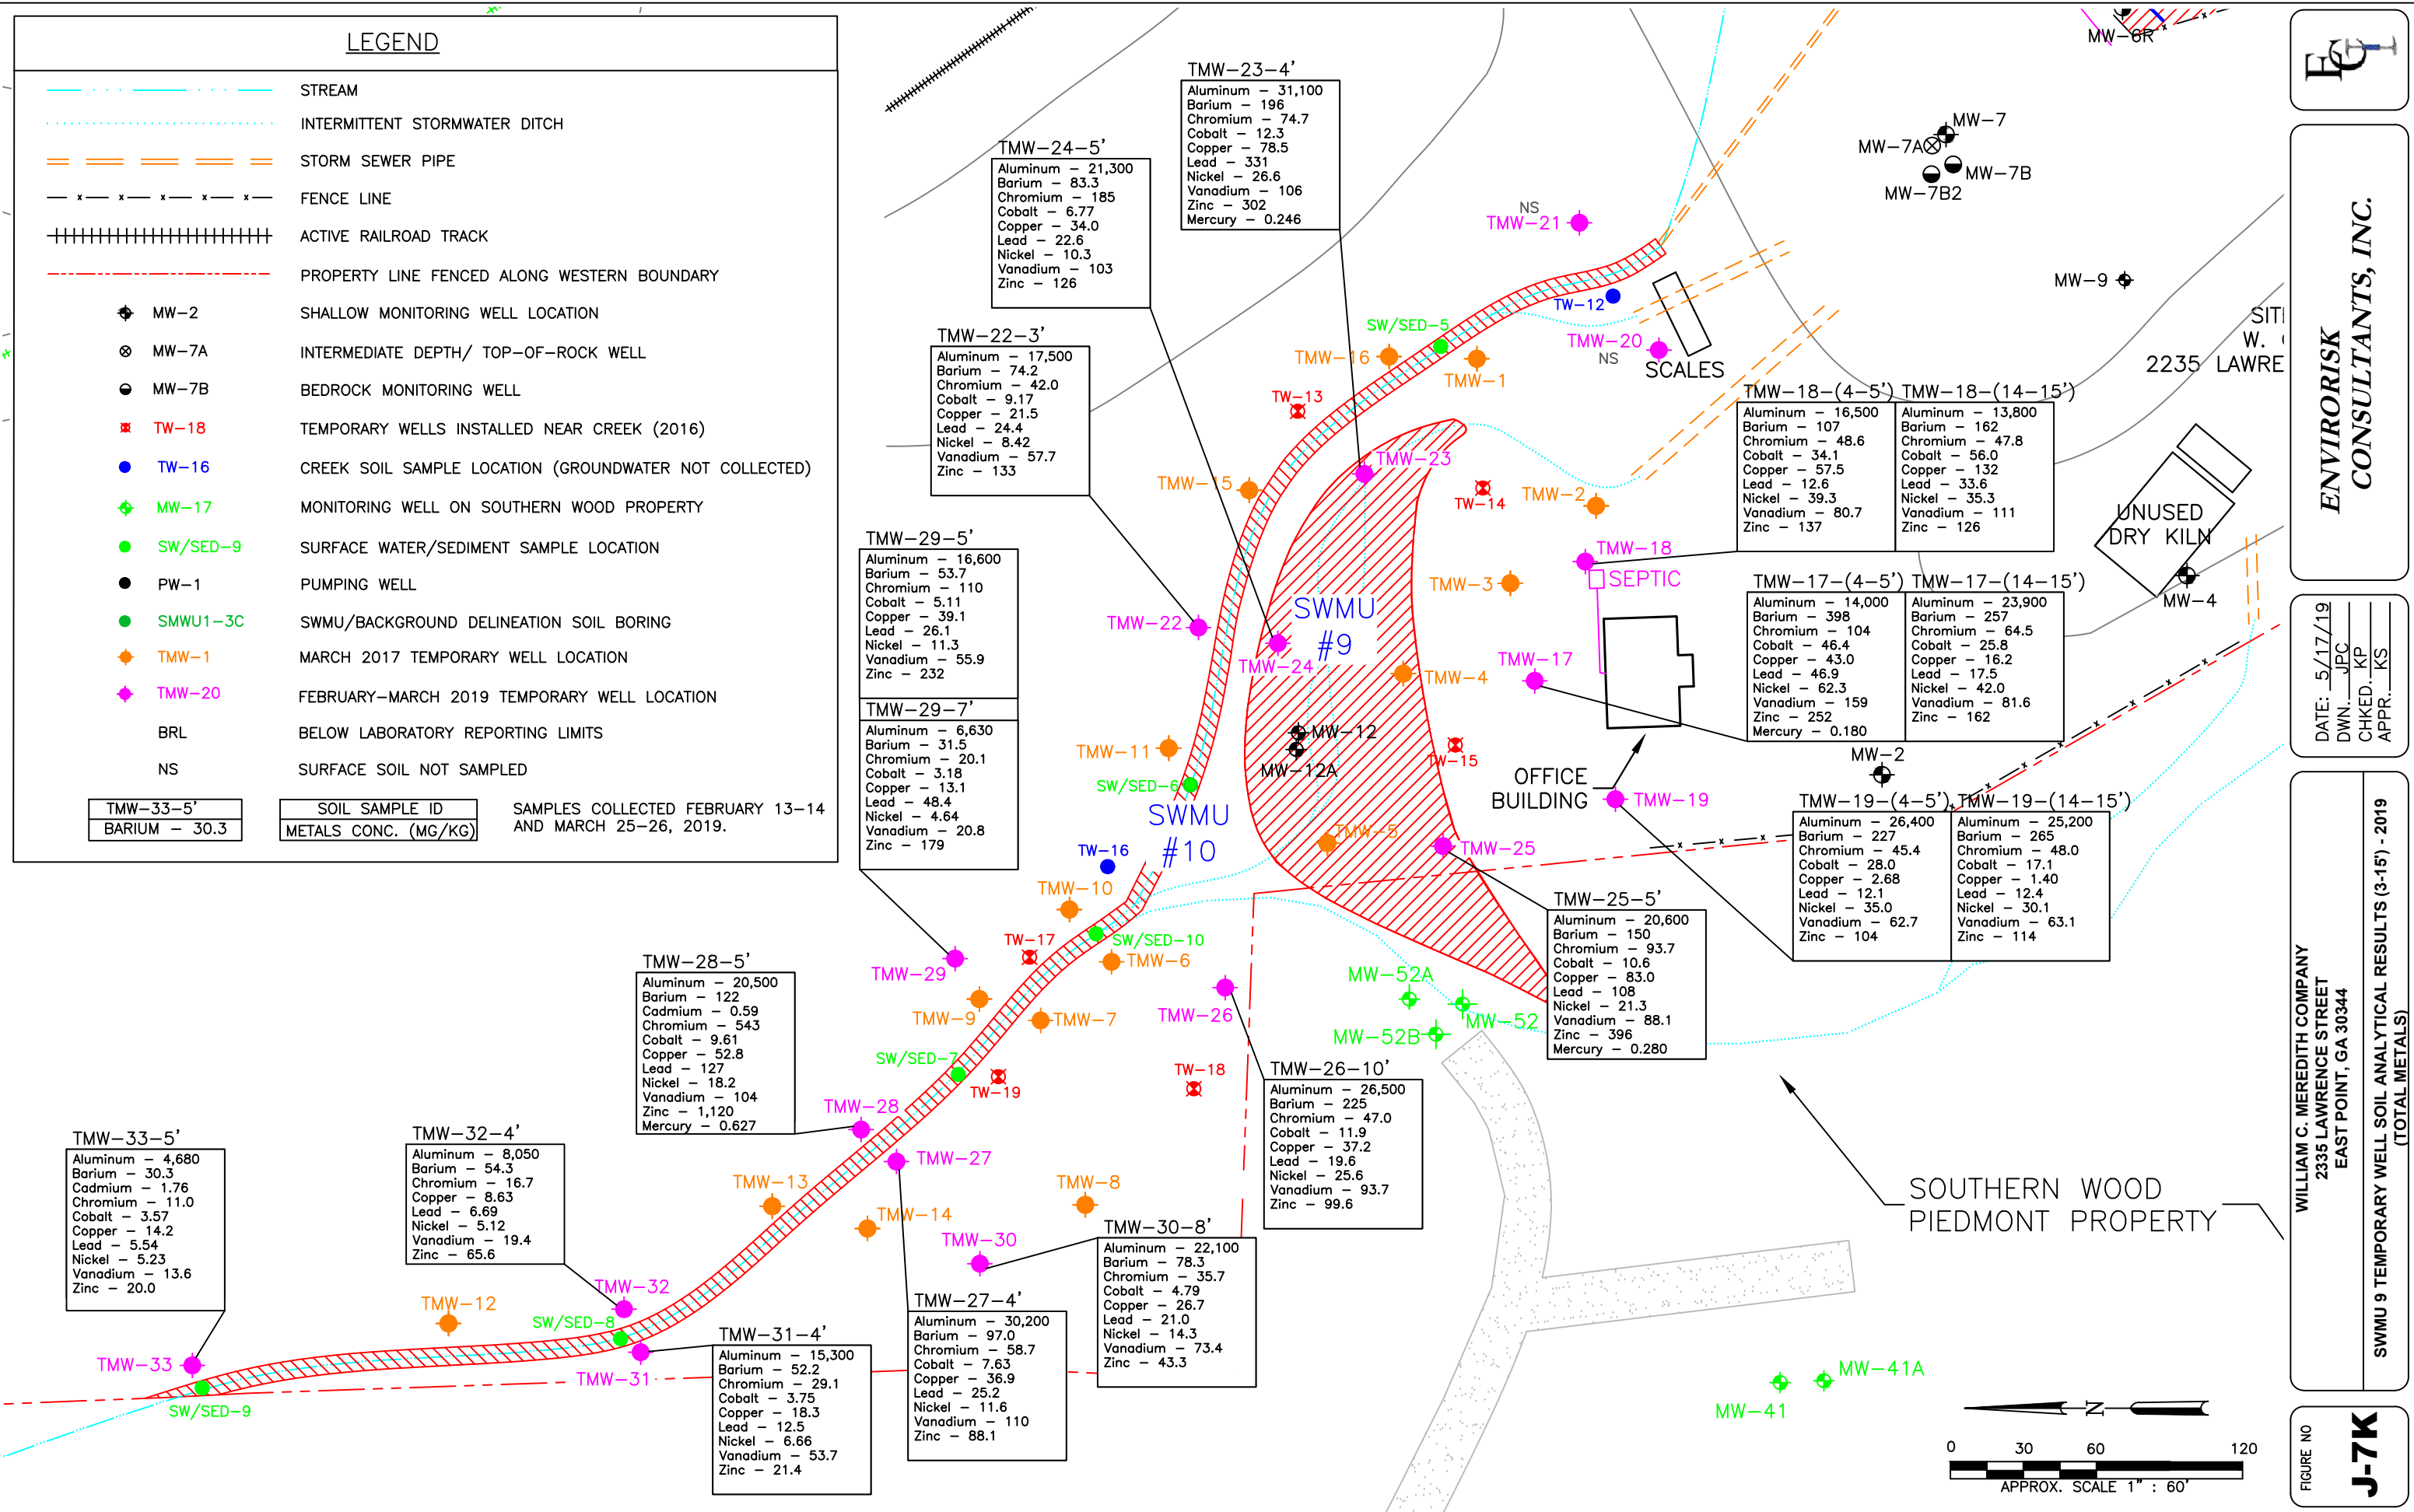

ENVIRORISK
CONSULTANTS, INC.

DATE: 5/17/19
DWN: JPC
CHKD: KP
APPR: KS

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

FIGURE NO
J-7K

SWMU 9 TEMPORARY WELL SOIL ANALYTICAL RESULTS (3-15') - 2019
(TOTAL METALS)

LEGEND

- STREAM
- INTERMITTENT STORMWATER DITCH
- STORM SEWER PIPE
- FENCE LINE
- ACTIVE RAILROAD TRACK
- PROPERTY LINE FENCED ALONG WESTERN BOUNDARY
- MW-2 SHALLOW MONITORING WELL LOCATION
- MW-7A INTERMEDIATE DEPTH/ TOP-OF-ROCK WELL
- MW-7B BEDROCK MONITORING WELL
- TW-18 TEMPORARY WELLS INSTALLED NEAR CREEK (2016)
- TW-16 CREEK SOIL SAMPLE LOCATION (GROUNDWATER NOT COLLECTED)
- MW-17 MONITORING WELL ON SOUTHERN WOOD PROPERTY
- SW/SED-9 SURFACE WATER/SEDIMENT SAMPLE LOCATION
- PW-1 PUMPING WELL
- SMWU1-3C SWMU/BACKGROUND DELINEATION SOIL BORING
- TMW-1 MARCH 2017 TEMPORARY WELL LOCATION
- TMW-20 FEBRUARY-MARCH 2019 TEMPORARY WELL LOCATION
- BRL BELOW LABORATORY REPORTING LIMITS
- NS SURFACE SOIL NOT SAMPLED

TMW-33-5'
Barium - 30.3

SOIL SAMPLE ID
METALS CONC. (MG/KG)

SAMPLES COLLECTED FEBRUARY 13-14
AND MARCH 25-26, 2019.

TMW-33-5'
Aluminum - 4,680
Barium - 30.3
Cadmium - 1.76
Chromium - 11.0
Cobalt - 3.57
Copper - 14.2
Lead - 5.54
Nickel - 5.23
Vanadium - 13.6
Zinc - 20.0

TMW-32-4'
Aluminum - 8,050
Barium - 54.3
Chromium - 16.7
Copper - 8.63
Lead - 6.69
Nickel - 5.12
Vanadium - 19.4
Zinc - 65.6

TMW-28-5'
Aluminum - 20,500
Barium - 122
Cadmium - 0.59
Chromium - 54.3
Cobalt - 9.61
Copper - 52.8
Lead - 127
Nickel - 18.2
Vanadium - 104
Zinc - 1,120
Mercury - 0.627

TMW-31-4'
Aluminum - 15,300
Barium - 52.2
Chromium - 29.1
Cobalt - 3.75
Copper - 18.3
Lead - 12.5
Nickel - 6.66
Vanadium - 53.7
Zinc - 21.4

TMW-27-4'
Aluminum - 30,200
Barium - 97.0
Chromium - 58.7
Cobalt - 7.63
Copper - 36.9
Lead - 25.2
Nickel - 11.6
Vanadium - 110
Zinc - 88.1

TMW-30-8'
Aluminum - 22,100
Barium - 78.3
Chromium - 35.7
Cobalt - 4.79
Copper - 26.7
Lead - 21.0
Nickel - 14.3
Vanadium - 73.4
Zinc - 43.3

TMW-26-10'
Aluminum - 26,500
Barium - 225
Chromium - 47.0
Cobalt - 11.9
Copper - 37.2
Lead - 19.6
Nickel - 25.6
Vanadium - 93.7
Zinc - 99.6

TMW-25-5'
Aluminum - 20,600
Barium - 150
Chromium - 93.7
Cobalt - 10.6
Copper - 83.0
Lead - 108
Nickel - 21.3
Vanadium - 88.1
Zinc - 396
Mercury - 0.280

TMW-19-(4-5')
Aluminum - 26,400
Barium - 227
Chromium - 45.4
Cobalt - 28.0
Copper - 2.68
Lead - 12.1
Nickel - 35.0
Vanadium - 62.7
Zinc - 104

TMW-19-(14-15')
Aluminum - 25,200
Barium - 265
Chromium - 48.0
Cobalt - 17.1
Copper - 1.40
Lead - 12.4
Nickel - 30.1
Vanadium - 63.1
Zinc - 114

TMW-17-(4-5')
Aluminum - 14,000
Barium - 398
Chromium - 104
Cobalt - 46.4
Copper - 43.0
Lead - 46.9
Nickel - 62.3
Vanadium - 159
Zinc - 252
Mercury - 0.180

TMW-17-(14-15')
Aluminum - 23,900
Barium - 257
Chromium - 64.5
Cobalt - 25.8
Copper - 16.2
Lead - 17.5
Nickel - 42.0
Vanadium - 81.6
Zinc - 162

TMW-18-(4-5')
Aluminum - 16,500
Barium - 107
Chromium - 48.6
Cobalt - 34.1
Copper - 57.5
Lead - 12.6
Nickel - 39.3
Vanadium - 80.7
Zinc - 137

TMW-18-(14-15')
Aluminum - 13,800
Barium - 162
Chromium - 47.8
Cobalt - 56.0
Copper - 132
Lead - 33.6
Nickel - 35.3
Vanadium - 111
Zinc - 126

TMW-24-5'
Aluminum - 21,300
Barium - 83.3
Chromium - 185
Cobalt - 6.77
Copper - 34.0
Lead - 22.6
Nickel - 10.3
Vanadium - 103
Zinc - 126

TMW-23-4'
Aluminum - 31,100
Barium - 196
Chromium - 74.7
Cobalt - 12.3
Copper - 78.5
Lead - 331
Nickel - 26.6
Vanadium - 106
Zinc - 302
Mercury - 0.246

TMW-22-3'
Aluminum - 17,500
Barium - 74.2
Chromium - 42.0
Cobalt - 9.17
Copper - 21.5
Lead - 24.4
Nickel - 8.42
Vanadium - 57.7
Zinc - 133


TMW-29-5'
Aluminum - 16,600
Barium - 53.7
Chromium - 110
Cobalt - 5.11
Copper - 39.1
Lead - 26.1
Nickel - 11.3
Vanadium - 55.9
Zinc - 232


TMW-29-7'
Aluminum - 6,630
Barium - 31.5
Chromium - 20.1
Cobalt - 3.18
Copper - 13.1
Lead - 48.4
Nickel - 4.64
Vanadium - 20.8
Zinc - 179




FIGURE NO

J-7K

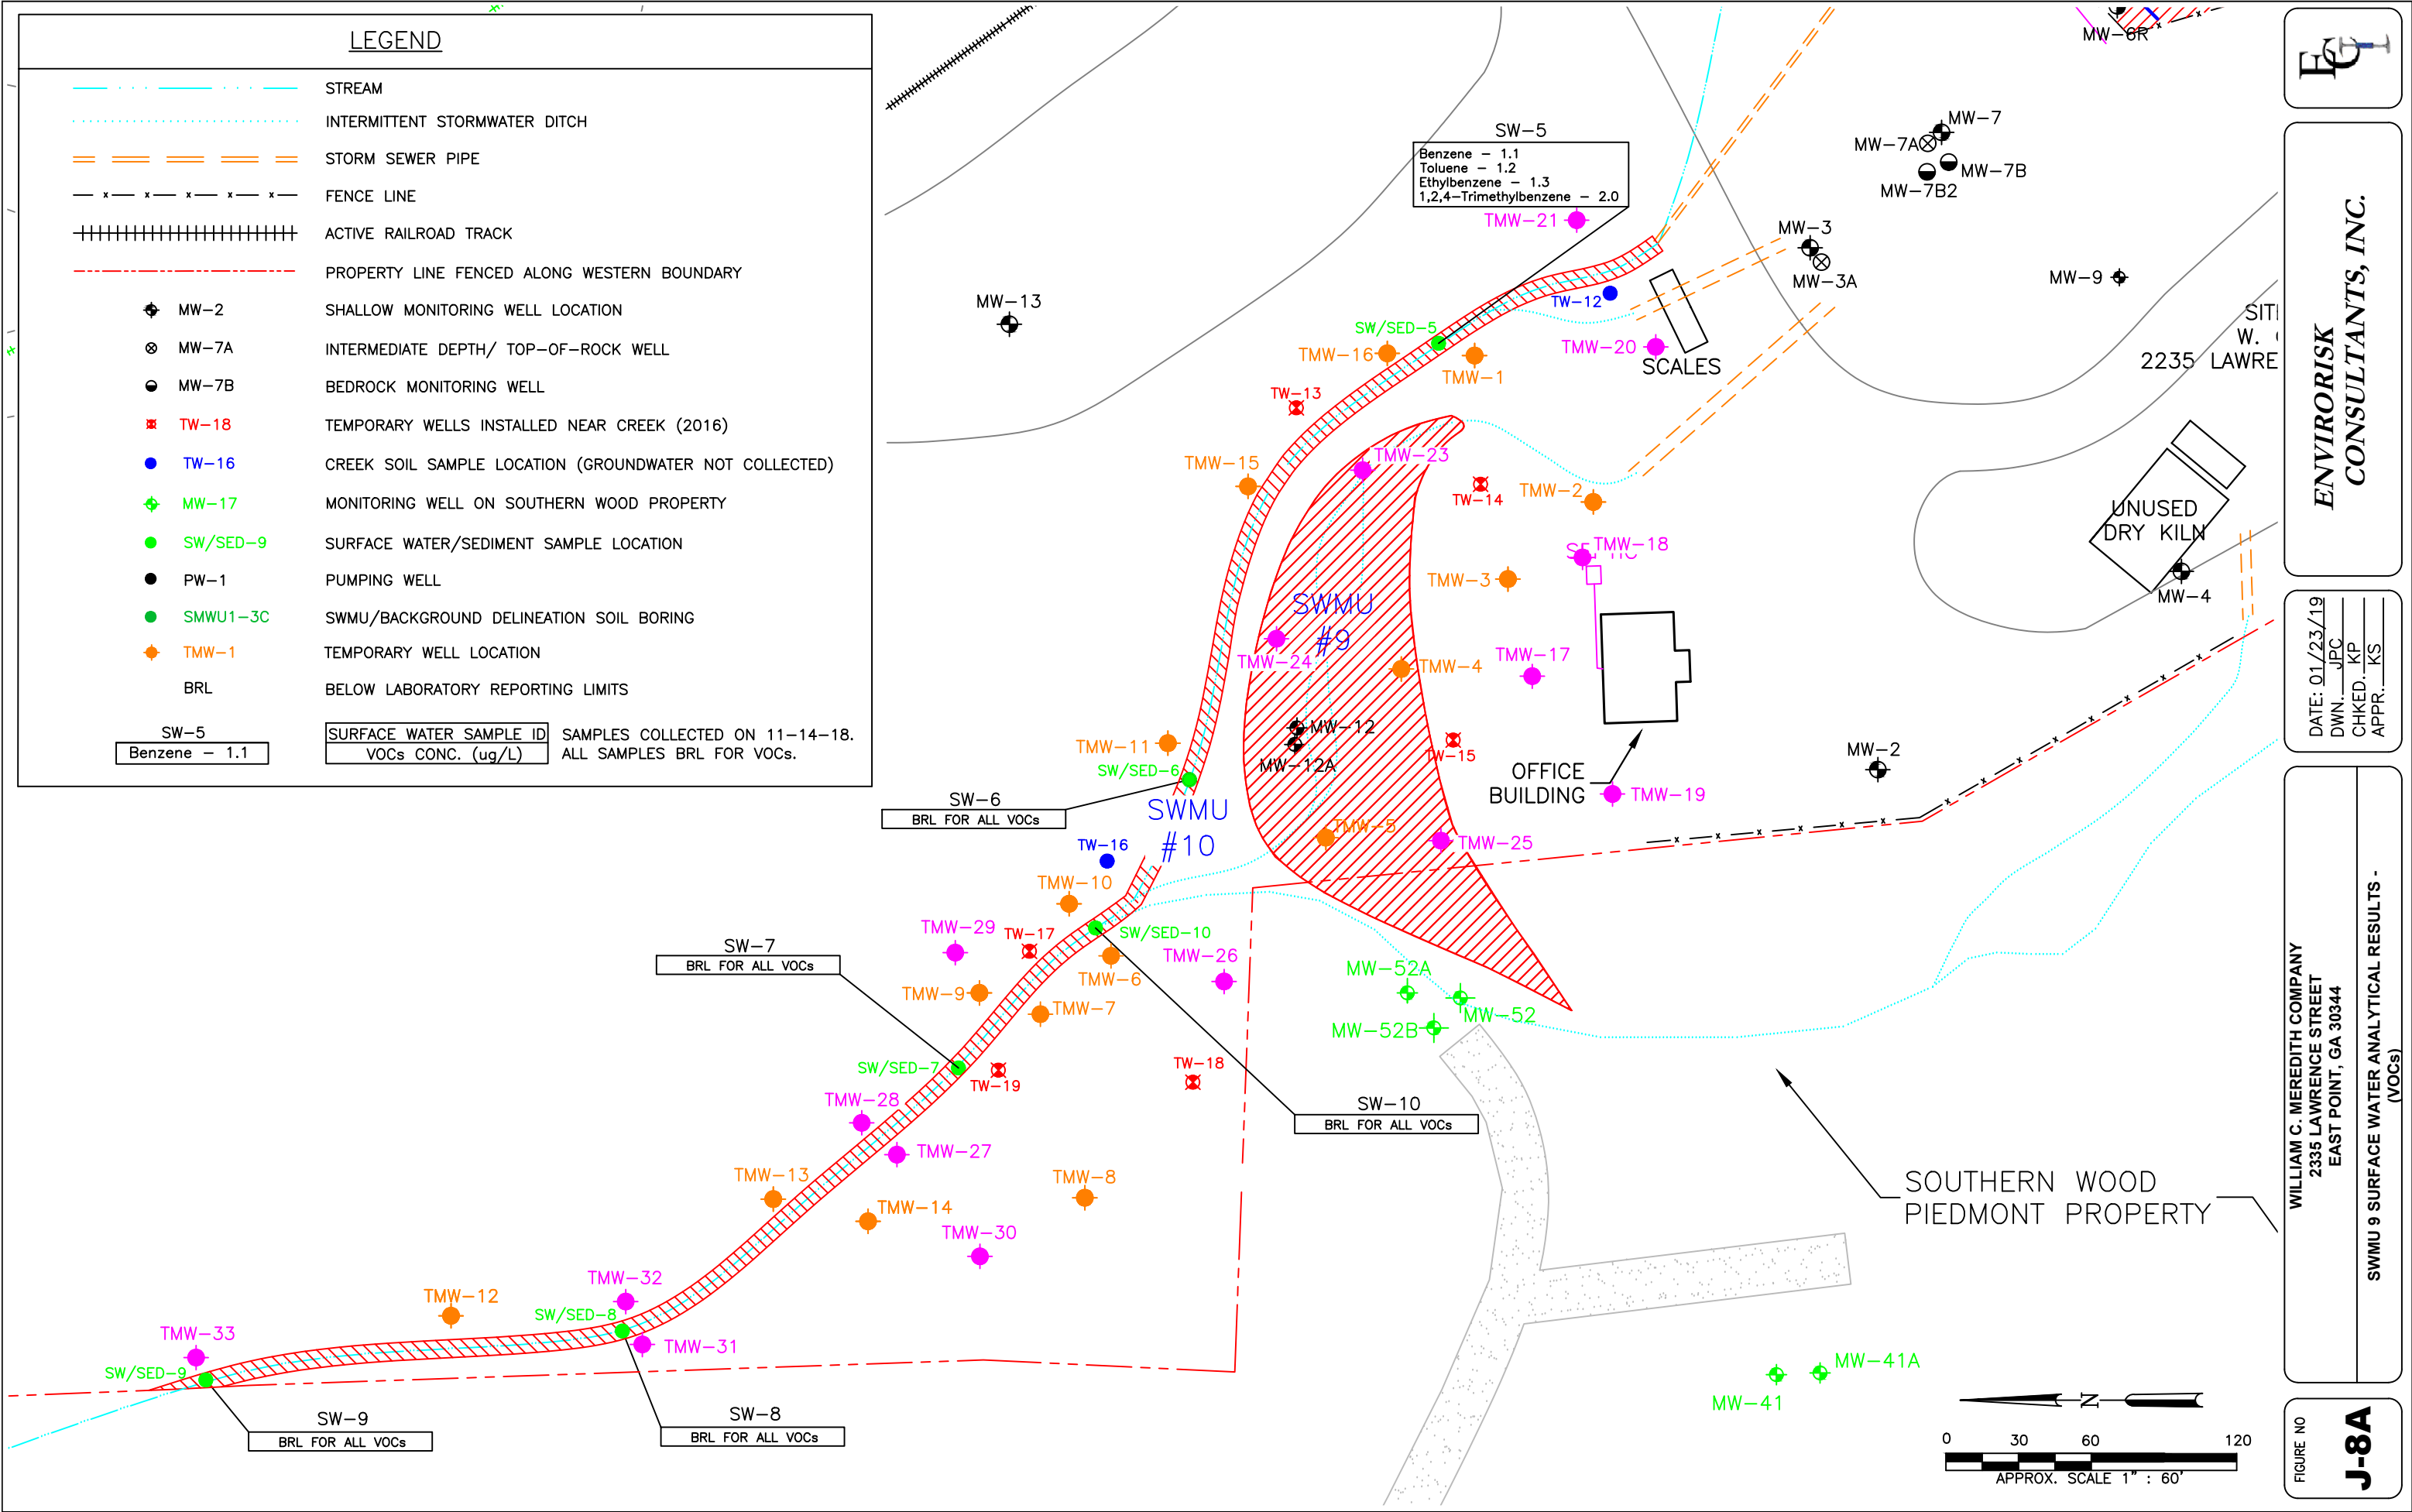

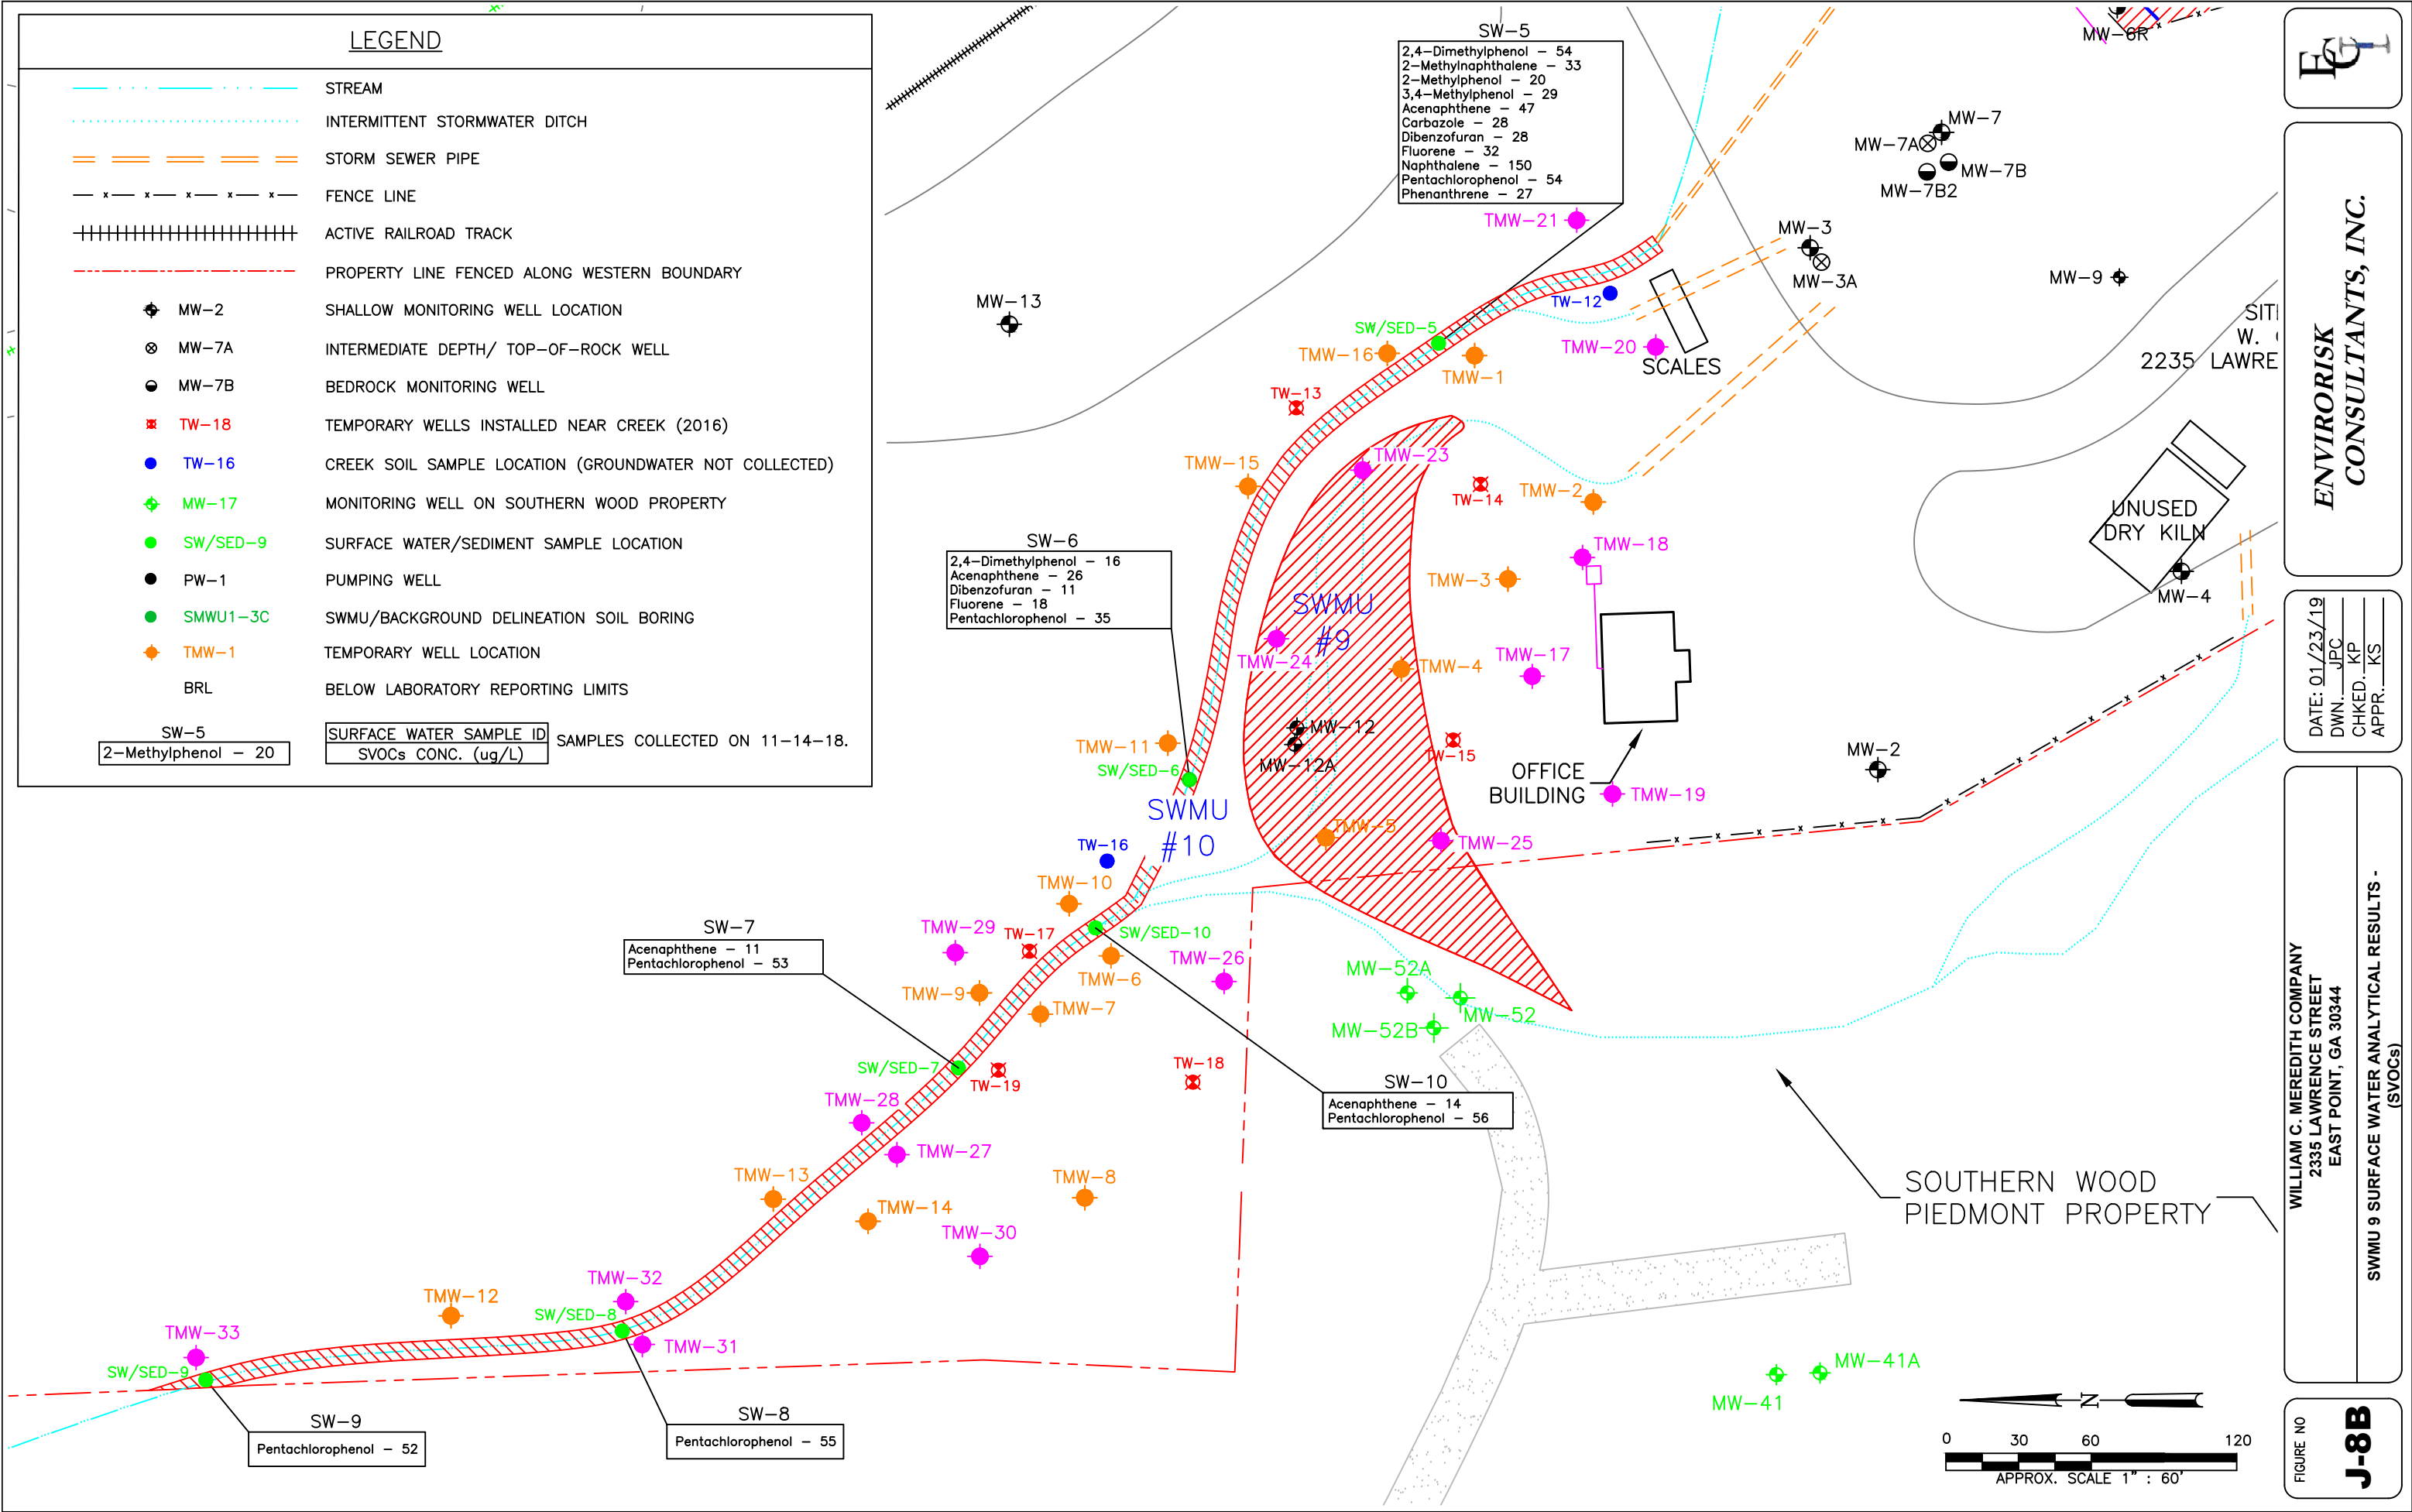

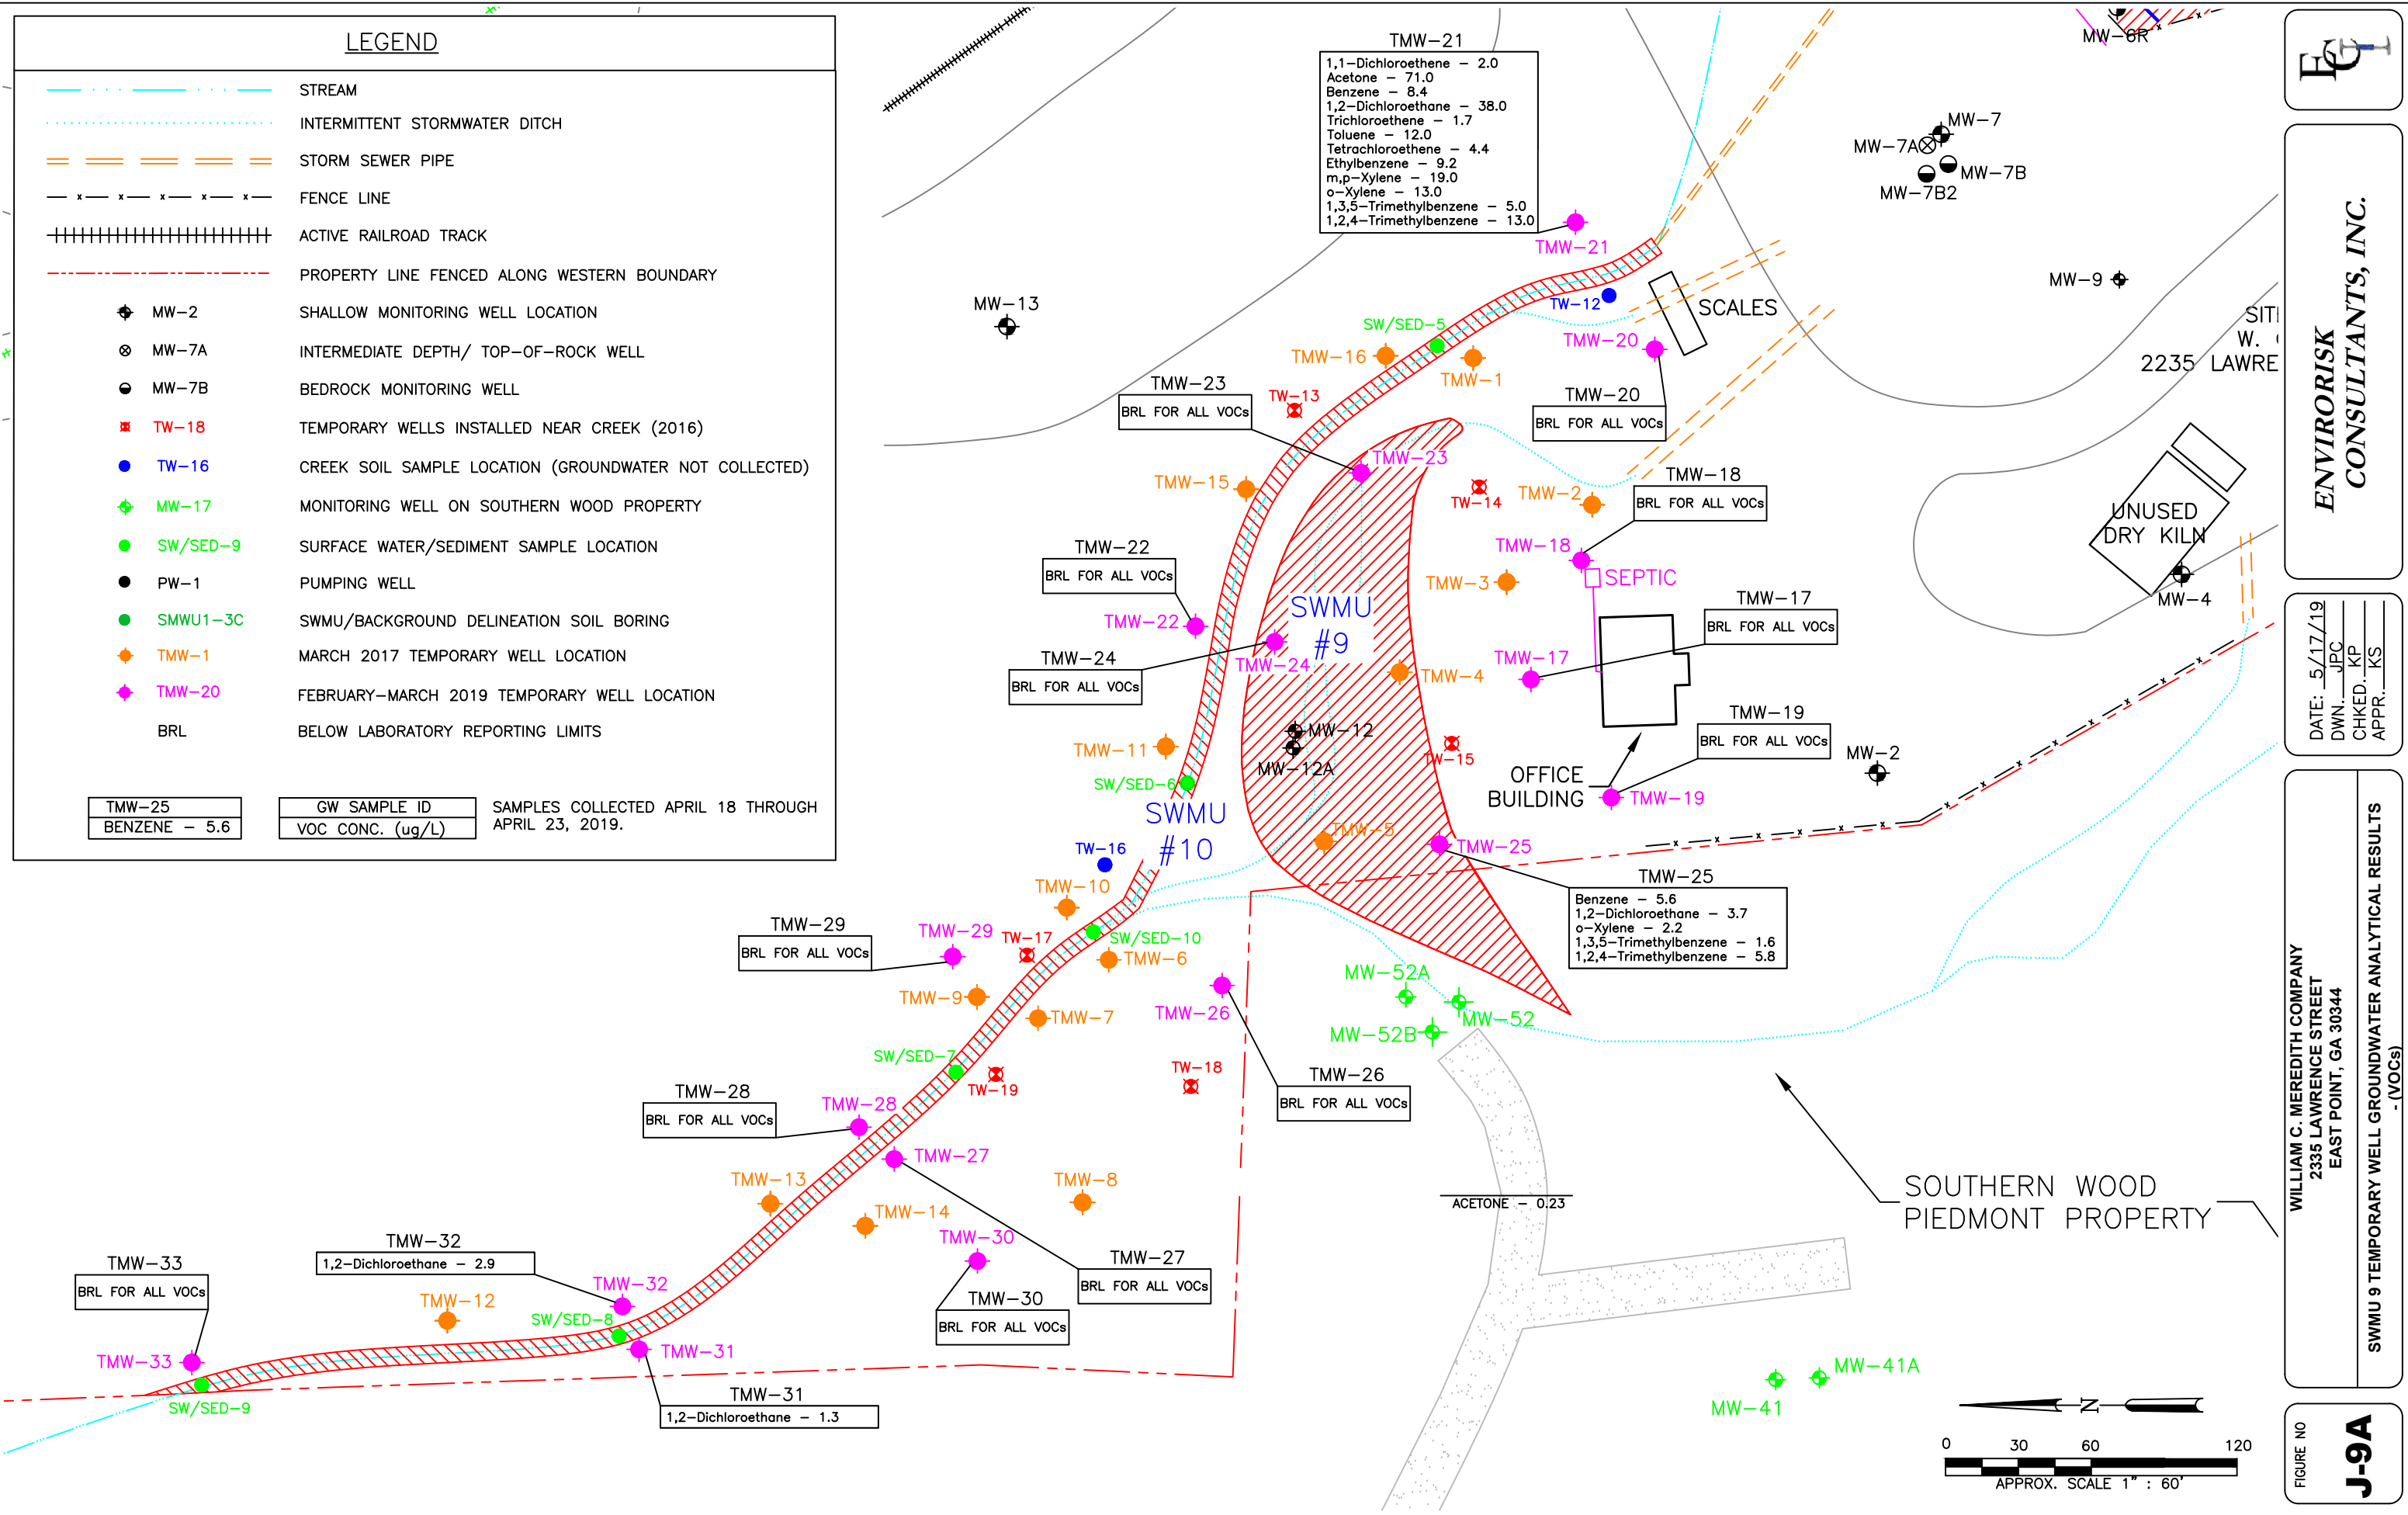

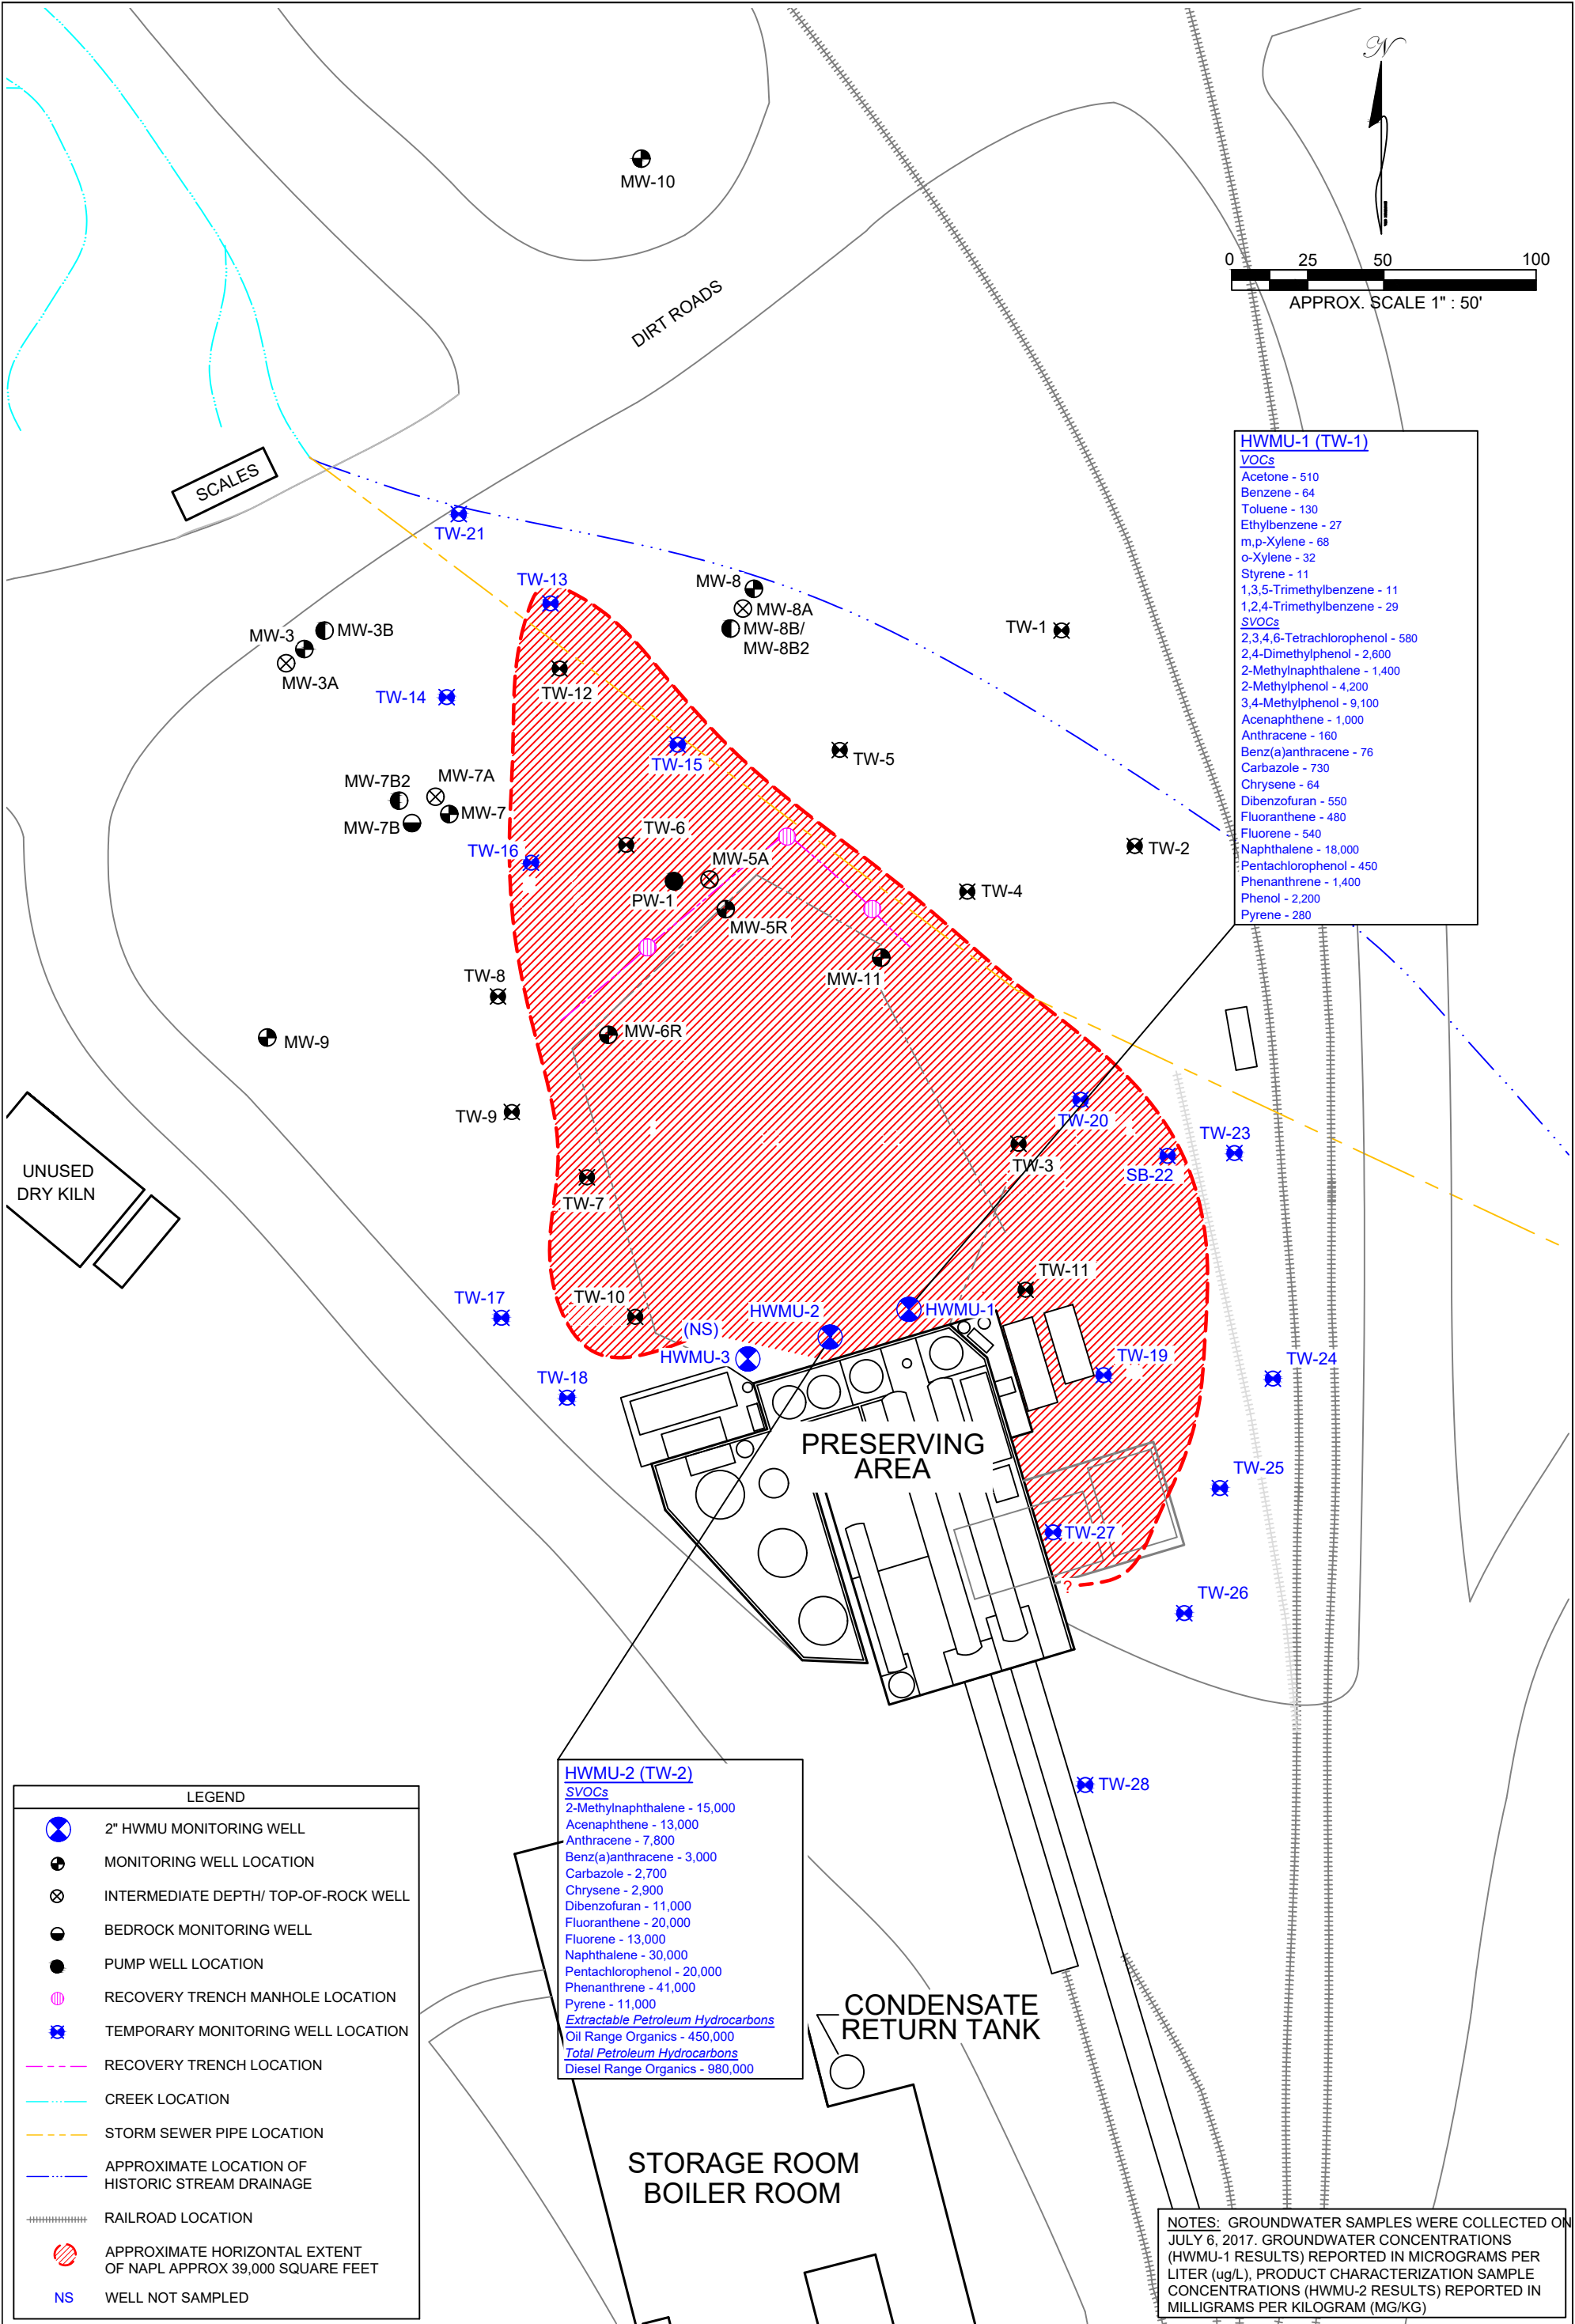


FIGURE NO

J-10

WILLIAM C. MEREDITH COMPANY
2335 LAWRENCE STREET
EAST POINT, GA 30344

IMPOUNDMENT ASSESSMENT GROUNDWATER AND PRODUCT
CHARACTERIZATION ANALYTICAL RESULTS

DATE: 9/29/21
DWN. JPC
CHKD. KCS
APPR. KCS

ENVIRORISK
CONSULTANTS, INC.



